

KING COUNTY HOUSING AUTHORITY  
LEAD-BASED PAINT TESTING REPORT

TABLE OF CONTENTS

PROJECT NO: WA2-08

AVONDALE MANOR

<u>ITEMS</u>	<u>PAGE</u>
COVER LETTER	1
REPORT DESCRIPTION	2
STATISTICAL SUMMARY	
Living Room	4
Dining Room	4
Bedroom	5
Hall	5
Bathroom	5
Kitchen	5
Staircase	6
Utility	6
Deck	6
Closet	7
Exterior	7
FREQUENCY DISTRIBUTION GRAPHS	
Living Room	9
Dining Room	11
Bedroom	14
Hall	15
Bathroom	16
Kitchen	18
Staircase	19
Utility	20
Deck	23
Closet	24
Exterior	27
REPORT ABBREVIATIONS	33
EXECUTIVE SUMMARY	34
DETAIL REPORT	37

## LEAD IN PAINT TEST RESULTS

Page 1

AGENCY: King County Housing Authority  
15455 65th Ave., S.  
Seattle, WA 98104

PROJECT NAME: Avondale Manor

PROJECT NO.: WA2-08

TEST DATE: September 15, 1993

REQUIREMENTS: Housing and Urban Development and Congressional Federal  
Registry 24 (CFR 24) limits (action limit of 1.0 mg Pb/cm<sup>2</sup>) and all  
subsequent revisions.

TEST CATEGORY: X-Ray Fluorescence Spectrum Analysis.

REPORT MEDIUM: mg Pb/cm<sup>2</sup> (milligrams of lead per centimeter squared).

INSTRUMENTATION: Scitec Corporation Model: MAP-3 XRF.  
Spectrum Analyzer Serial No: AS-273.  
AS-057.  
AG-041.

CALIBRATION: As per manufacturers recommendations.

OPERATORS LICENSE: ORE-0538-1.  
Technician: Lyle Cummings.  
David Fowell.  
William Vandervort.

I hereby certify that to the best of my knowledge and capabilities, the following report  
reflects the true lead content of the painted surfaces at the above project.



Patrick J. Lehne  
General Manager  
American Environmental Services, Inc.  
2610 S.E. Clinton St. Suite E  
Portland, OR. 97202


10-5-93  
Date

The following pages contain four types of reports:

1. *Statistical Report:* The project broken-down into the individual building components. The "Apparent Lead Concentration" (ALC), "Corrected Lead Concentration" (CLC) and "Substrate Equivalent Lead" (SEL), if any, is reported here. These categories are further broken into "Positive, Negative, and Inconclusive" counts and percentages. Also, the "Standard Deviation" is listed at the far right.
2. *Frequency Distribution Report:* Each of these graphs represents a single building component, i.e. "Living Room Walls Lower" or "Hallway Door Casing" etc. The graphs show the frequency at which each component tested at the various lead levels.
3. *Summary Report:* This section is meant as a quick glance area which allows the reader to discover if the project contains abateable lead. It is separated by apartment or unit number. Building components with an apparent lead (Pb) concentration of 1.0 mg/cm<sup>2</sup> or greater are listed.
4. *Detail Report:* This is the hard data which supplies the other three reports and lists each test taken. It is broken down by unit, room type, room location, building component type, and location. Unusual substrate types, paint condition, spectrum assay numbers, and comments are also reported here.

*Report Drawings:* Under normal conditions unit drawings will not be supplied. If a unit is too complex to report with the system listed below, unit and room drawings will be included as a supplement.

*Detail Reporting System:* Room locations are given only if there are two or more of a particular type. The most common are bedrooms and bathrooms. A code of up to three letters can be used to locate the room. The simplest example would be a three bedroom, single story unit as shown below. In the detail report these bedrooms would have locations of "FR" (front right), "RR" (rear right), and "RL" (rear left). If the unit were a multi-story, the third letter code would be added for upper and lower floors.

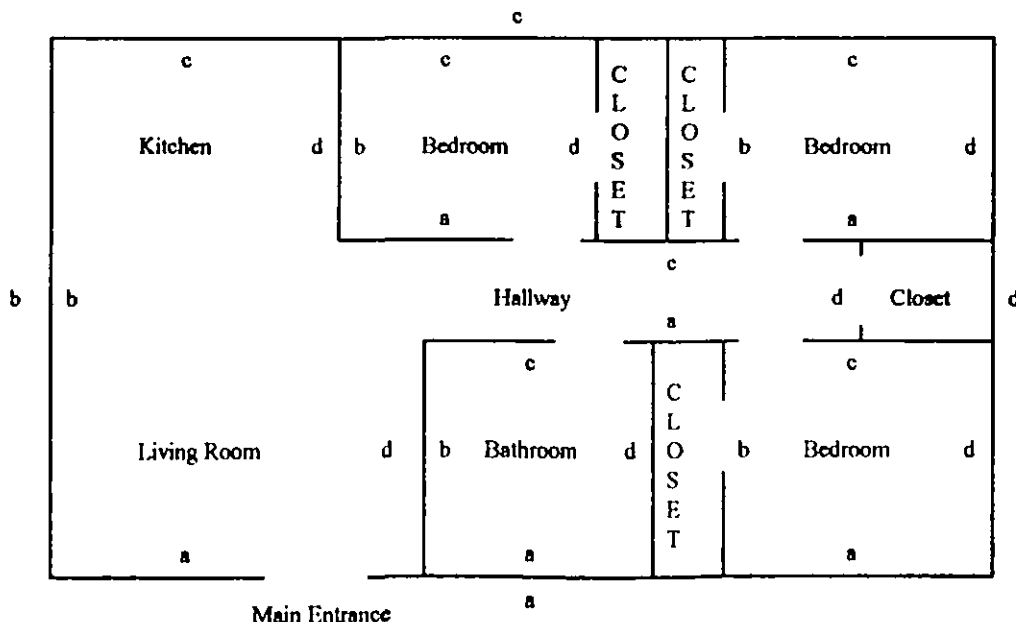

The main entrance of the unit is a key by which all building components are located. This eliminates the need for any reference to North/South/East/West directions, or any other point in the project or building. This main entrance wall is listed as the "A" wall in the "Side" field of the detail report. Moving clockwise to the "B, C, & D" walls, respectively. The "A" wall of each room, area, or closet is the same as the main entrance.

A building component is first located by the wall it is on, then by where it appears on the wall (left, center, right). A third code letter can be used for upper and lower, if needed. In the sample above, the hallway door casing leading to the rear left bedroom would be reported as "CL" (C wall, left) in the side field of the detail report.

Statistical Report  
American Environmental Services, Inc.

Project Number: WA2-08	Specification File: SWA2-08
Project Name: Avondale Manor Apartments	
Organization: King County Housing Authority	
Address: 15455 65th Ave. S. Seattle, WA 98104	Lead Concentration Ranges:
File Number :	Negative: 0.0-0.7
Test Date(s): 9/15/93	Inconclusive: 0.8-1.2
	Positive: >1.2

Spec#	Component Description	POS CNT	%	INC CNT	%	NEG CNT	%
0111	AAA Living Room - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	20	100%
	Corrected Lead Conc.	0	0%	0	0%	20	100%
	Total Count = 20					Standard Deviation =	0.1
0131	ACA Living Room - Window Sills						
	Apparent Lead Conc.	0	0%	0	0%	16	100%
	Corrected Lead Conc.	0	0%	0	0%	16	100%
	Total Count = 16					Standard Deviation =	0.1
0192	AIB Living Room - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	20	100%
	Corrected Lead Conc.	0	0%	0	0%	20	100%
	Total Count = 20					Standard Deviation =	0.1
0211	BAA Dining Room - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19					Standard Deviation =	0.1
0221	BBA Dining Room - Doors						
	Apparent Lead Conc.	11	58%	0	0%	8	42%
	Corrected Lead Conc.	11	58%	0	0%	8	42%
	Total Count = 19					Standard Deviation =	0.9
0222	BBB Dining Room - Door Casings						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19					Standard Deviation =	0.2
0231	✓ BCA Dining Room - Window Sills - UP						
	Apparent Lead Conc.	5	23%	0	0%	17	77%
	Corrected Lead Conc.	5	23%	0	0%	17	77%
	Total Count = 22					Standard Deviation =	0.7
0232	✓ BCA Dining Room - Window Sills - LOW						
	Apparent Lead Conc.	8	27%	0	0%	22	73%
	Corrected Lead Conc.	8	27%	0	0%	22	73%
	Total Count = 30					Standard Deviation =	0.8
0292	BIB Dining Room - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19					Standard Deviation =	0.1

Statistical Report  
American Environmental Services, Inc.

Project Number: WA2-08

Specification File: SWA2-08

Spec#	Component Description	POS CNT	%	INC CNT	%	NEG CNT	%
0311	CAA Bedroom - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	61	100%
	Corrected Lead Conc.	0	0%	0	0%	61	100%
	Total Count = 61					Standard Deviation =	0.1
0331	CCA Bedroom - Window Sills						
	Apparent Lead Conc.	0	0%	0	0%	55	100%
	Corrected Lead Conc.	0	0%	0	0%	55	100%
	Total Count = 55					Standard Deviation =	0.1
0392	CIB Bedroom - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	60	100%
	Corrected Lead Conc.	0	0%	0	0%	60	100%
	Total Count = 60					Standard Deviation =	0.1
0411	DAA Hall - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	21	100%
	Corrected Lead Conc.	0	0%	0	0%	21	100%
	Total Count = 21					Standard Deviation =	0.1
0492	DIB Hall - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	23	100%
	Corrected Lead Conc.	0	0%	0	0%	23	100%
	Total Count = 23					Standard Deviation =	0.2
0511	FAA Bathroom - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	26	100%
	Corrected Lead Conc.	0	0%	0	0%	26	100%
	Total Count = 26					Standard Deviation =	0.2
0531	FCA Bathroom - Window Sills						
	Apparent Lead Conc.	0	0%	0	0%	5	100%
	Corrected Lead Conc.	0	0%	0	0%	5	100%
	Total Count = 5					Standard Deviation =	0.0
0592	FIB Bathroom - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	25	100%
	Corrected Lead Conc.	0	0%	0	0%	25	100%
	Total Count = 25					Standard Deviation =	0.1
0611	GAA Kitchen - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19					Standard Deviation =	0.1
0692	GIB Kitchen - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19					Standard Deviation =	0.1

Statistical Report  
American Environmental Services, Inc.

Project Number: WA2-08

Specification File: SWA2-08

Spec#	Component Description	POS CNT	%	INC CNT	%	NEG CNT	%
0700	GIJ Kitchen - Fuse Box						
	Apparent Lead Conc.	0	0%	0	0%	16	100%
	Corrected Lead Conc.	0	0%	0	0%	16	100%
	Total Count = 16						Standard Deviation = 0.1
0811	EAA Staircase - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	20	100%
	Corrected Lead Conc.	0	0%	0	0%	20	100%
	Total Count = 20						Standard Deviation = 0.1
0892	EIB Staircase - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	5	100%
	Corrected Lead Conc.	0	0%	0	0%	5	100%
	Total Count = 5						Standard Deviation = 0.2
1011	KAA Utility - Walls Lower						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19						Standard Deviation = 0.1
1021	KBA Utility - Doors						
	Apparent Lead Conc.	0	0%	0	0%	17	100%
	Corrected Lead Conc.	0	0%	0	0%	17	100%
	Total Count = 17						Standard Deviation = 0.1
1092	KIB Utility - Ceiling/Joist						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19						Standard Deviation = 0.1
1100	KIJ Utility - Shelf						
	Apparent Lead Conc.	0	0%	0	0%	5	100%
	Corrected Lead Conc.	0	0%	0	0%	5	100%
	Total Count = 5						Standard Deviation = 0.0
1101	KIJ Utility - Holder						
	Apparent Lead Conc.	0	0%	0	0%	9	100%
	Corrected Lead Conc.	0	0%	0	0%	9	100%
	Total Count = 9						Standard Deviation = 0.1
1102	KIJ Deck - Hand Rail						
	Apparent Lead Conc.	0	0%	0	0%	22	100%
	Corrected Lead Conc.	0	0%	0	0%	22	100%
	Total Count = 22						Standard Deviation = 0.1
1103	KIJ Deck - Support						
	Apparent Lead Conc.	0	0%	0	0%	21	100%
	Corrected Lead Conc.	0	0%	0	0%	21	100%
	Total Count = 21						Standard Deviation = 0.0

Statistical Report  
American Environmental Services, Inc.

Project Number: WA2-08

Specification File: SWA2-08

Spec#	Component Description	POS CNT	%	INC CNT	%	NEG CNT	%
1104	KIA Deck - Floor						
	Apparent Lead Conc.	0	0%	0	0%	9	100%
	Corrected Lead Conc.	0	0%	0	0%	9	100%
	Total Count =	9					0.1
1221	*DC All Closet Door						
	Apparent Lead Conc.	0	0%	0	0%	63	100%
	Corrected Lead Conc.	0	0%	0	0%	63	100%
	Total Count =	63					0.1
1241	*DA All Closet Walls						
	Apparent Lead Conc.	0	0%	0	0%	85	100%
	Corrected Lead Conc.	0	0%	0	0%	85	100%
	Total Count =	85					0.1
1246	*DF All Closet Shelves						
	Apparent Lead Conc.	0	0%	0	0%	53	100%
	Corrected Lead Conc.	0	0%	0	0%	53	100%
	Total Count =	53					0.1
1247	*DG All Closet Holders						
	Apparent Lead Conc.	0	0%	0	0%	57	100%
	Corrected Lead Conc.	0	0%	0	0%	57	100%
	Total Count =	57					0.1
1249	*DI All Closet Ceilings						
	Apparent Lead Conc.	0	0%	0	0%	74	100%
	Corrected Lead Conc.	0	0%	0	0%	74	100%
	Total Count =	74					0.2
1321	✓ IBA Exterior - Doors						
	Apparent Lead Conc.	12	57%	0	0%	9	43%
	Corrected Lead Conc.	12	57%	0	0%	9	43%
	Total Count =	21					1.4
1322	✓ IBB Exterior - Door Casings						
	Apparent Lead Conc.	1	5%	0	0%	20	95%
	Corrected Lead Conc.	1	5%	0	0%	20	95%
	Total Count =	21					0.4
1323	✓ IBC Exterior - Door Jambs						
	Apparent Lead Conc.	14	74%	0	0%	5	26%
	Corrected Lead Conc.	14	74%	0	0%	5	26%
	Total Count =	19					2.2
1325	IBE Exterior - Door Trim						
	Apparent Lead Conc.	0	0%	0	0%	14	100%
	Corrected Lead Conc.	0	0%	0	0%	14	100%
	Total Count =	14					0.2



Statistical Report  
American Environmental Services, Inc.



Project Number: WA2-08



Specification File: SWA2-08



Spec#	Component Description	POS CNT	%	INC CNT	%	NEG CNT	%
1332	ICB Exterior - Window Casings						
	Apparent Lead Conc.	0	0%	0	0%	19	100%
	Corrected Lead Conc.	0	0%	0	0%	19	100%
	Total Count = 19	Standard Deviation = 0.1					
1381	IHA Exterior - Siding						
	Apparent Lead Conc.	0	0%	0	0%	23	100%
	Corrected Lead Conc.	0	0%	0	0%	23	100%
	Total Count = 23	Standard Deviation = 0.1					
1382	IHB Exterior - Eaves						
	Apparent Lead Conc.	0	0%	0	0%	14	100%
	Corrected Lead Conc.	0	0%	0	0%	14	100%
	Total Count = 14	Standard Deviation = 0.1					
1384	IHD Exterior - Corner Trim						
	Apparent Lead Conc.	0	0%	0	0%	10	100%
	Corrected Lead Conc.	0	0%	0	0%	10	100%
	Total Count = 10	Standard Deviation = 0.0					
1387	IHG Exterior - Siding Upper Trim						
	Apparent Lead Conc.	0	0%	0	0%	20	100%
	Corrected Lead Conc.	0	0%	0	0%	20	100%
	Total Count = 20	Standard Deviation = 0.1					
1399	III Exterior - Fences						
	Apparent Lead Conc.	0	0%	0	0%	15	100%
	Corrected Lead Conc.	0	0%	0	0%	15	100%
	Total Count = 15	Standard Deviation = 0.1					
1400	KIA Deck - Floor						
	Apparent Lead Conc.	0	0%	0	0%	9	100%
	Corrected Lead Conc.	0	0%	0	0%	9	100%
	Total Count = 9	Standard Deviation = 0.1					





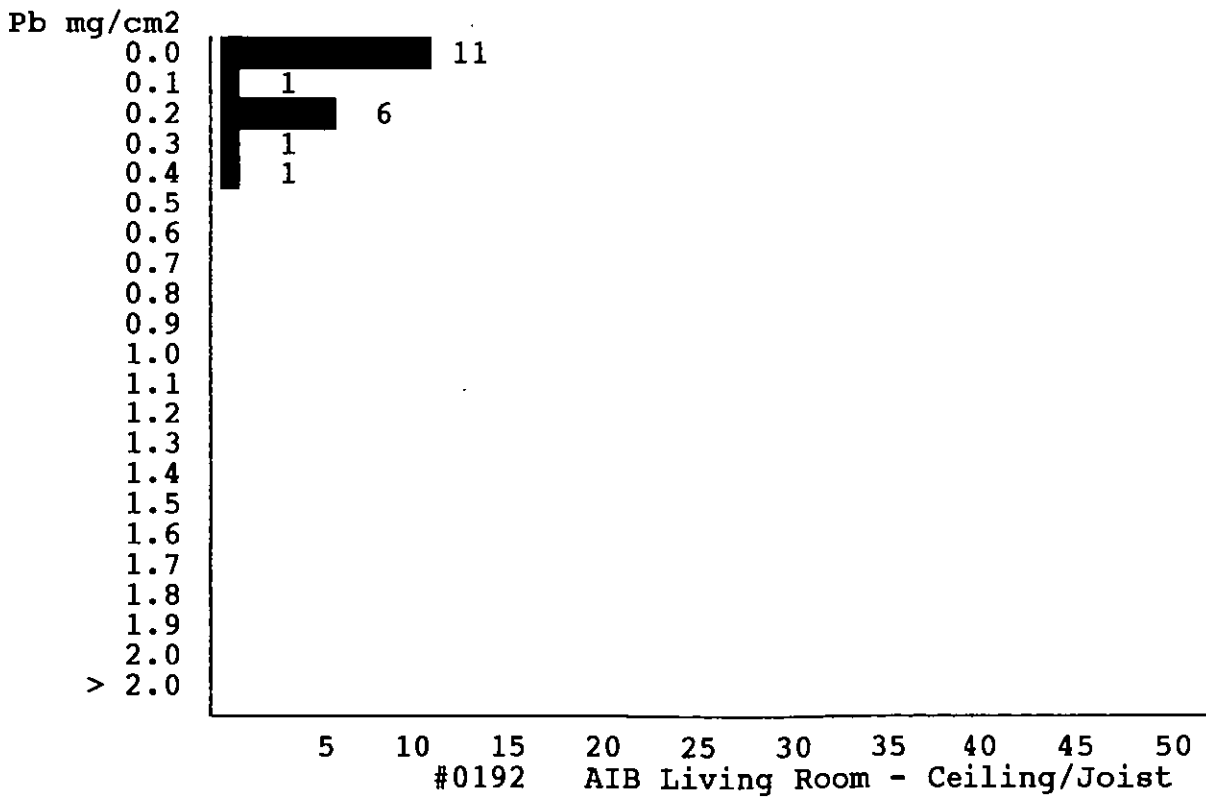
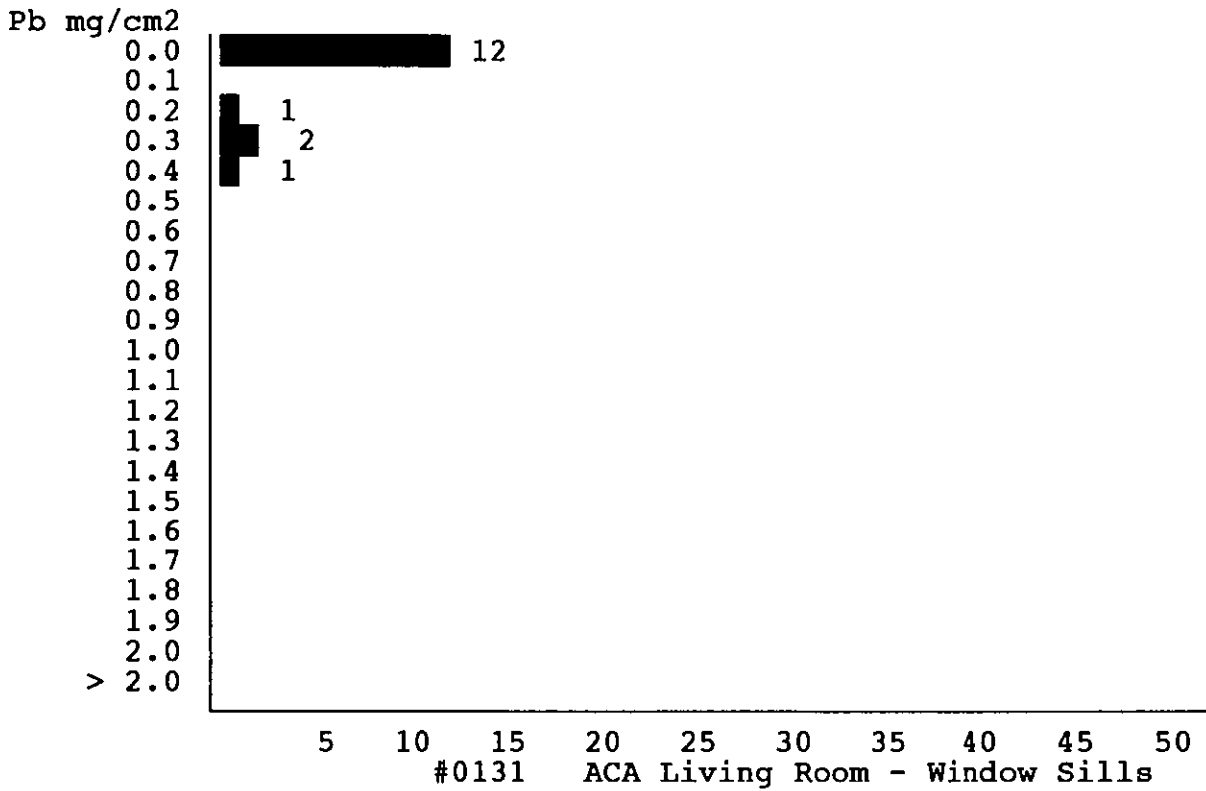


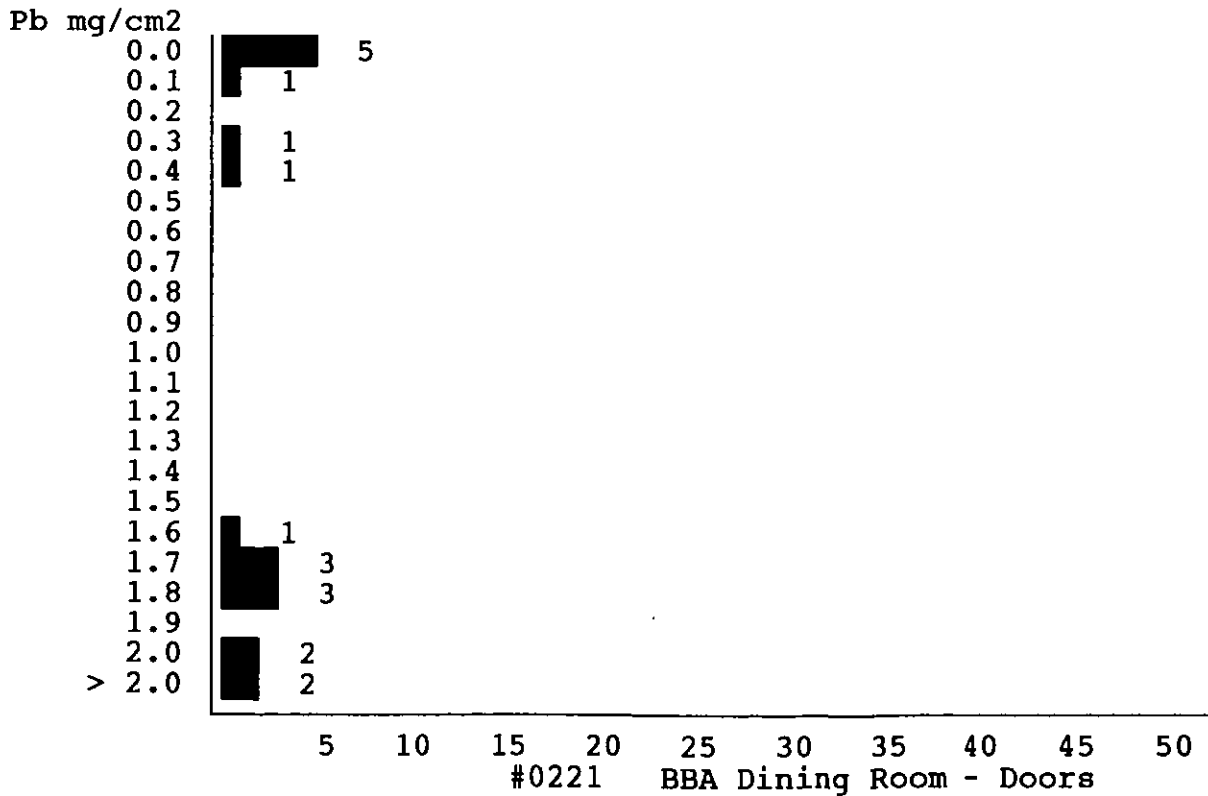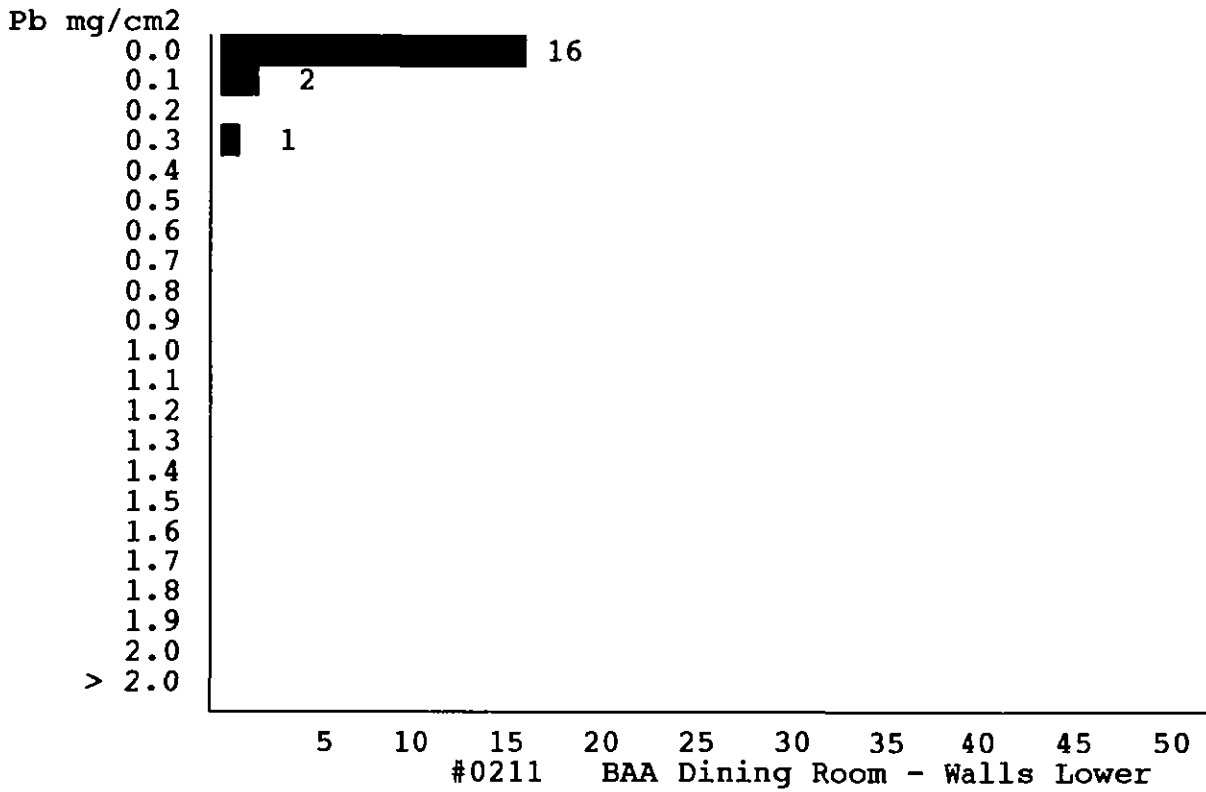

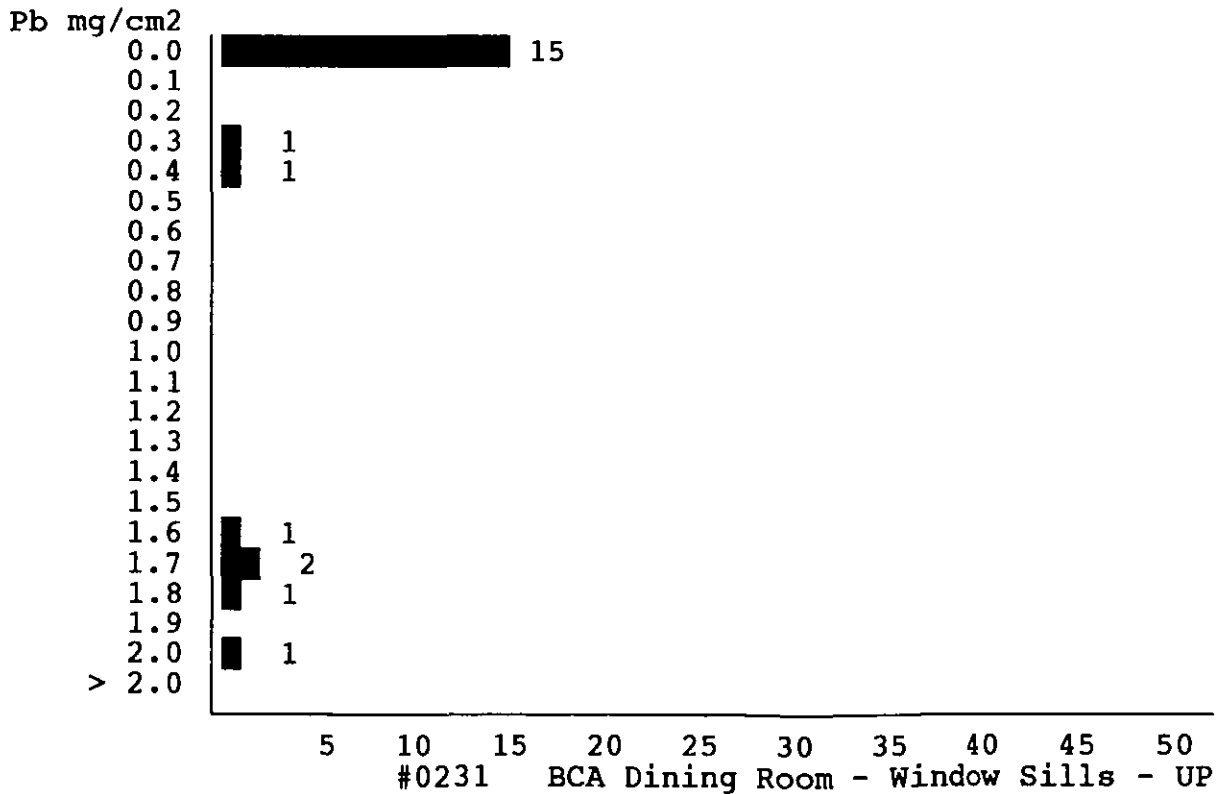
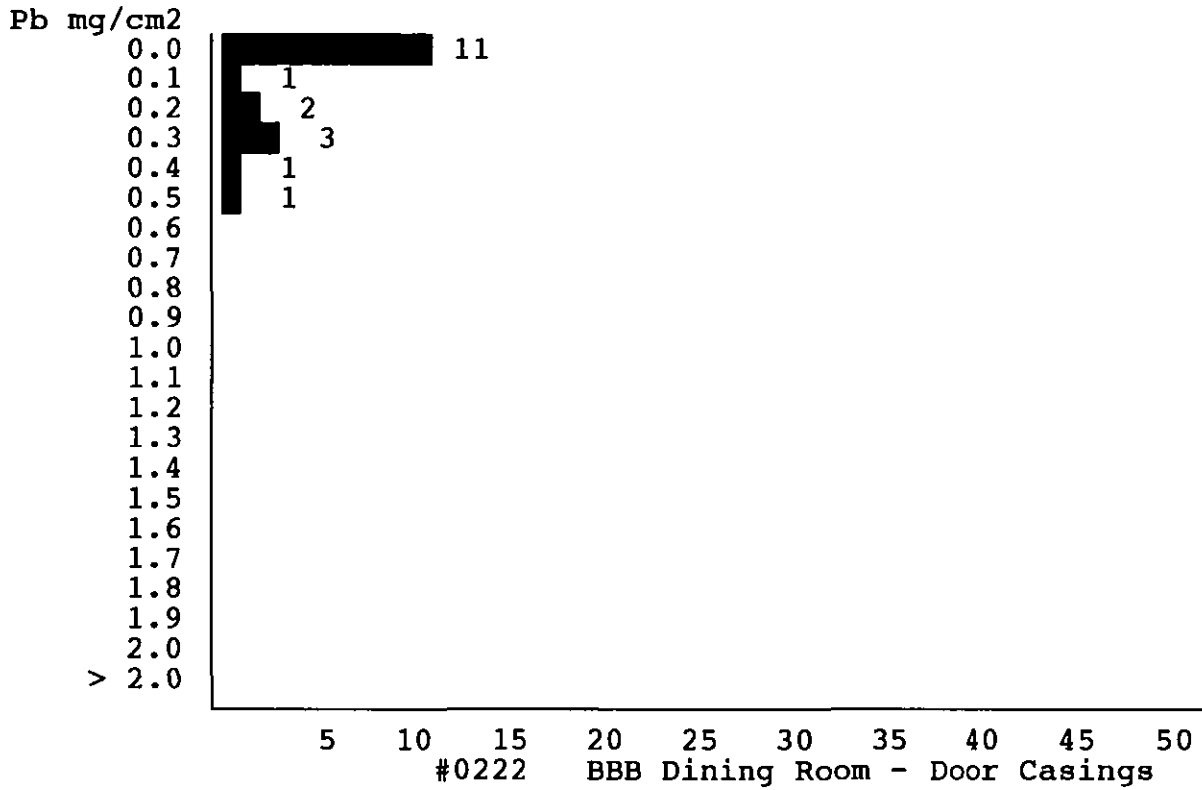


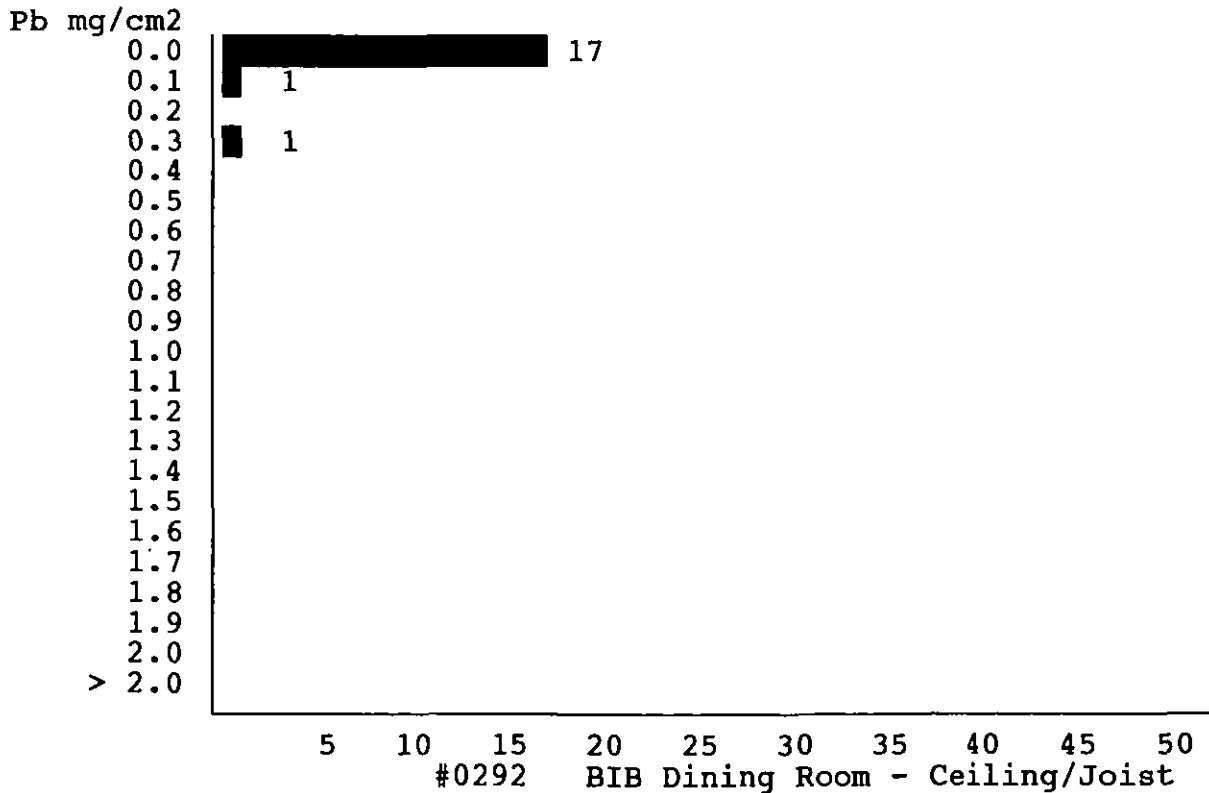
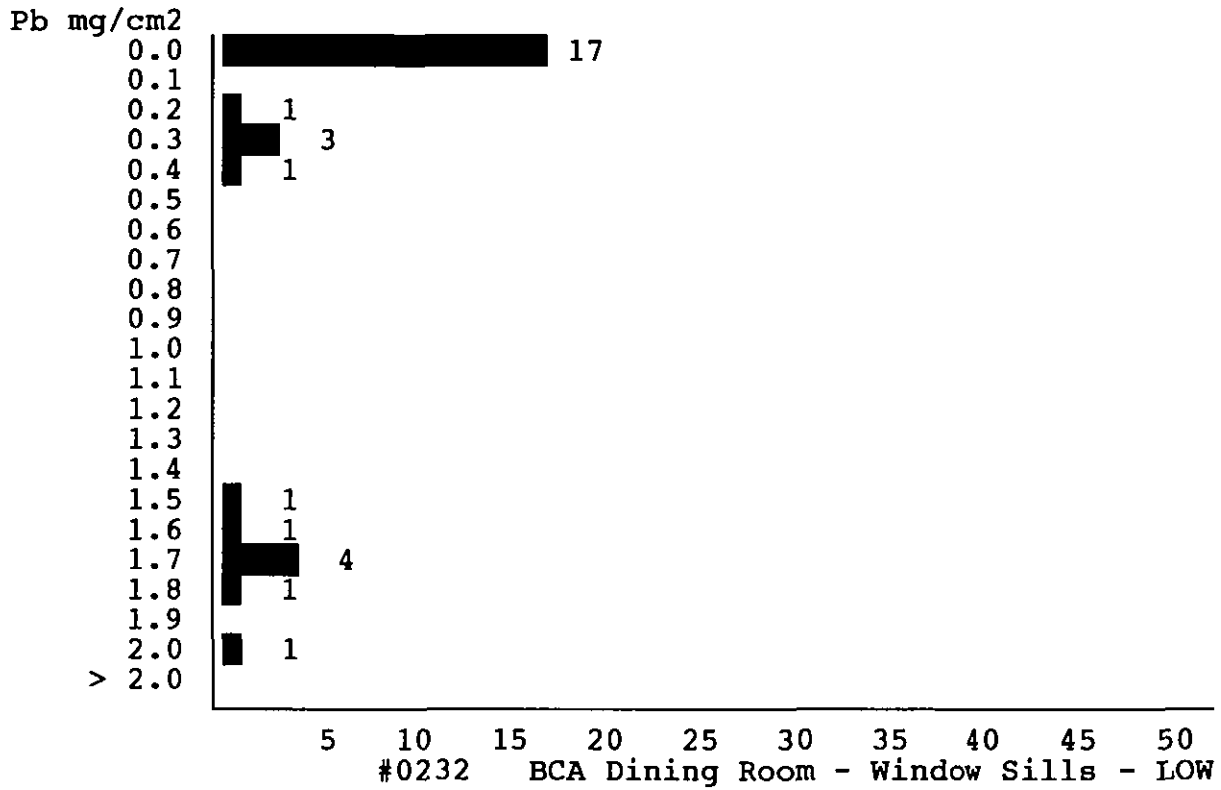


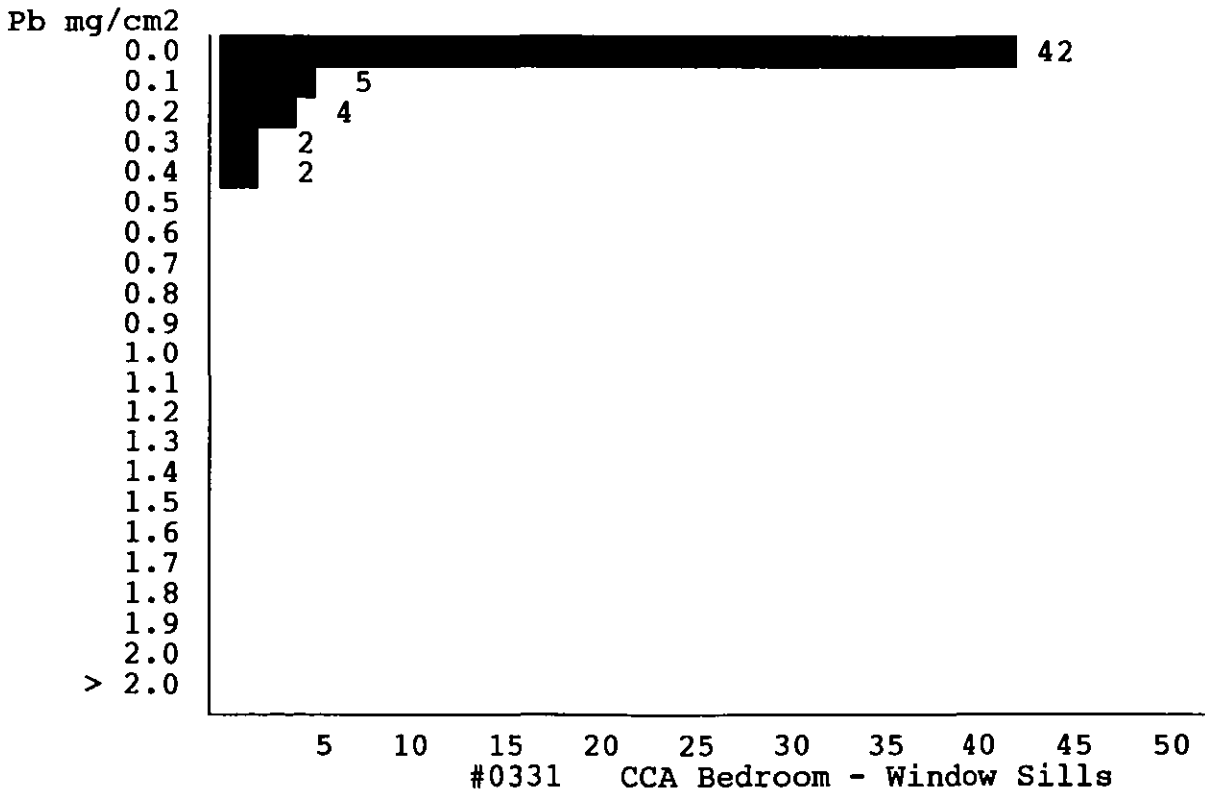
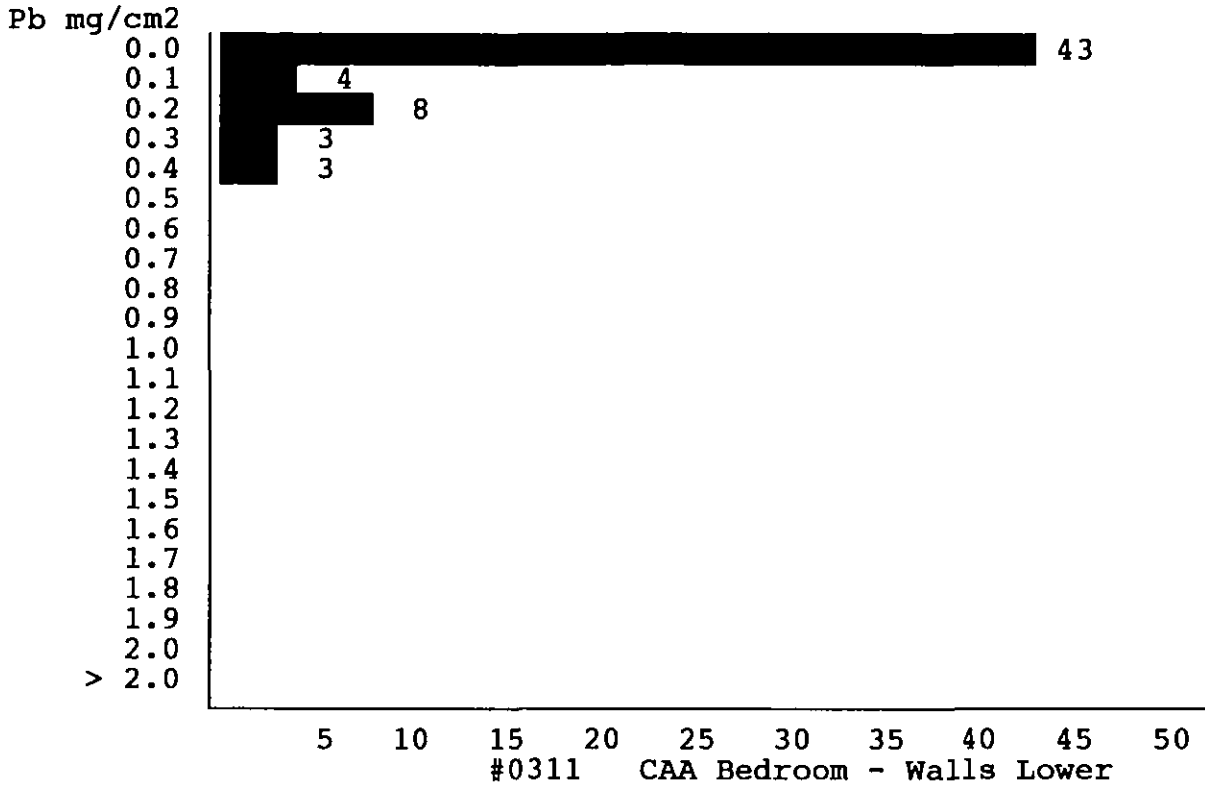


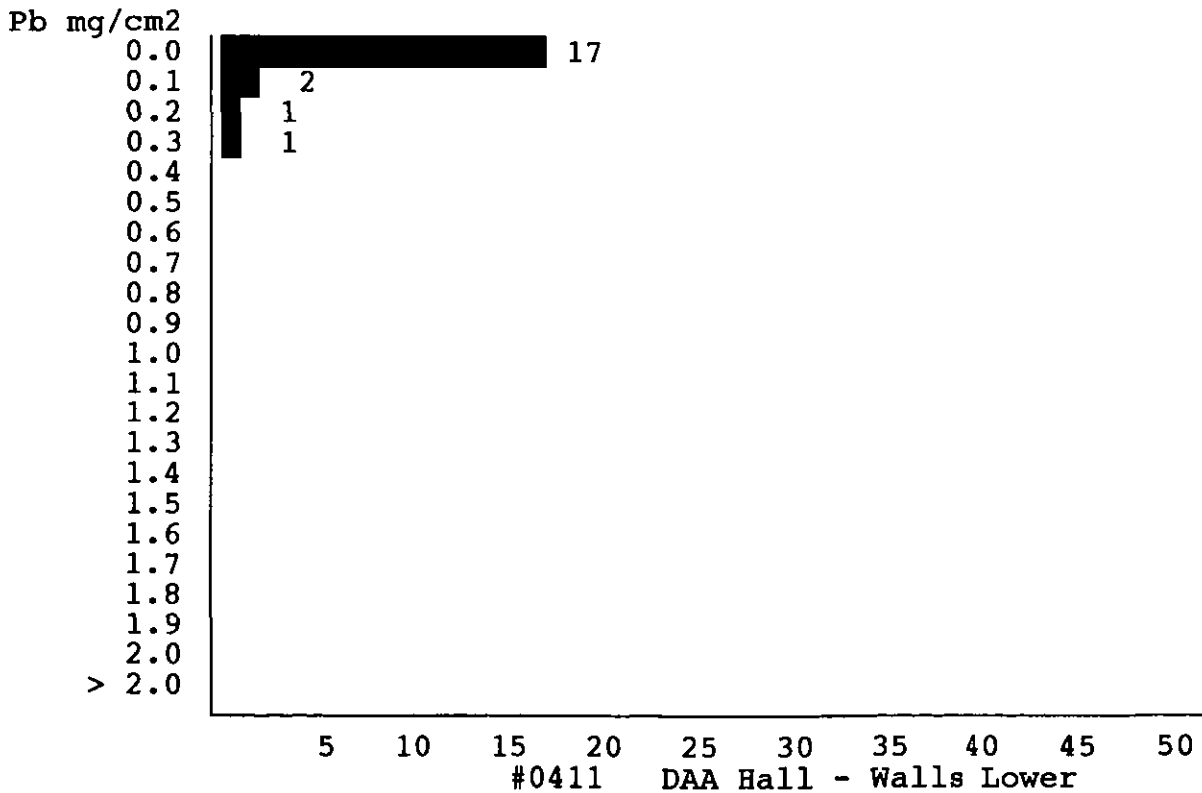
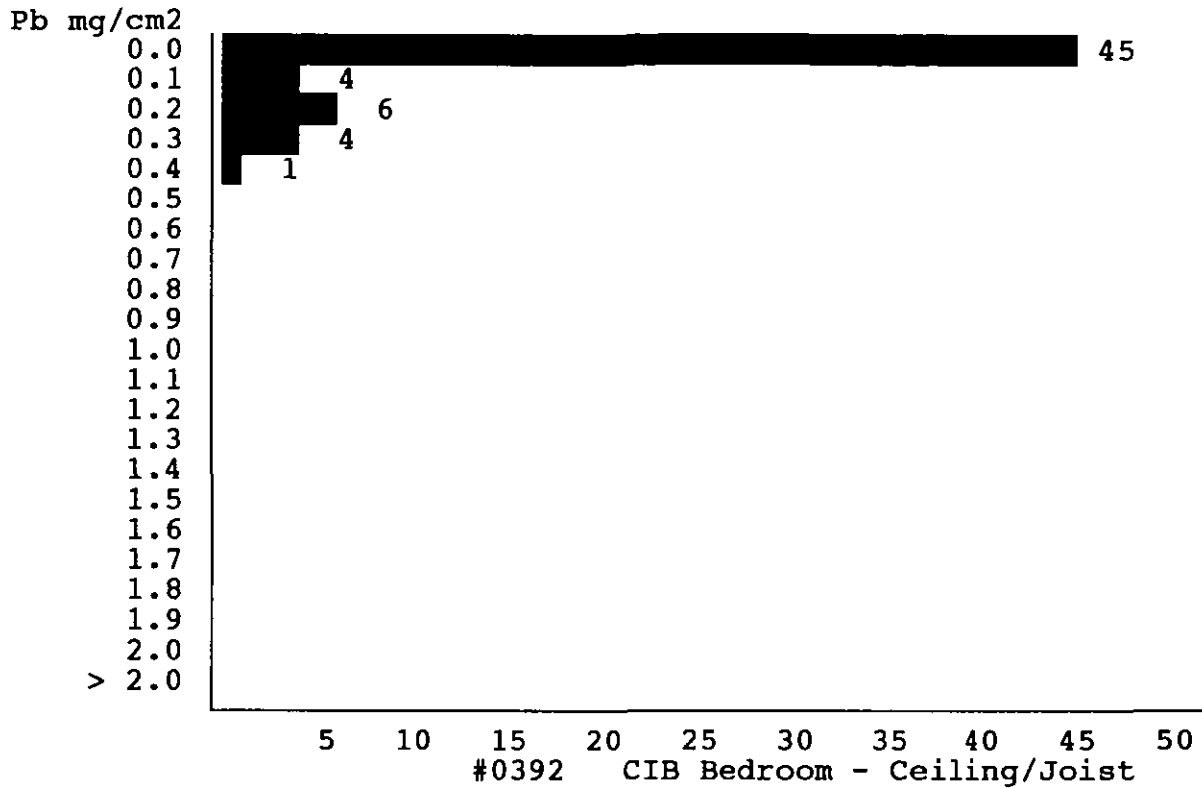


Graph File: \GWA2-08

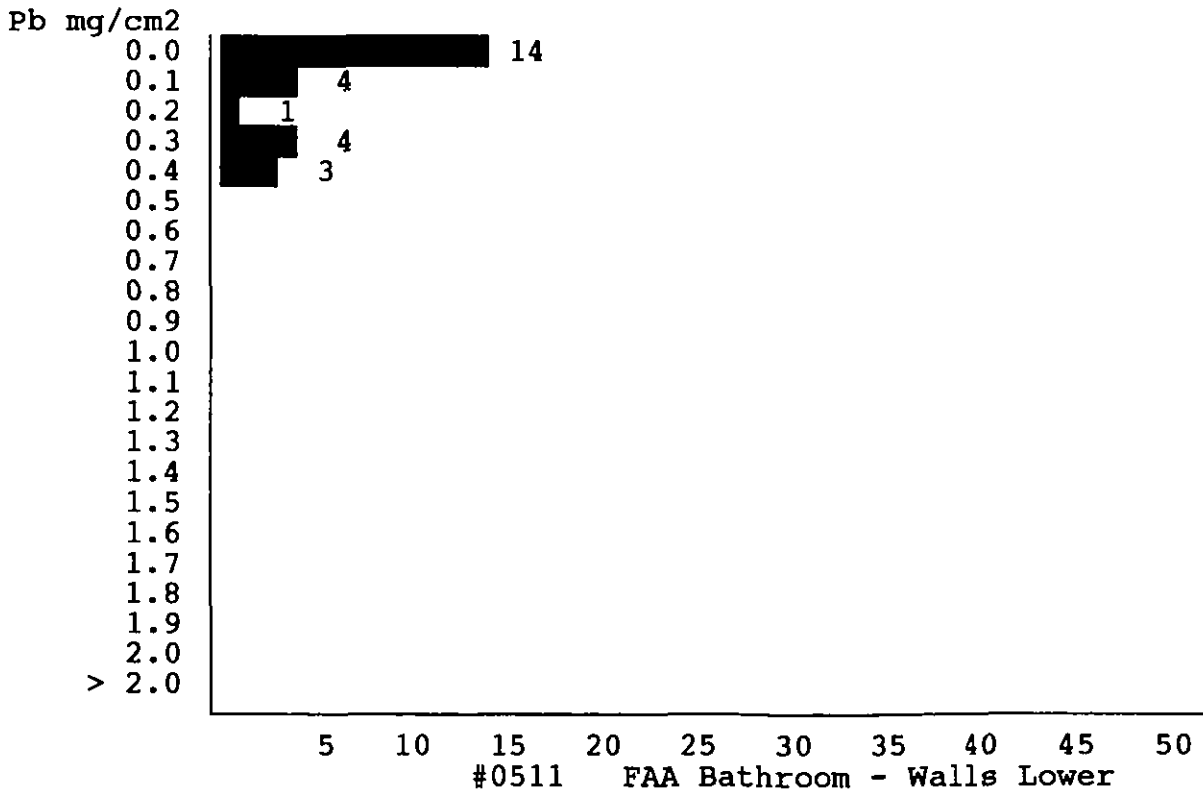
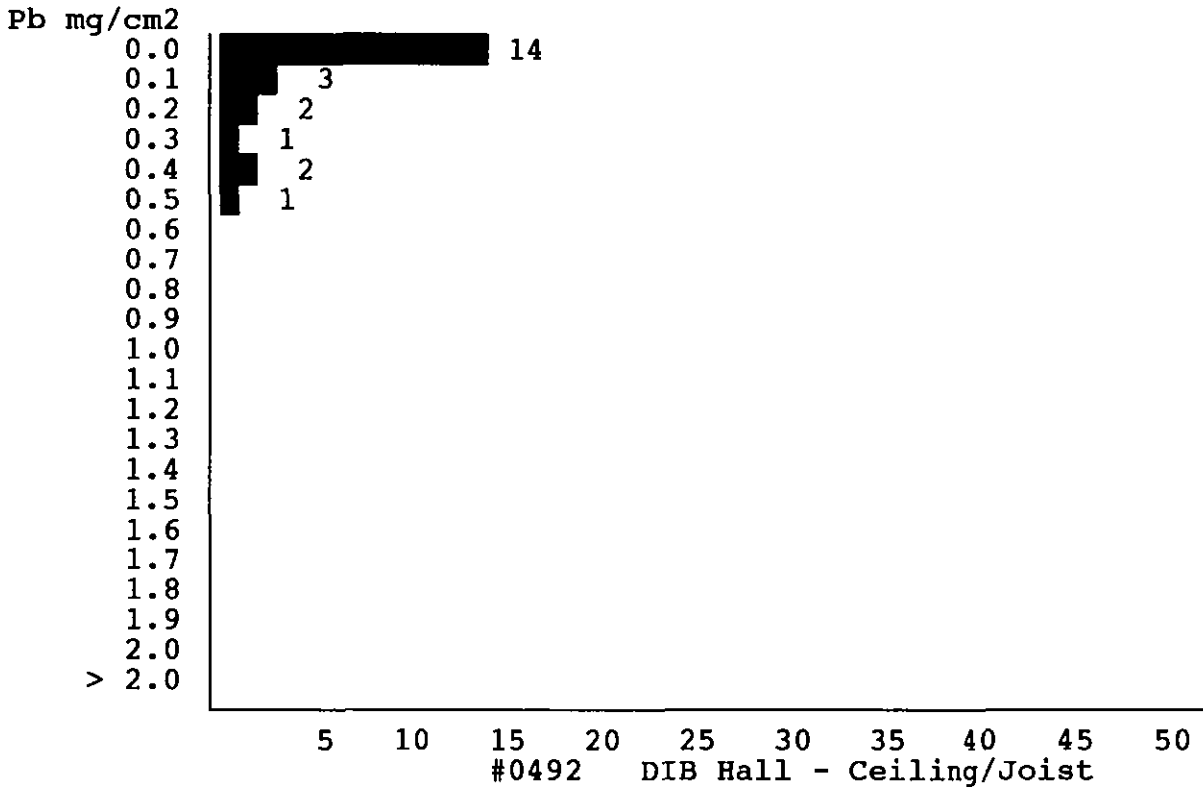


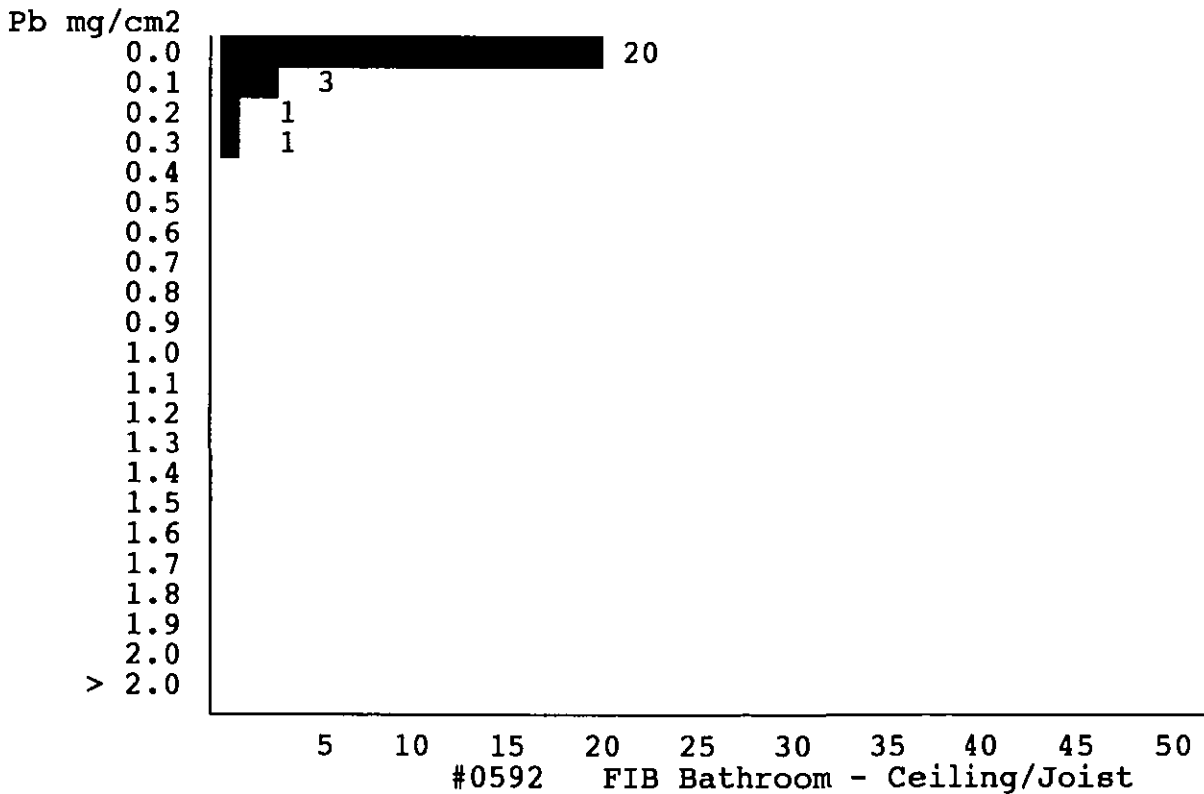
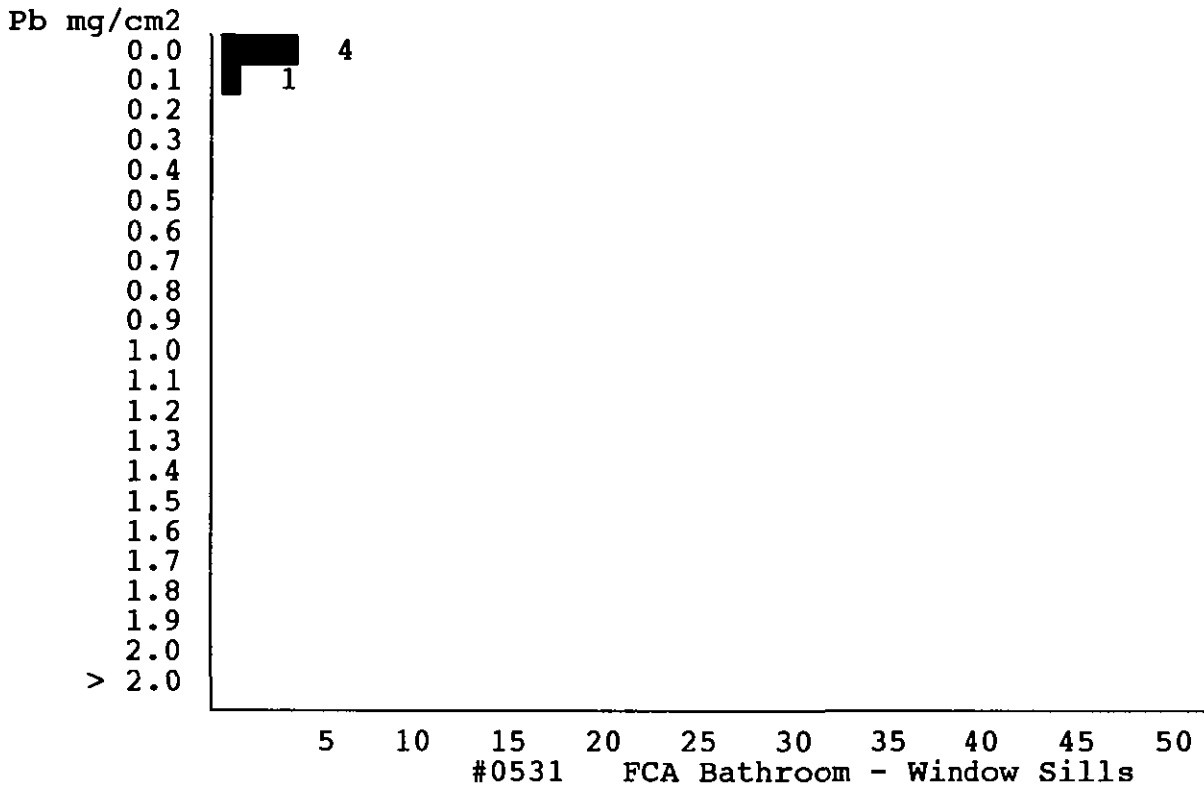


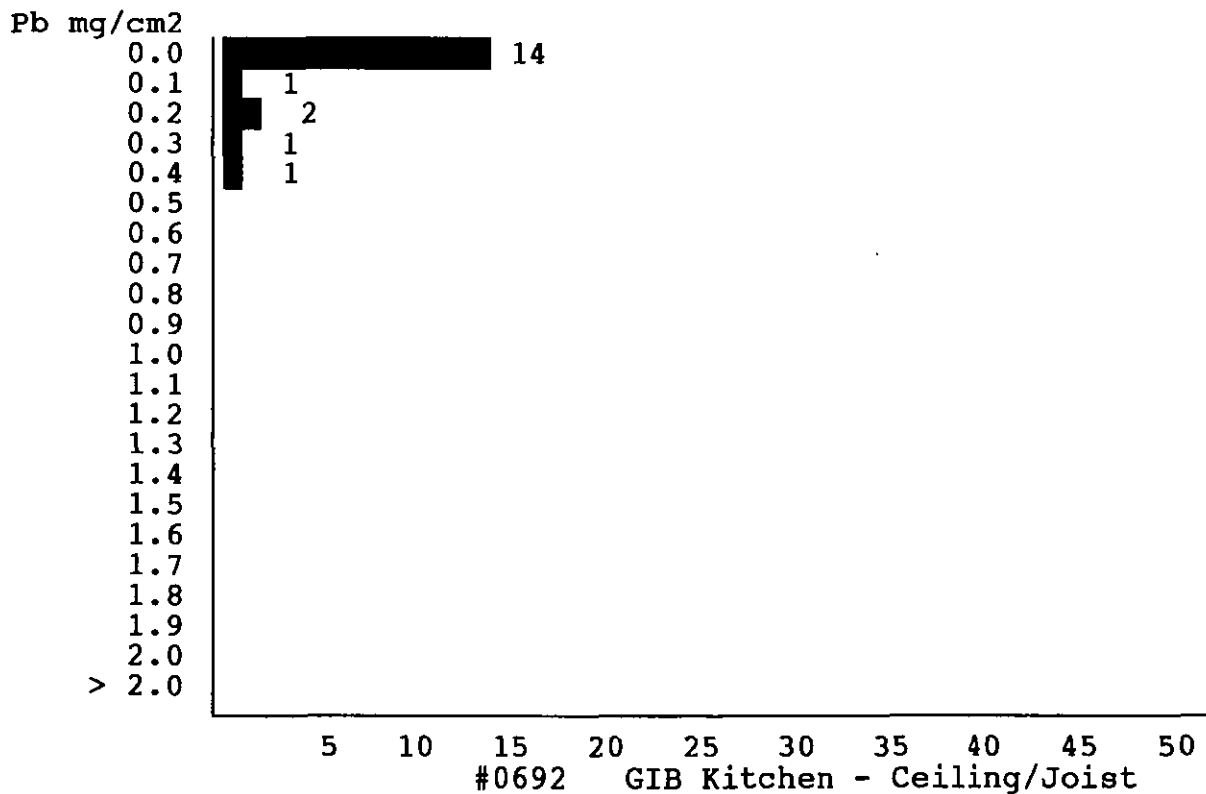
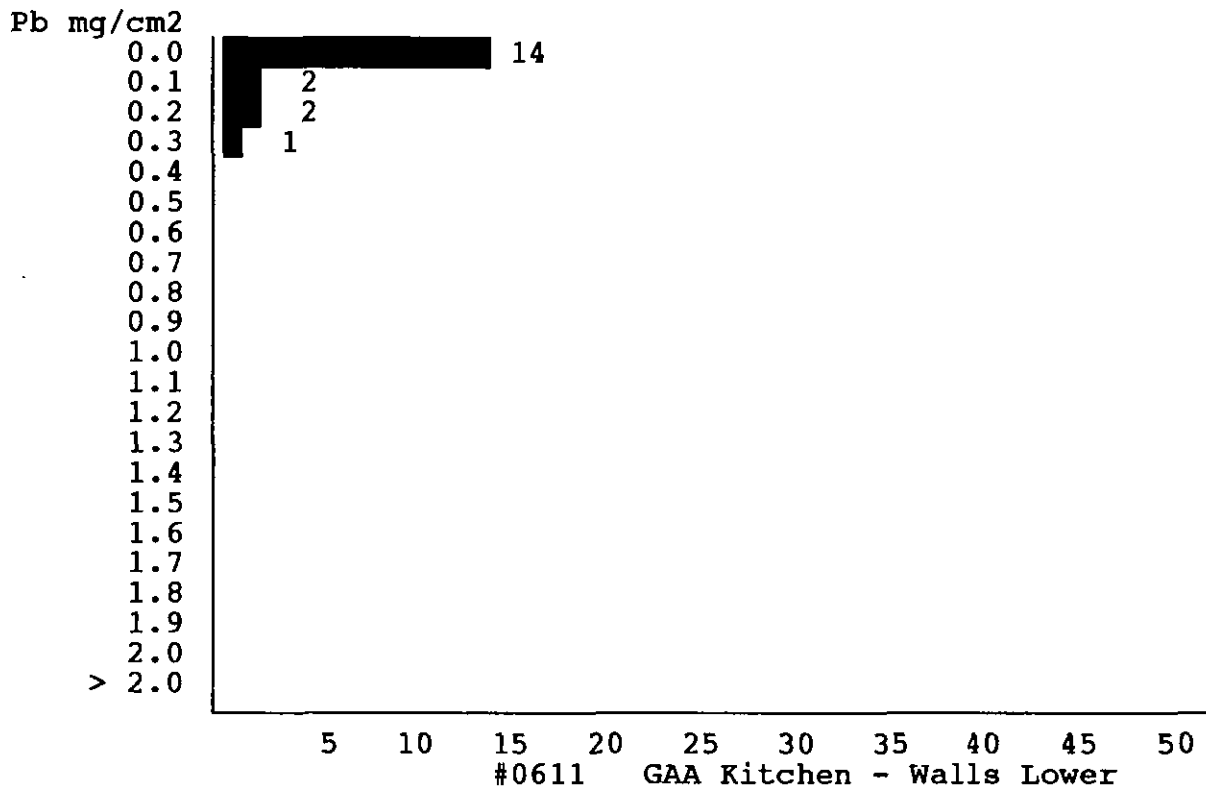


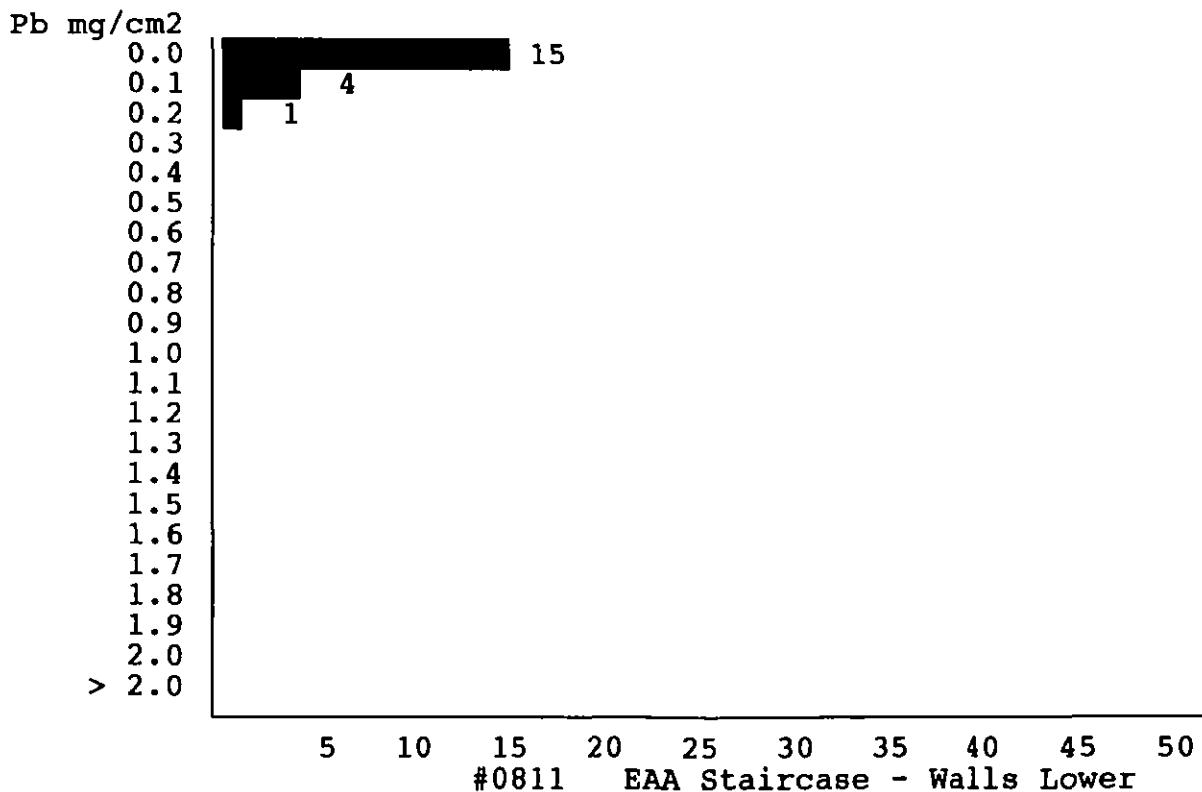
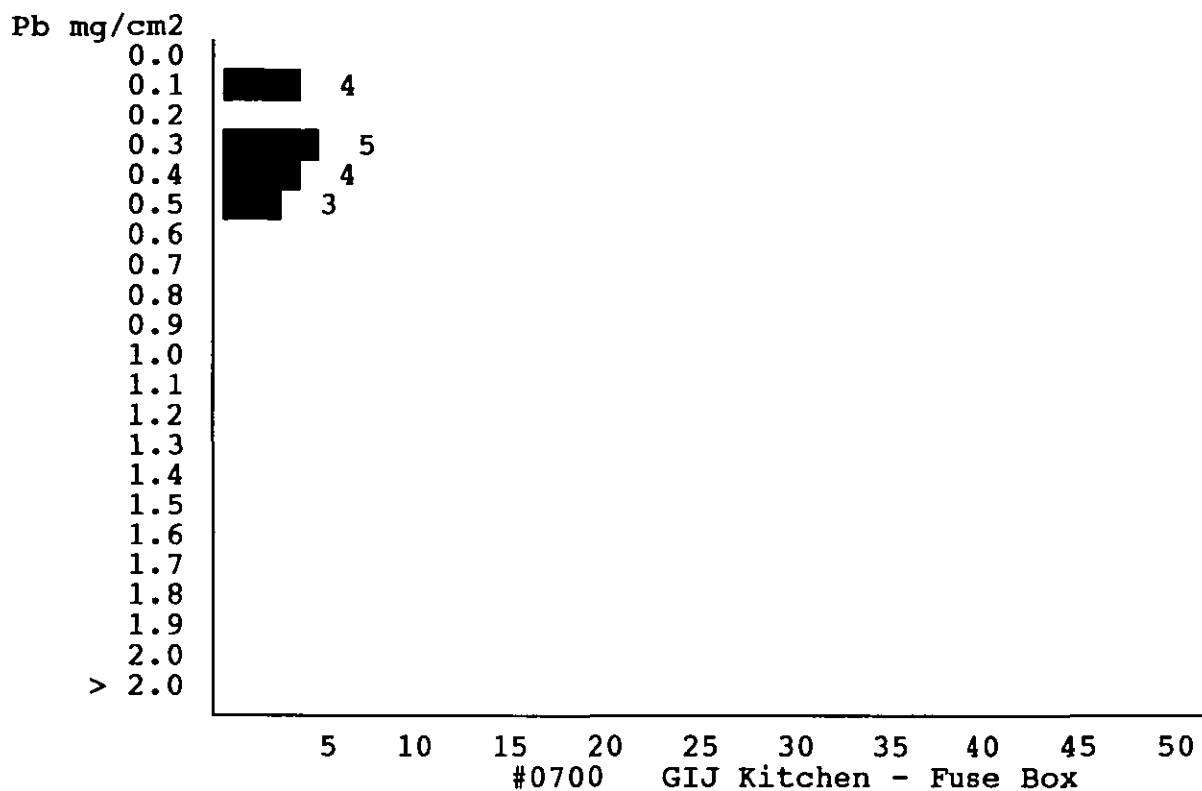




Graph File: \GWA2-08

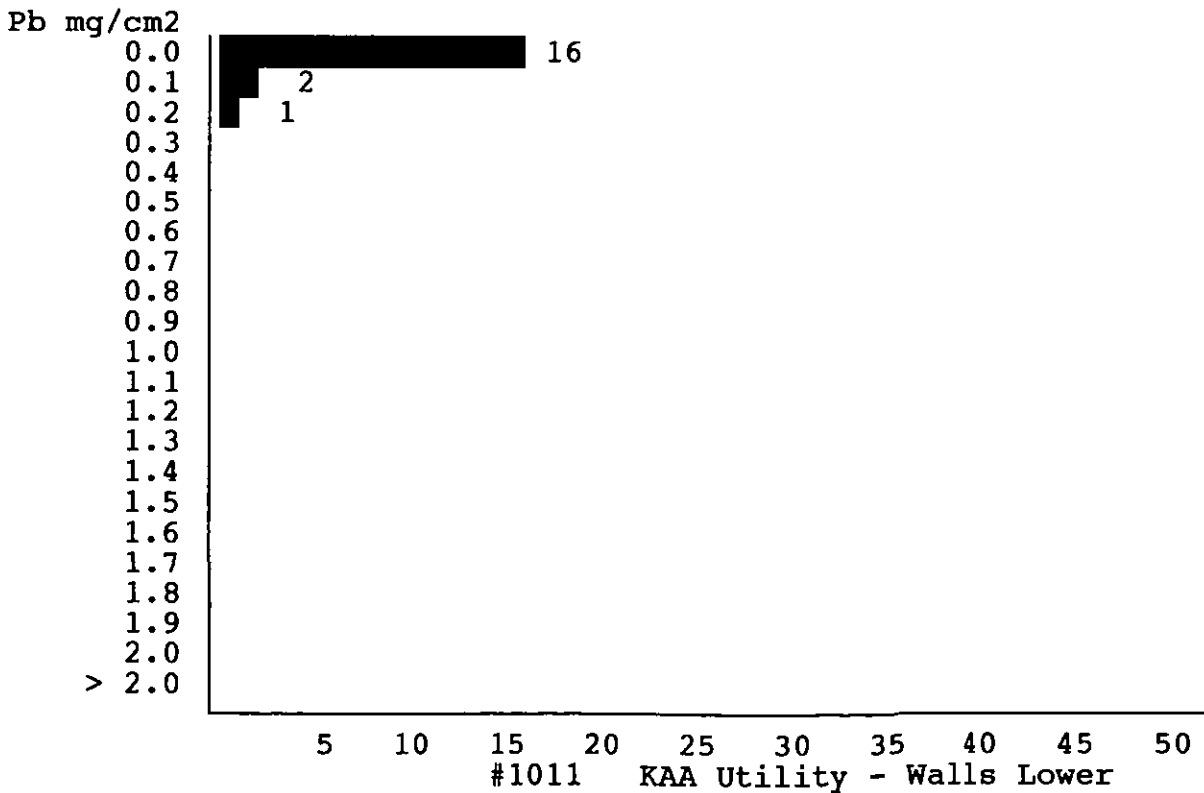
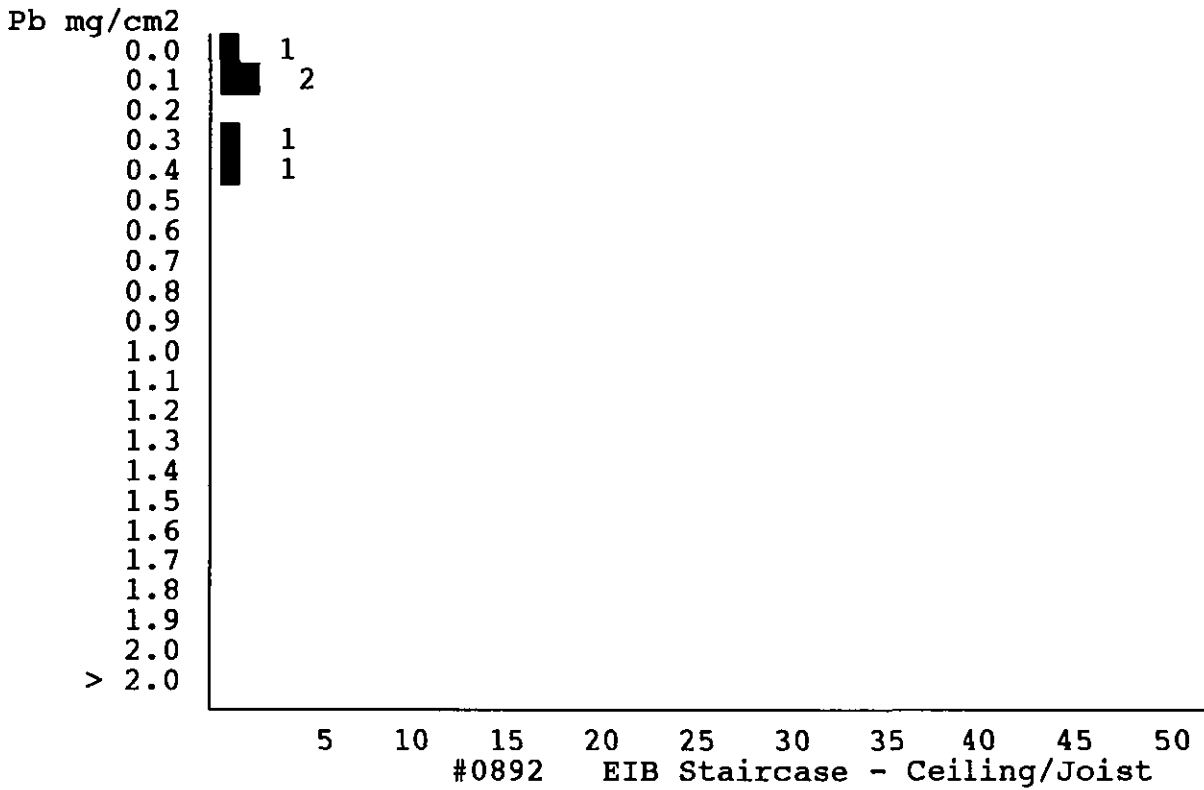


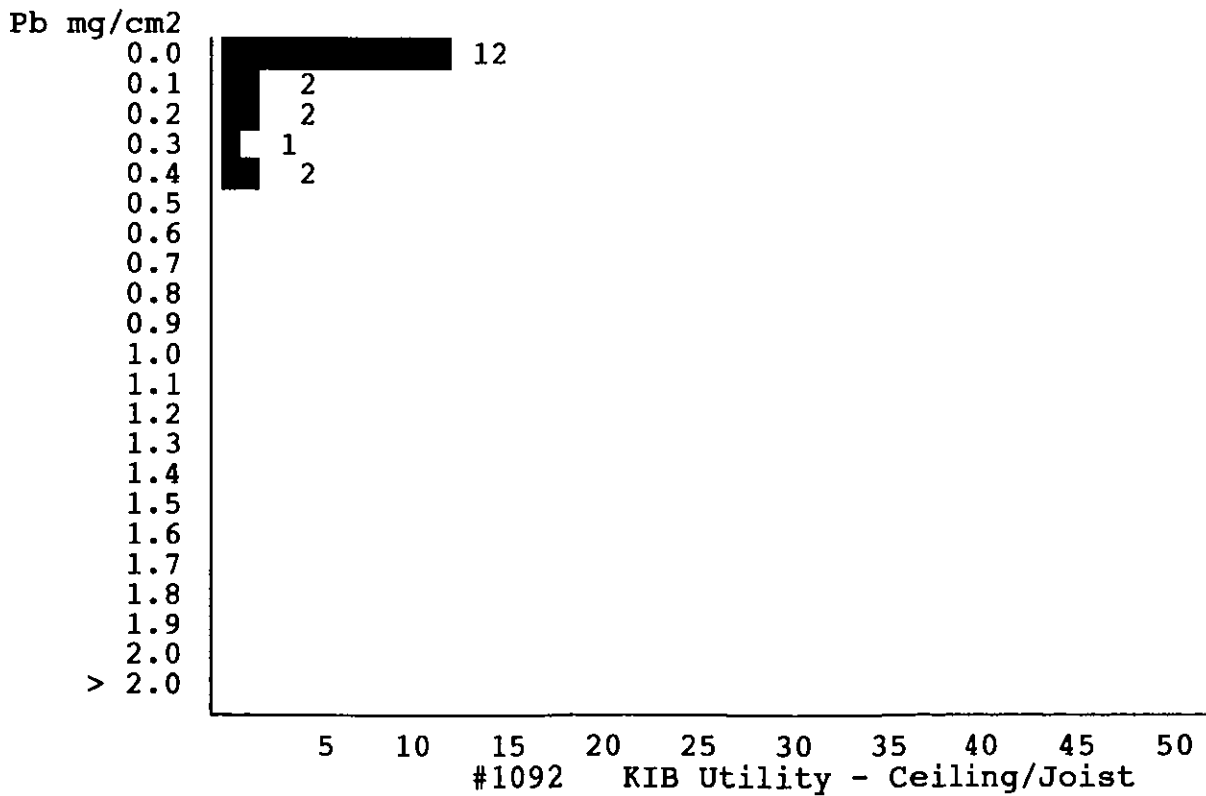
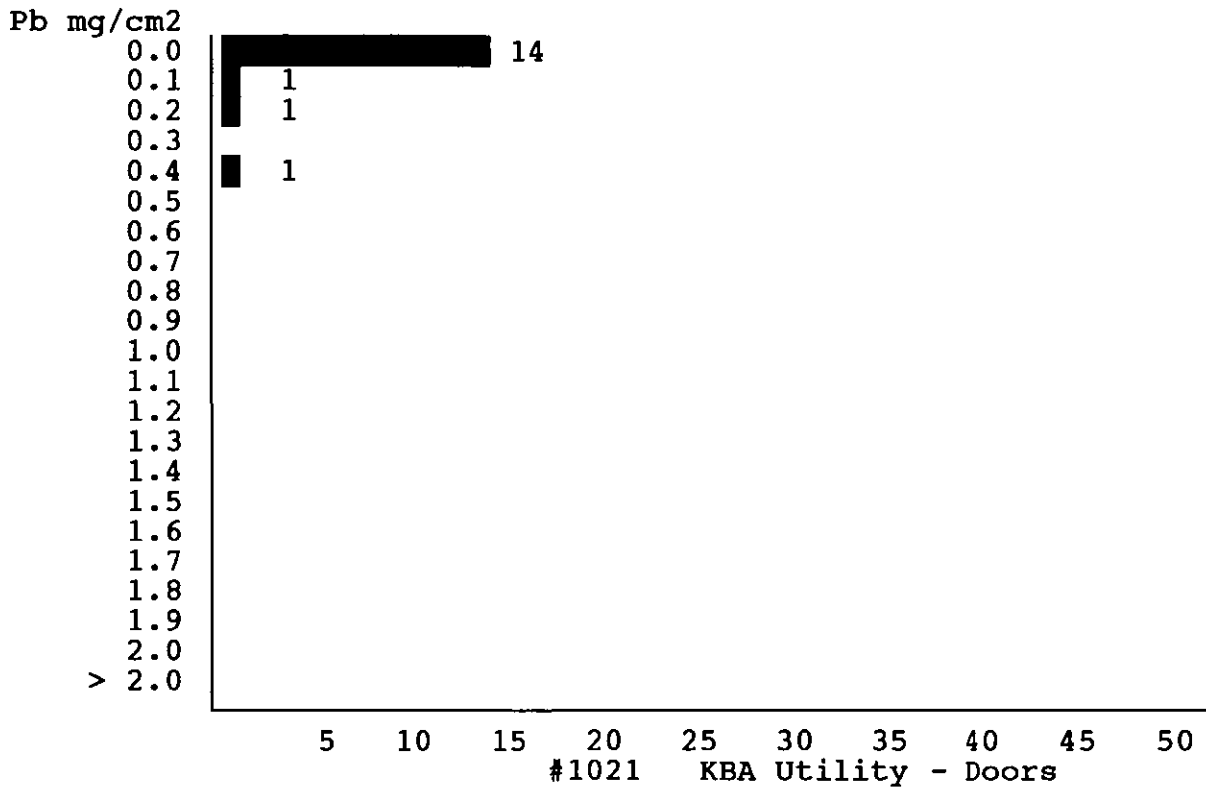


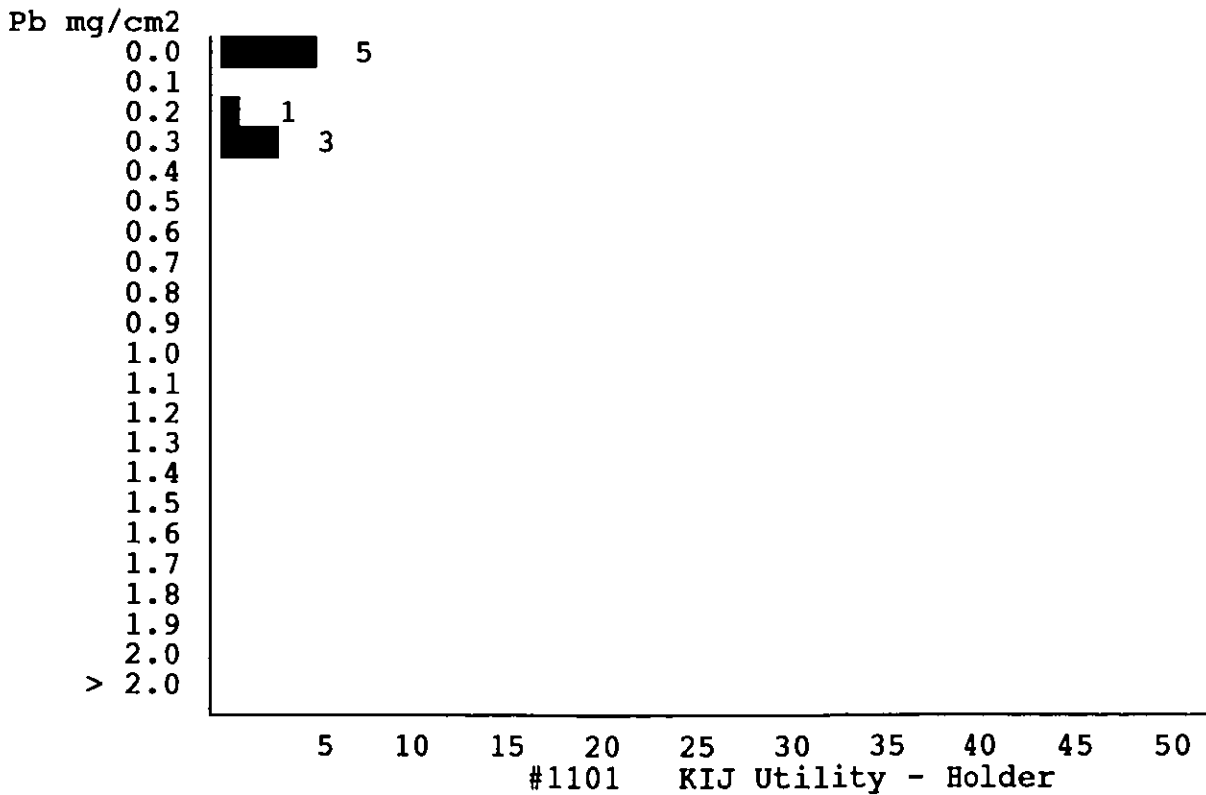
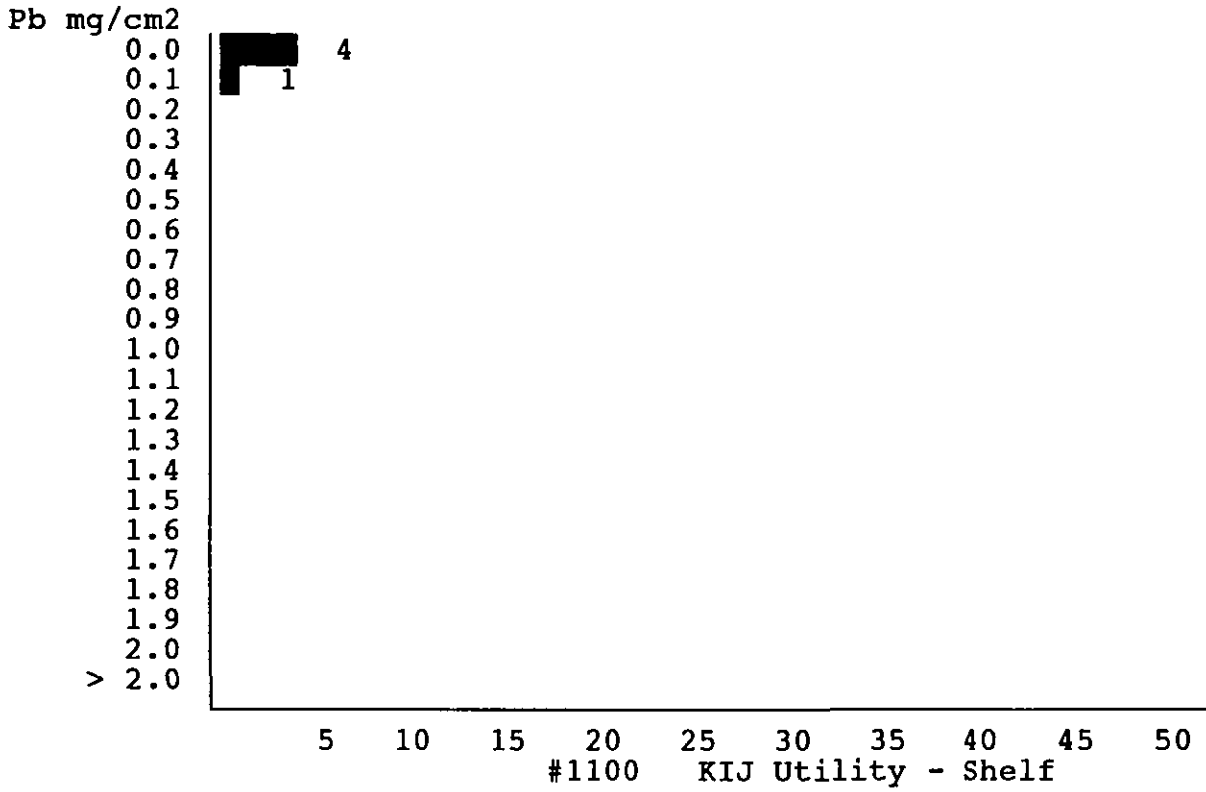


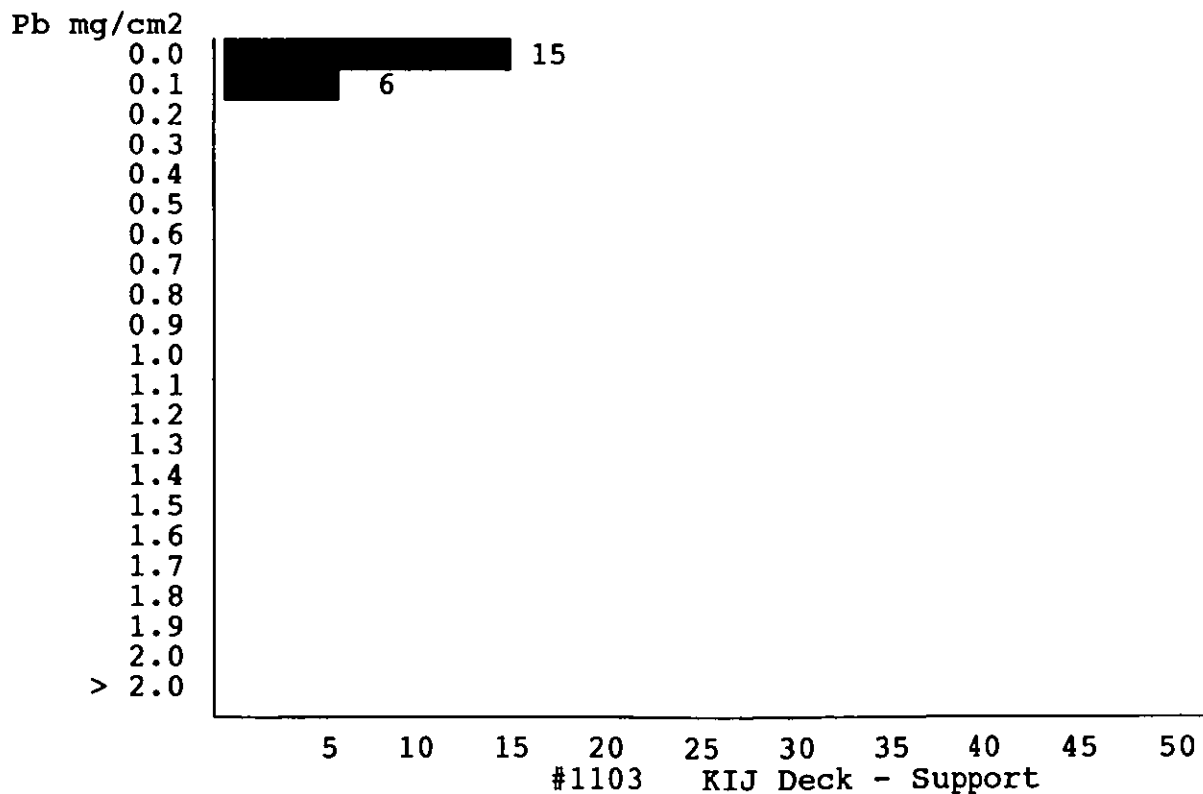
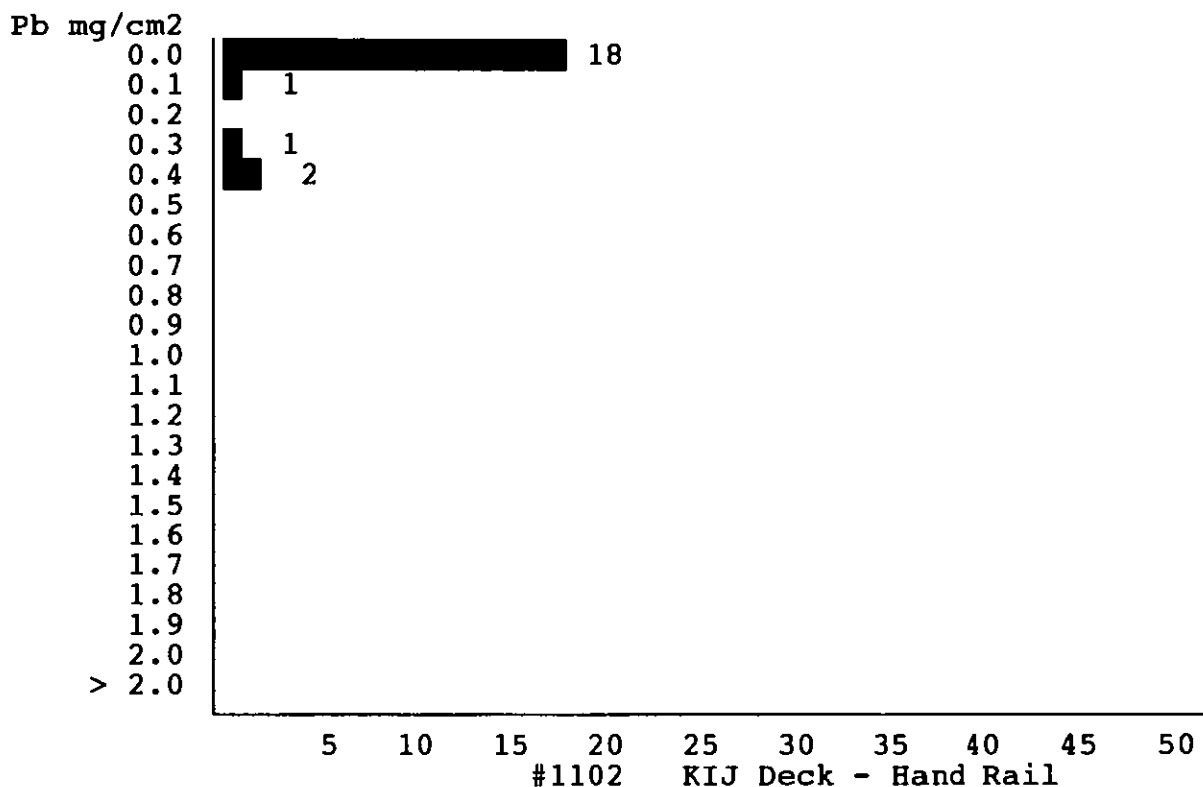


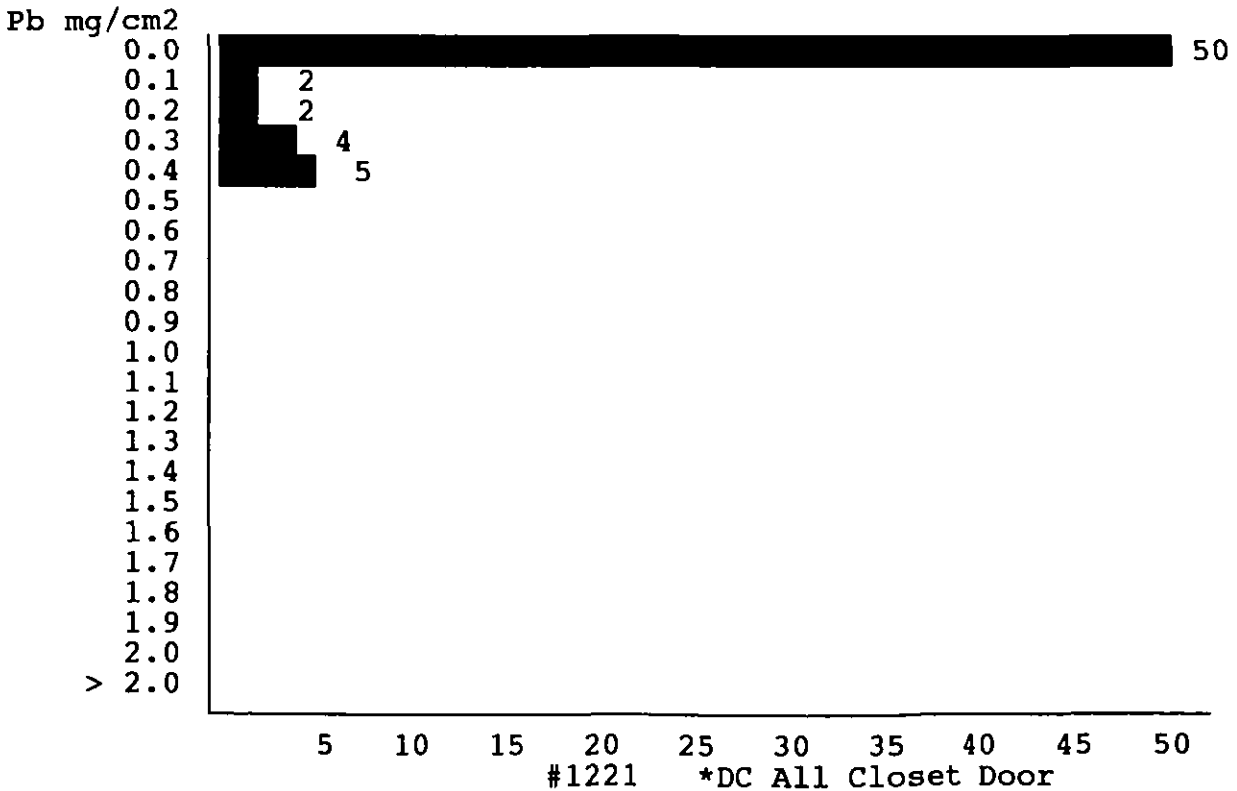
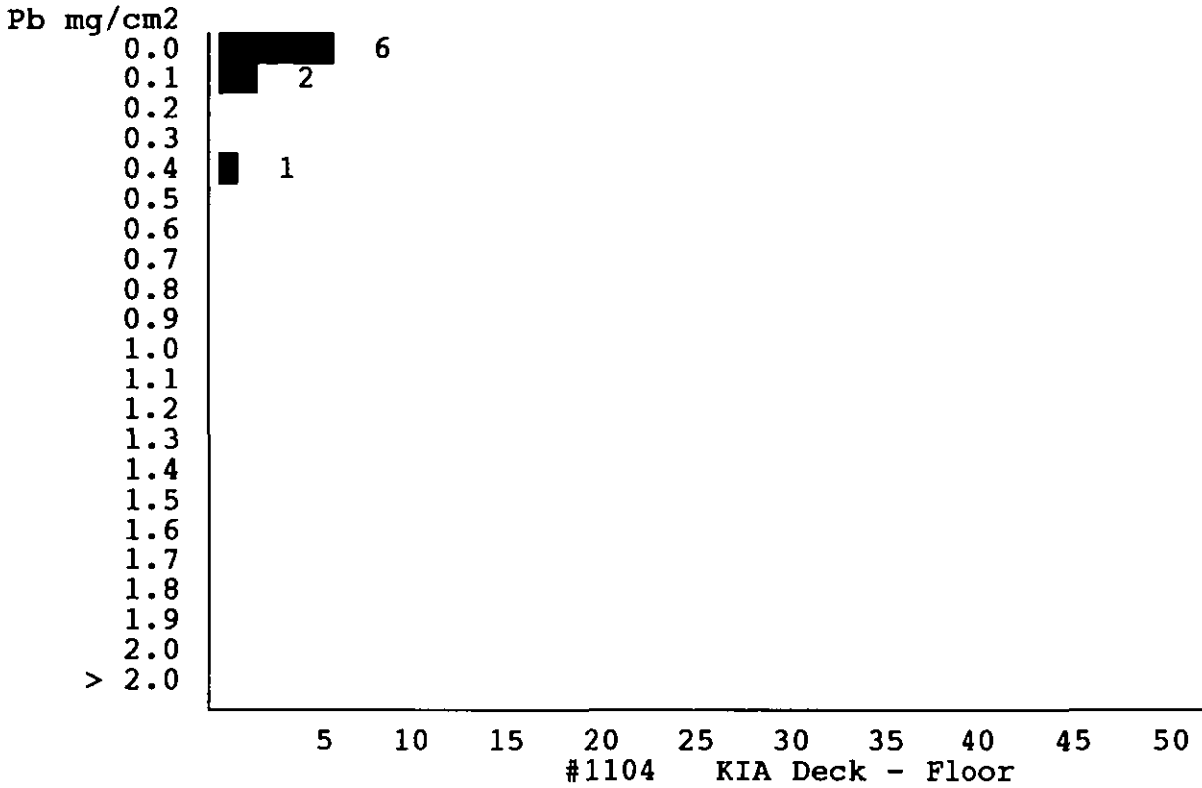


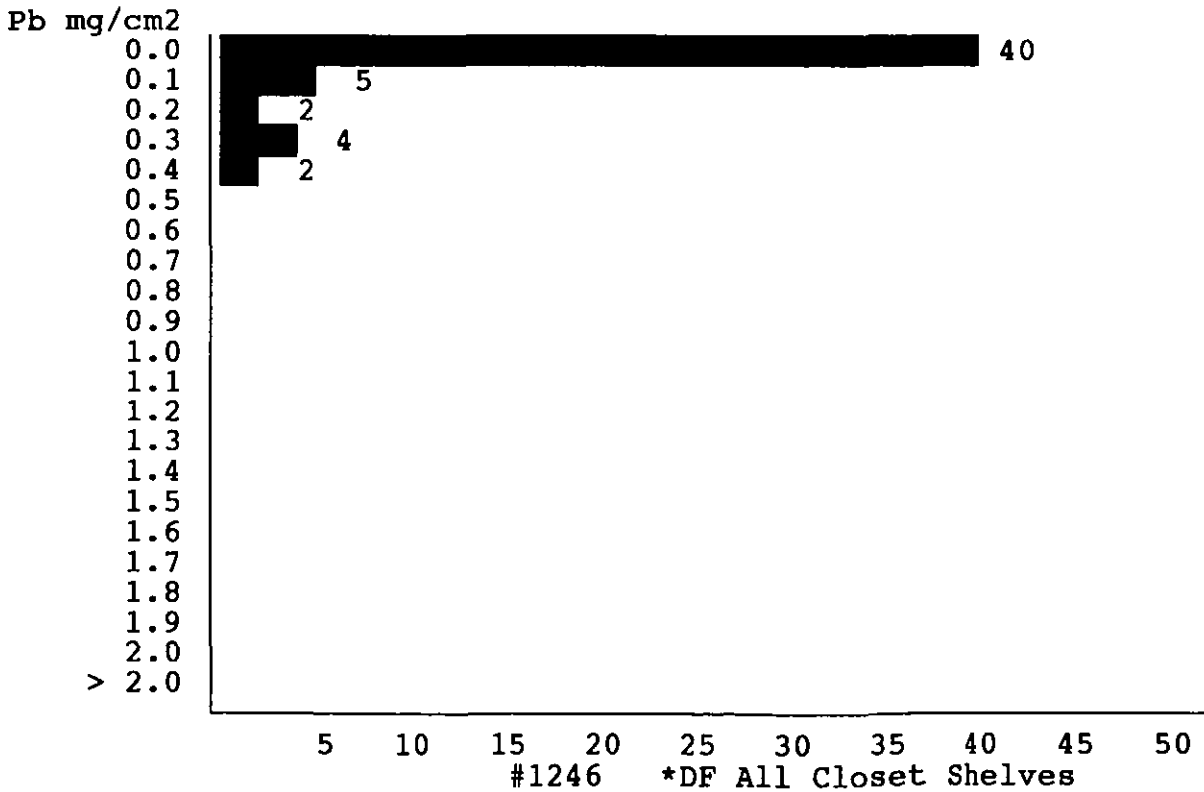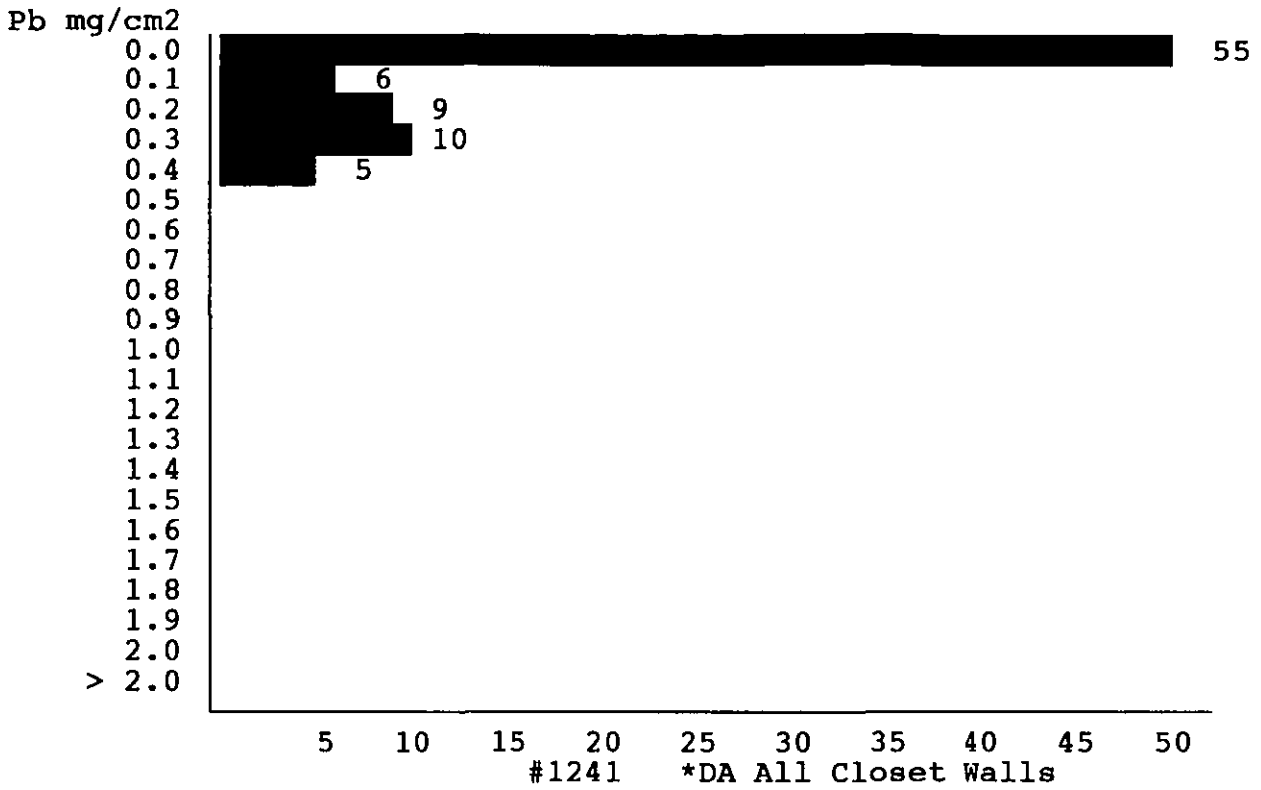

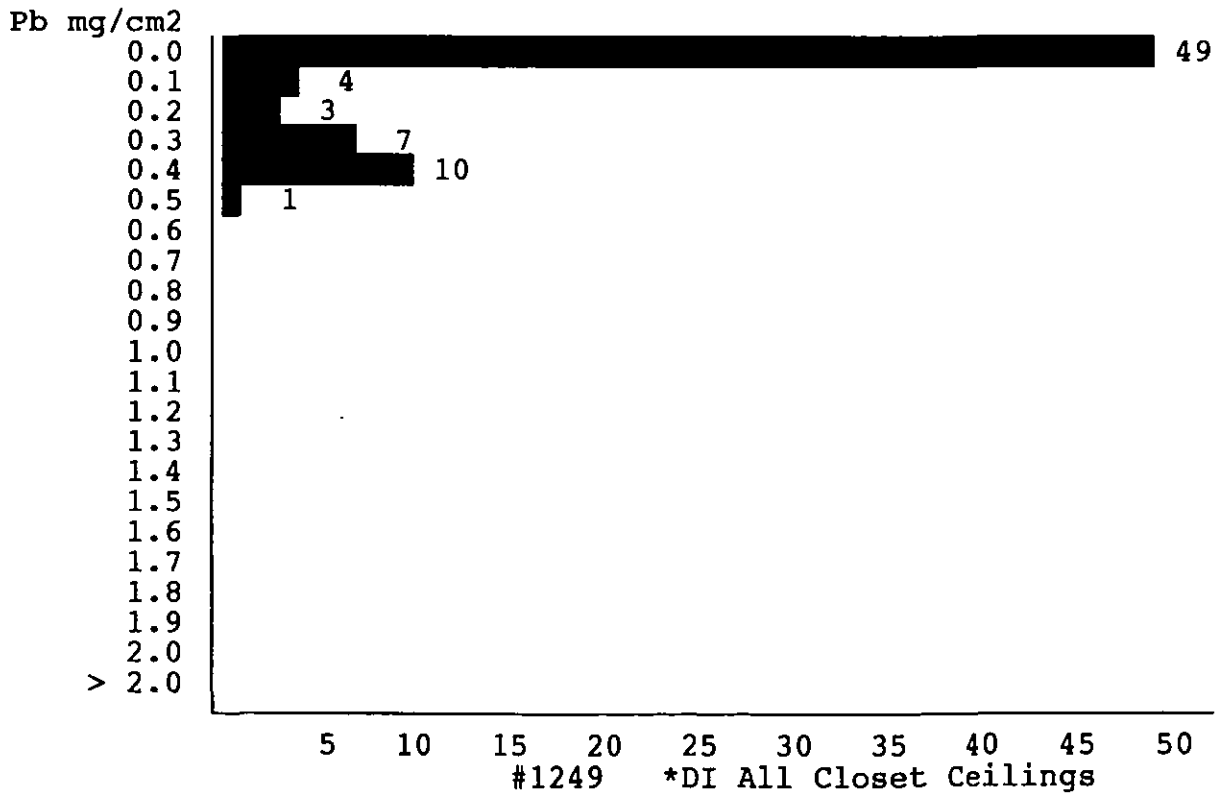
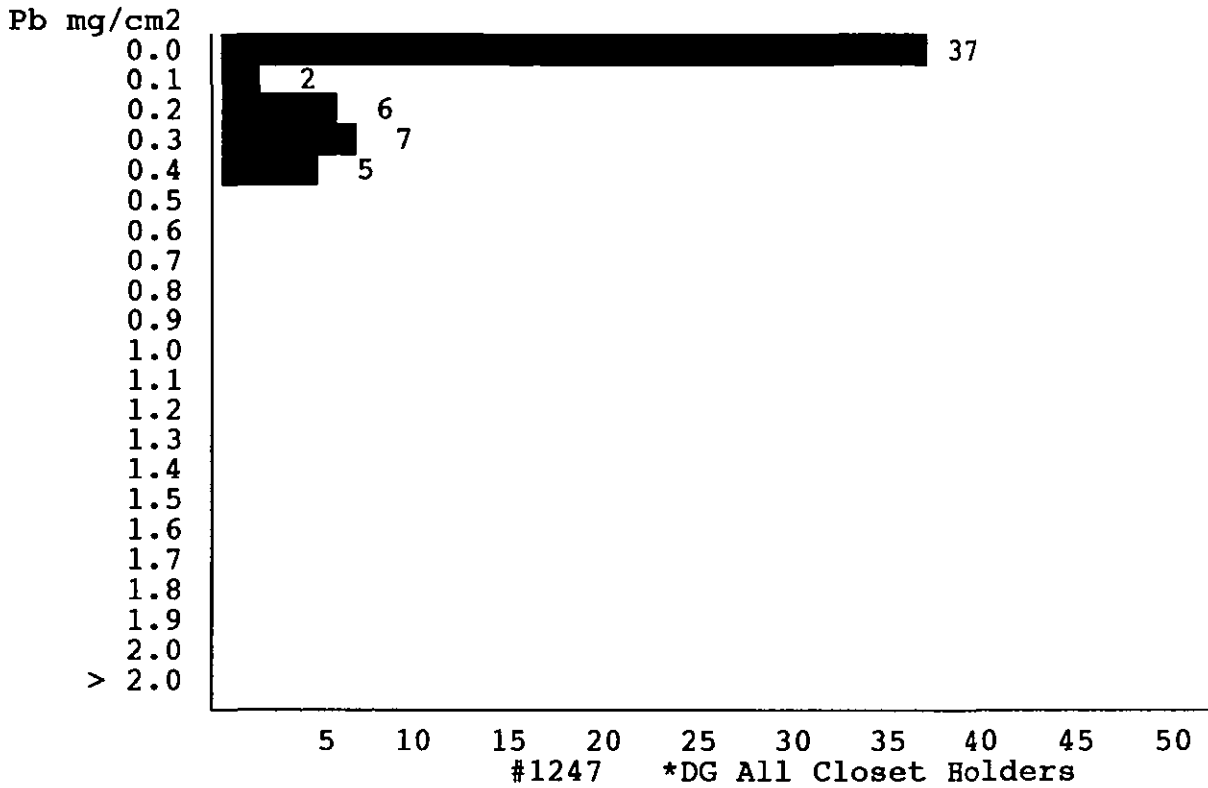


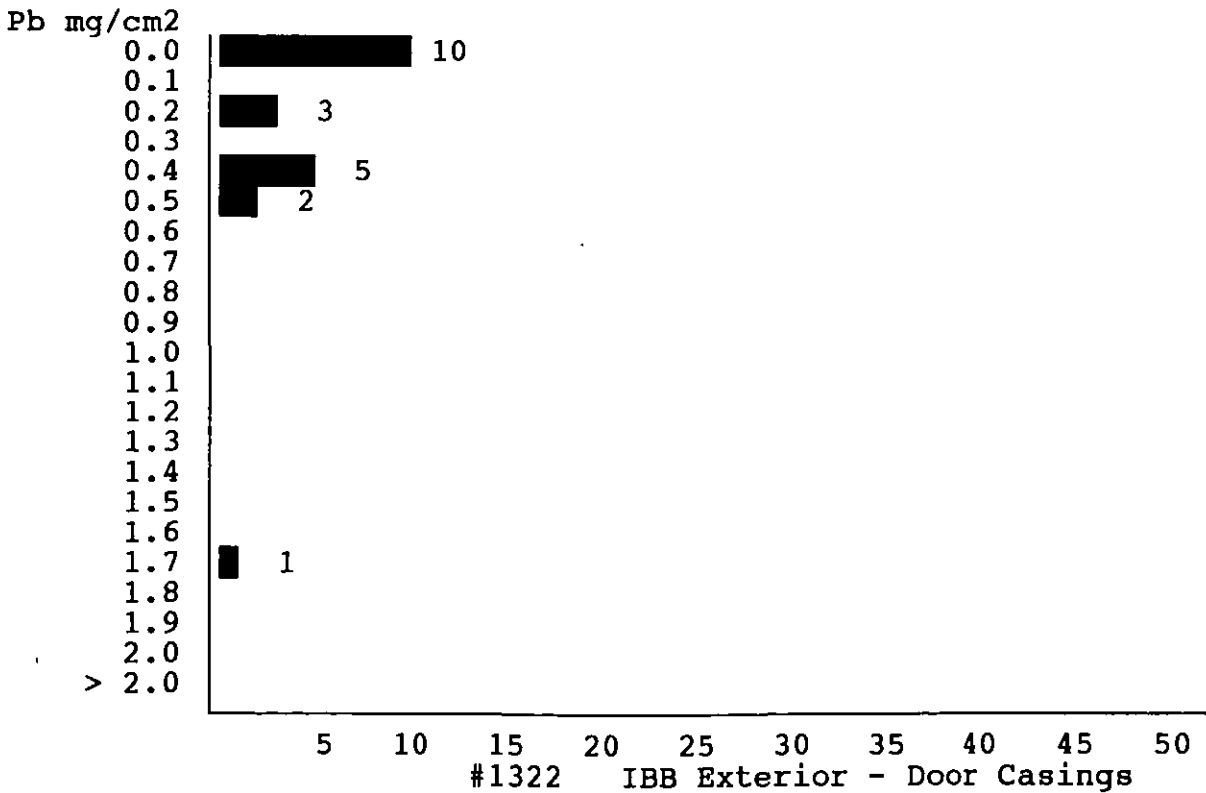
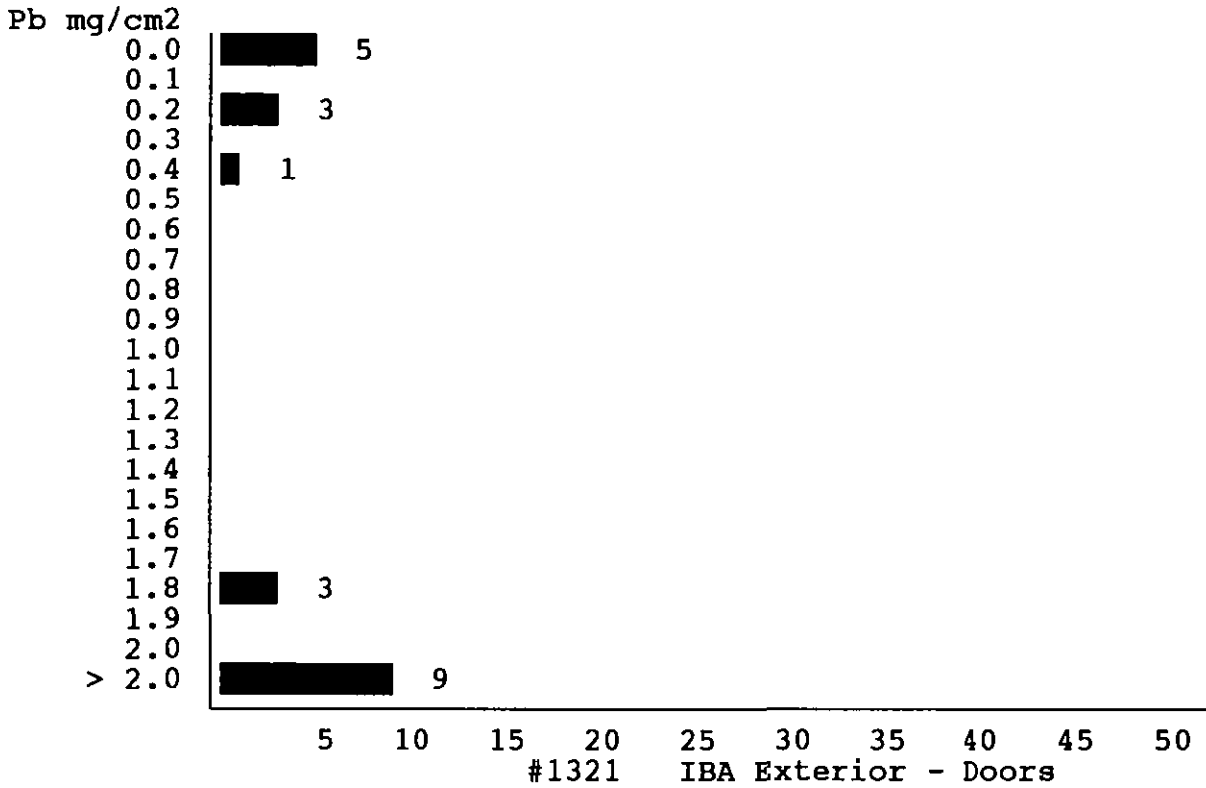


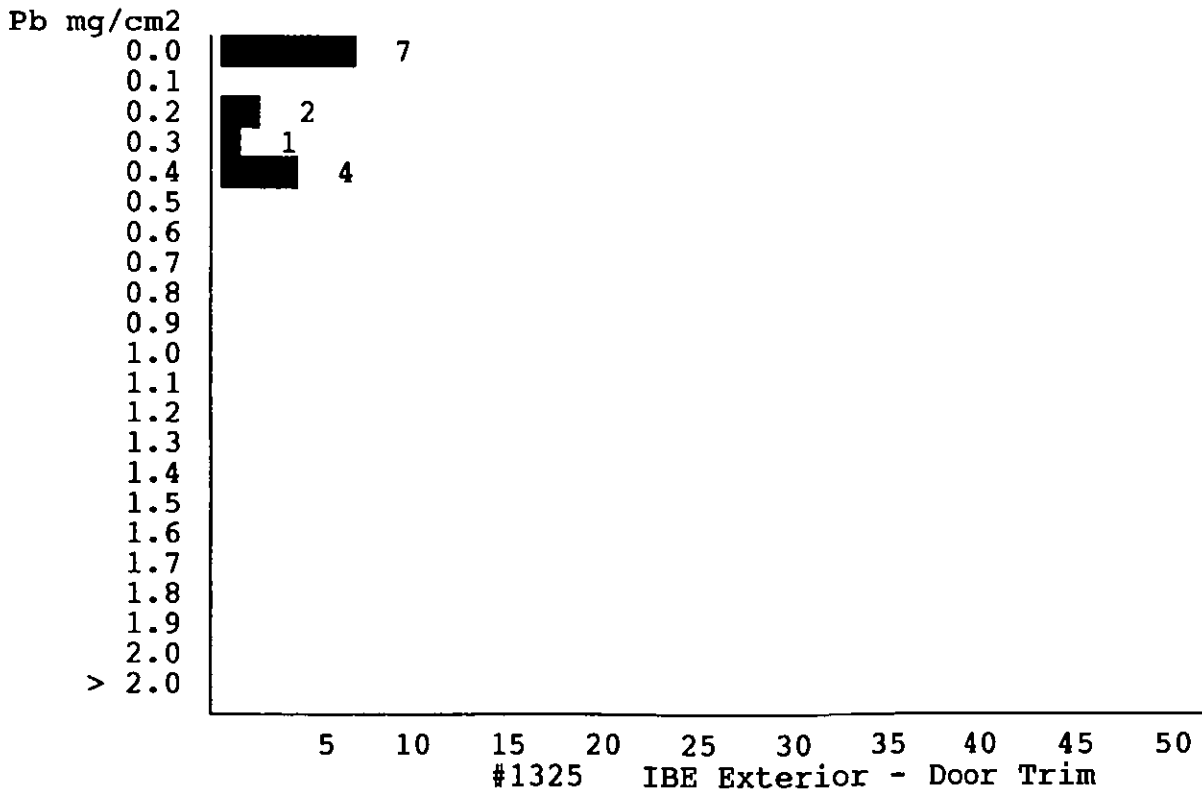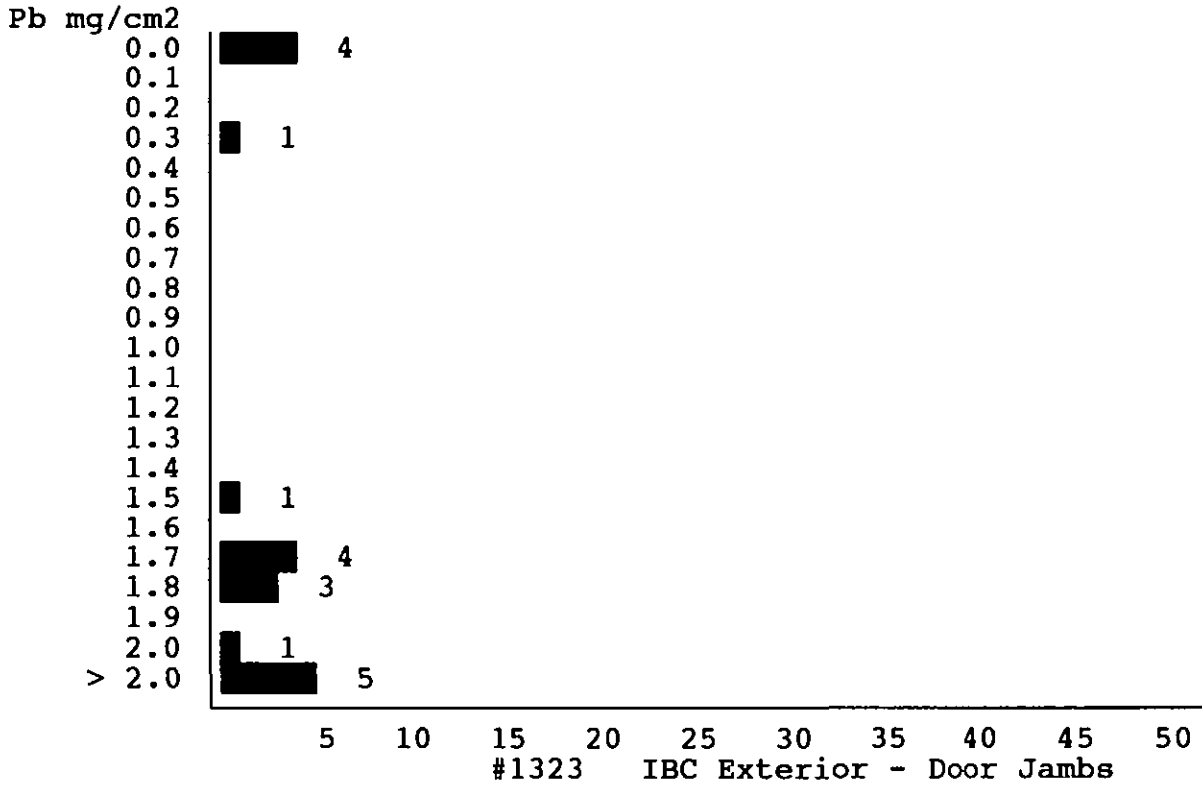


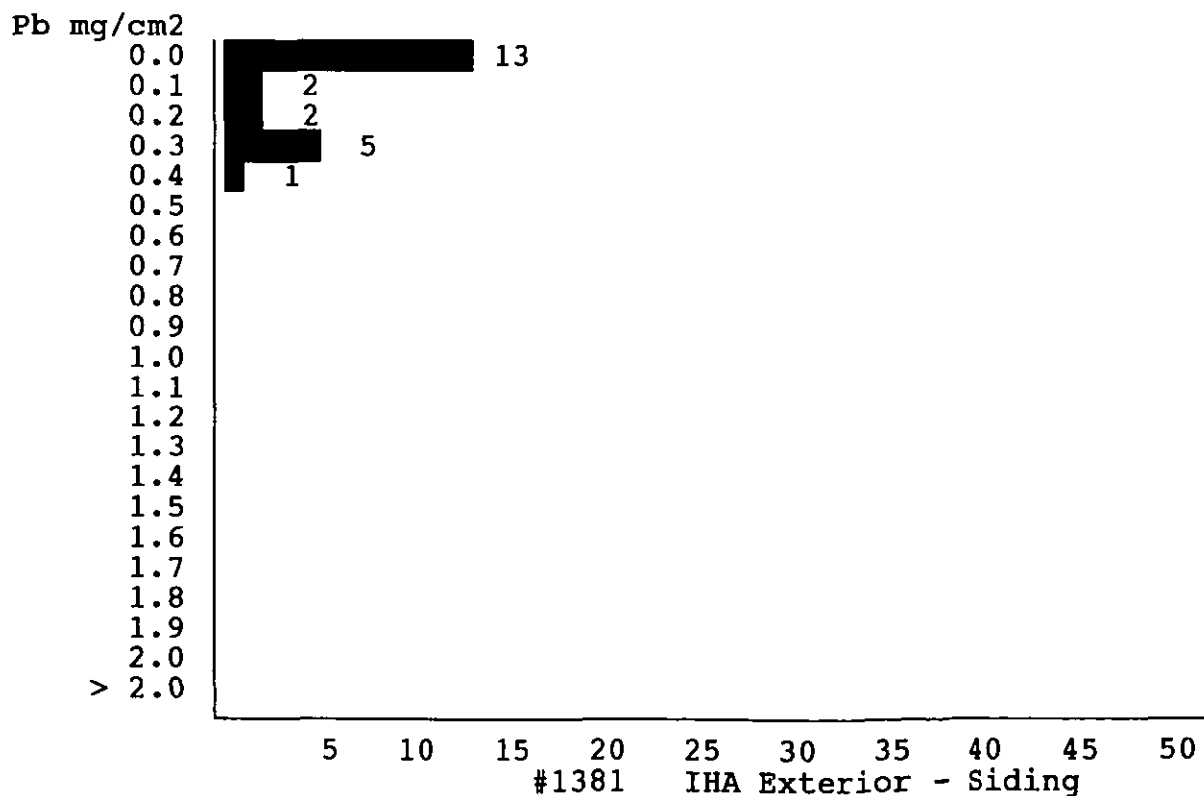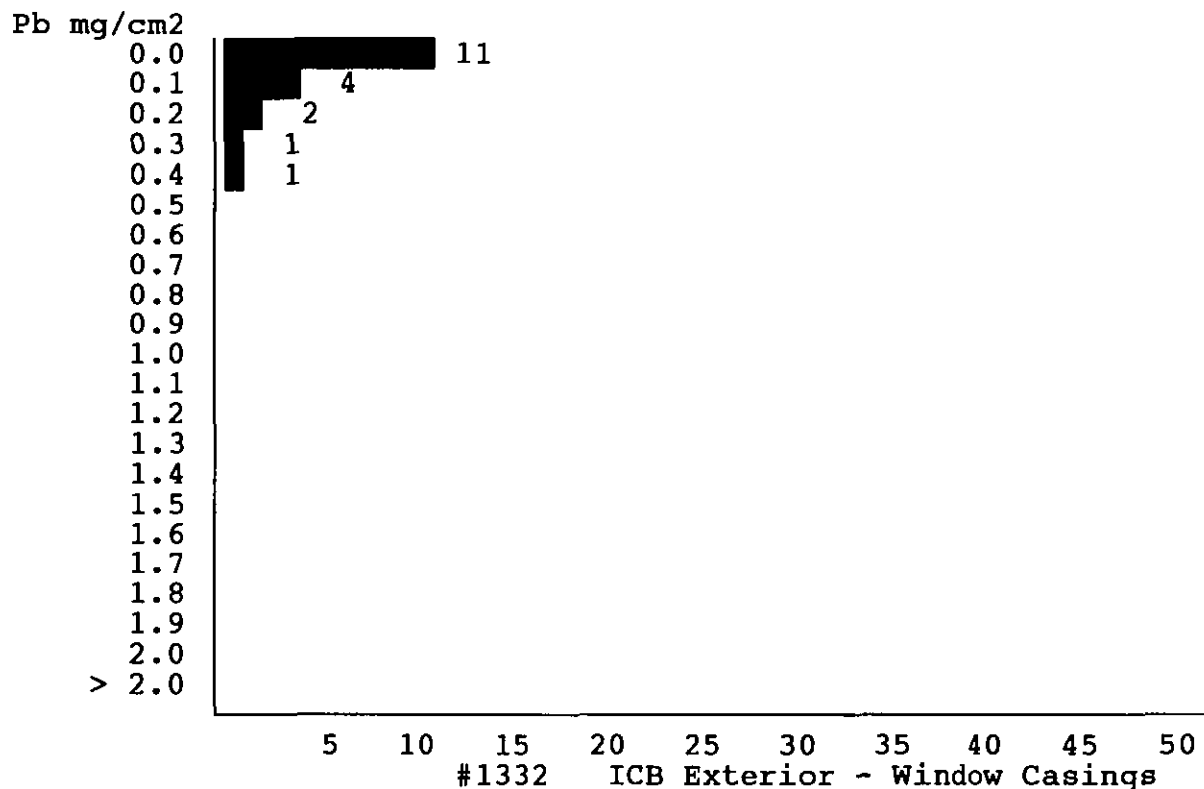

Graph File: \GWA2-08

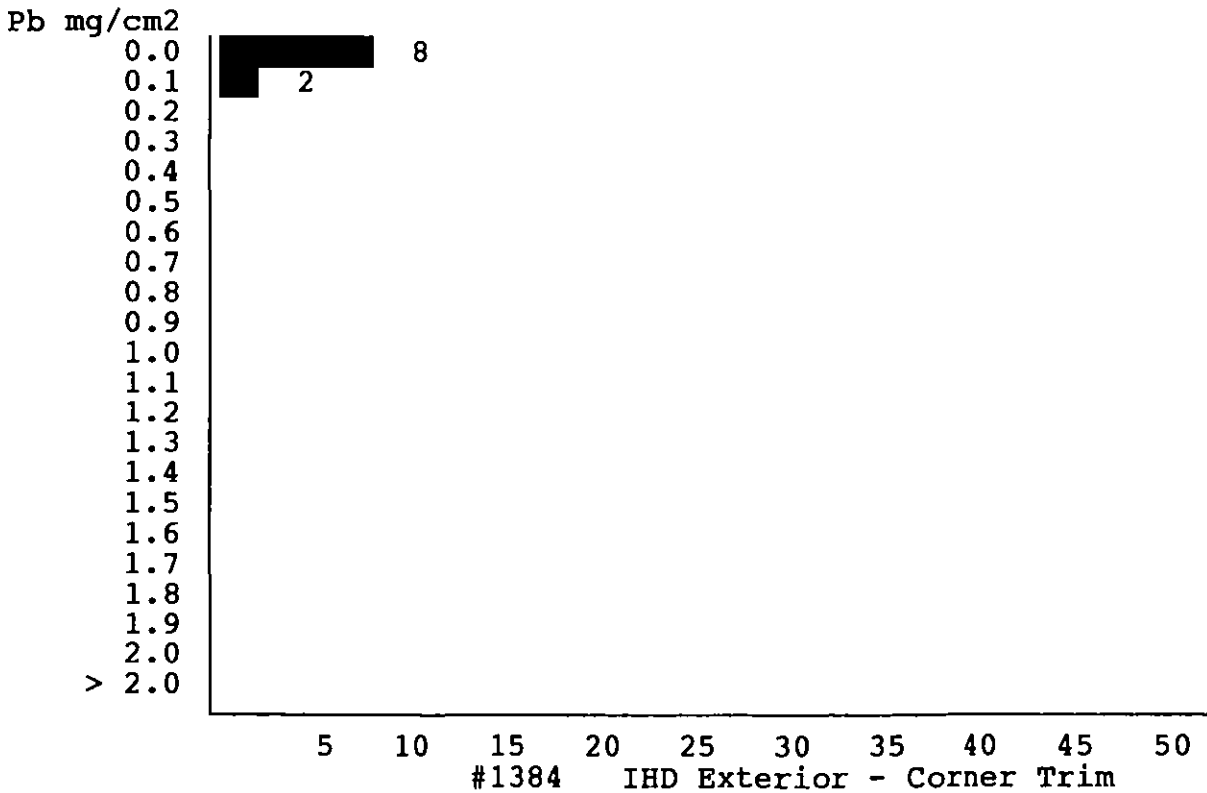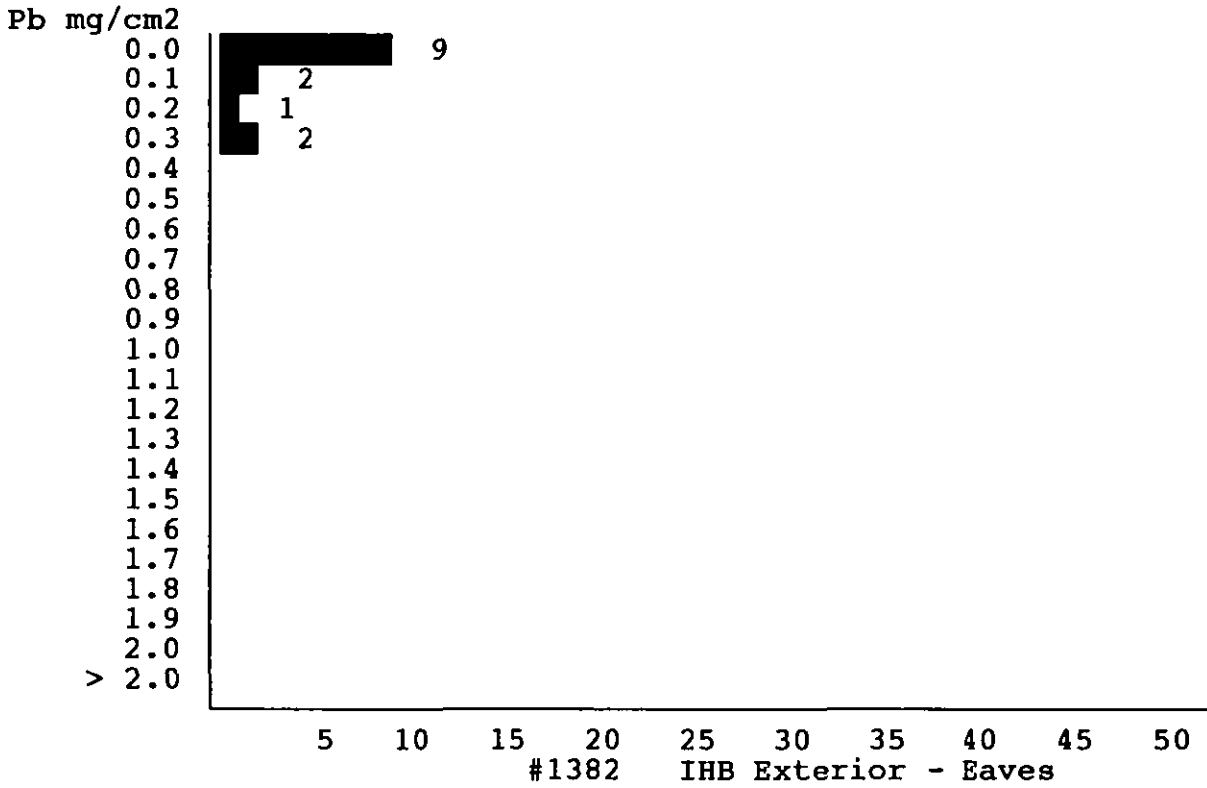

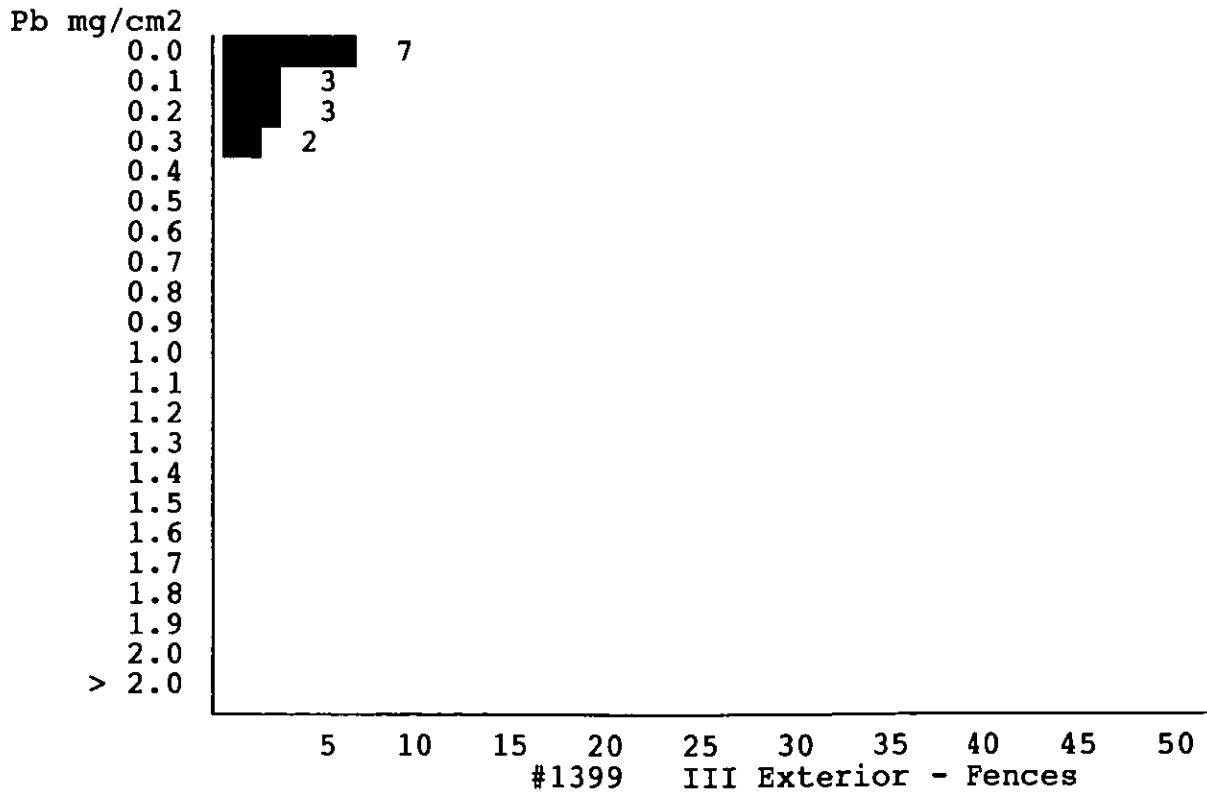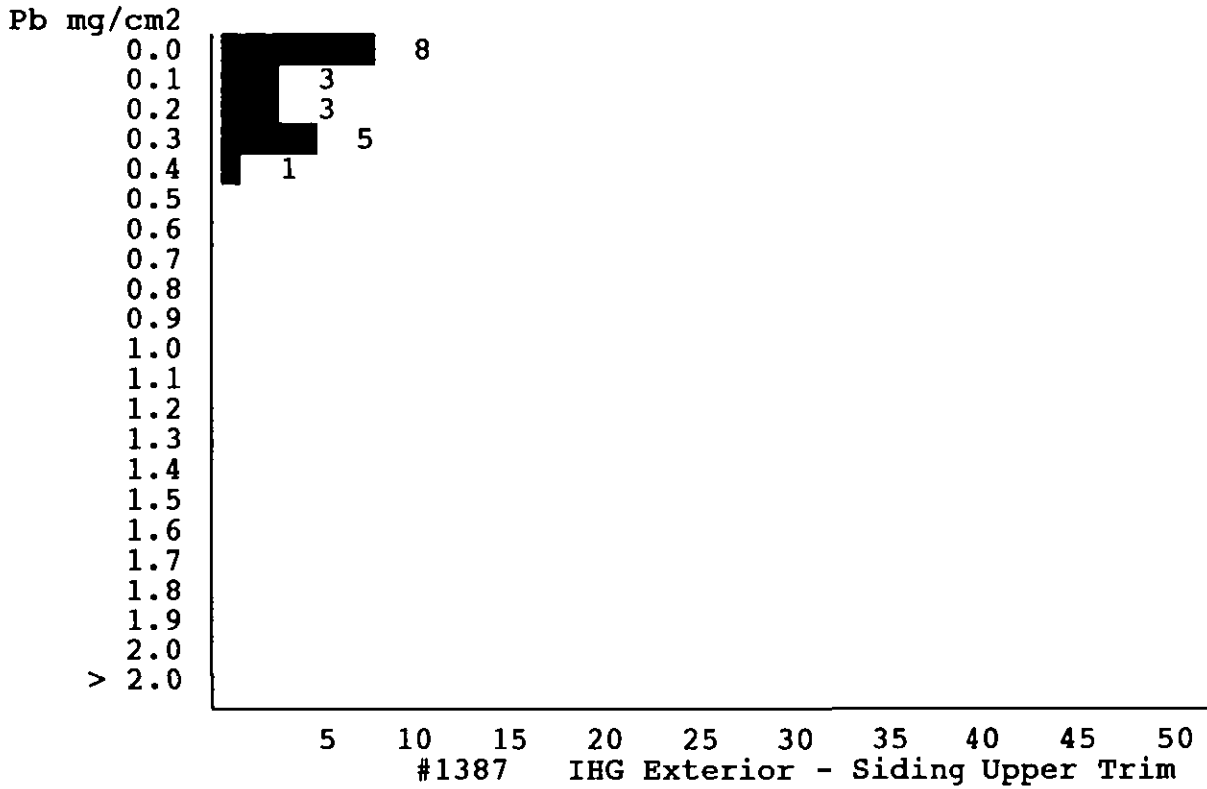

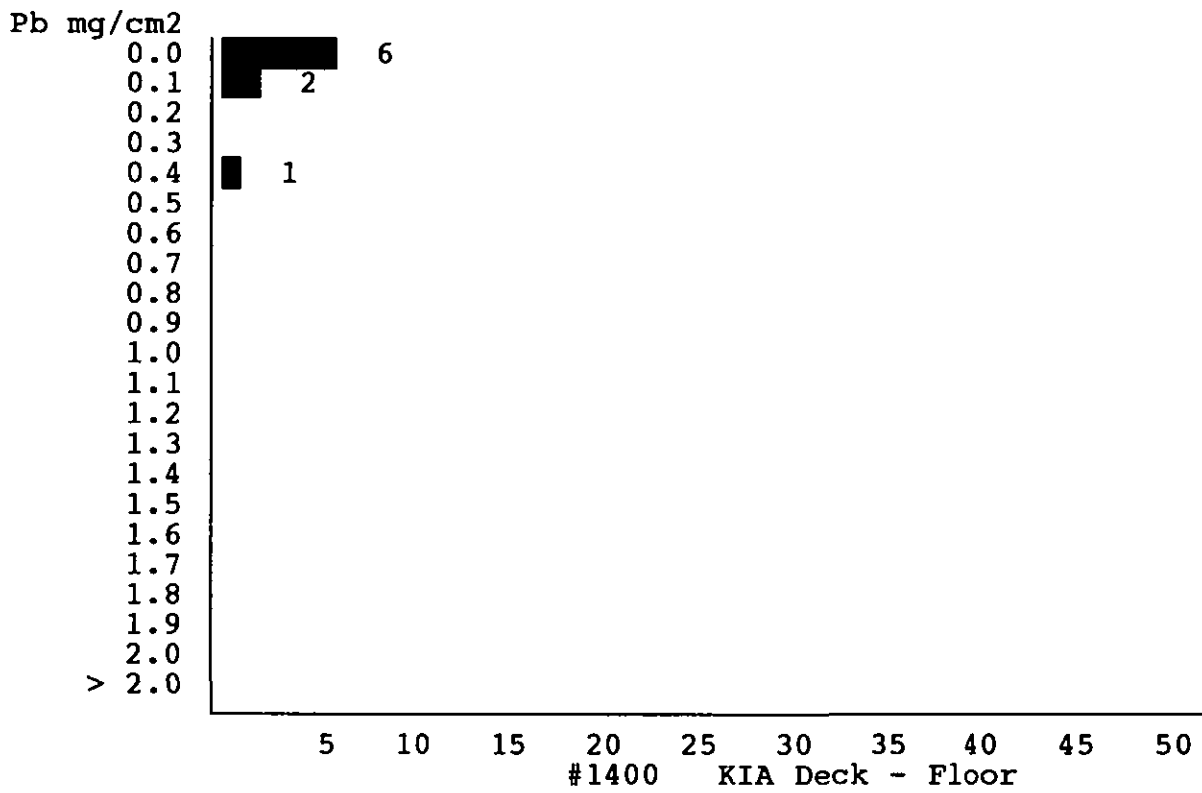

# Report Abbreviations

## "SIDE" Column Abbreviations:

The first letter indicates the wall location within the room.

A = Front      B = Left      C = Rear      D = Right

Note: The "A" wall of the unit is the wall that contains the front, (or main entrance ) door. In each room, closet, hall, etc., the "A" wall is also the same side as the front door.

If a second or third letter appears it indicates where an item is located on the wall.

L = Left      C = Center      R = Right      U = Upper      D = Lower

Example: The bedroom of the sample unit has 2 doors, both located on the "C" wall. The left is to the hallway and the right is to the closet. The hallway door was analyzed and is reported as "CL".

## "COND" Column Abbreviations

Paint Condition:

P = Peeling      CP = Chipping      I = Intact

Note: All painted surfaces should be considered "Intact" unless otherwise noted.

## Other Abbreviations:


BCC = Bare Concrete  
BRK = Brick  
CC = Concrete  
M = Metal  
PLY = Plywood  
W = Wood

BM = Bare Metal  
BW = Bare Wood  
FPM = Factory Painted Metal  
NA or N/A = No Access  
T = Tile  
AT = Acoustical Tile

BMS = Bare Metal Sliding  
BWS = Bare Wood Sliding  
PL = Plastic  
V = Vinyl  
Note: Others can be defined as necessary.

The "Pb", or lead, column gives the reading. For quick reference all readings in excess of the HUD limit are slightly indented to the left a few spaces in a separate column.

The "Description" column will be self explanatory.

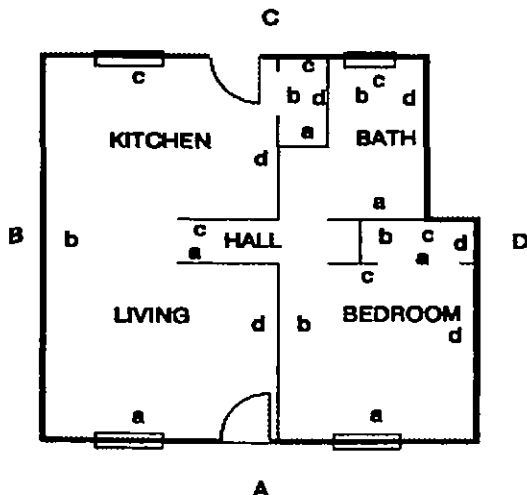


## Room "LOC" Abbreviations:

1st Letter	2nd Letter	3rd Letter
F = Front	L = Left	U = Upper
C = Center	C = Center	C = Center
R = Rear	R = Right	L = Lower

Room locations are only given when there are multiples of a particular type of room, i.e. bedrooms.

LEAD BASE PAINT TEST  
SUMMARY REPORT  
PROJECT WA2-08

Avondale Manor Apartments  
King County Housing Authority  
15455 65th Ave. S.  
Seattle, WA 98104  
File No.:  
Initial Start: 9/15/93  
Reported: 10/04/93

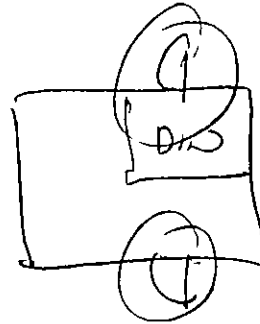

UNIT NO. 1	DESCRIPTION
Dining Room	Door: @ A, 2.0.
Exterior	Door: Jamb, @ A, 1.8-3.4.

UNIT NO. 2	DESCRIPTION
Dining Room	Door: <sup>door only</sup> @ A, 1.8.
Exterior	Door: <sup>door</sup> Jamb, @ A, 1.8-3.0.

UNIT NO. 3	DESCRIPTION
Dining Room	Door: @ A, 1.7. Windows: Sill, @ AL, 1.7.
Exterior	Door: <sup>door</sup> Jamb, @ A, 1.8-2.6.

UNIT NO. 4	DESCRIPTION
Dining Room	Door: @ A, 2.2.
Exterior	Door: Jamb, @ A, 1.8-2.8.

UNIT NO. 5	DESCRIPTION
Dining Room	Door: @ A, 1.8.
Exterior	Door: Jamb, @ A, 2.0-4.1.

UNIT NO. 6	DESCRIPTION
Dining Room	Windows: Sill, @ AR, 1.7.



## LEAD BASE PAINT TEST

## SUMMARY REPORT

PROJECT WA2-08

## UNIT NO. 15 (Cont.)

-----  
 Exterior Door: Casing, Jamb, @ A, 1.7-2.7.

## UNIT NO. 16 DESCRIPTION

-----  
 Dining Room Door: @ A, 2.2.  
 Windows: Sill, @ AR, 1.8.  
 Exterior (7) Door: Jamb, @ A, 1.8-2.9.

## UNIT NO. 17 DESCRIPTION

-----  
 Start Data Other: Test Block B, @ , , , 1.6-1.7.  
 Dining Room Door: @ A, 1.8.  
 Exterior Door: Jamb, @ A, 1.7-1.8.

## UNIT NO. 18 DESCRIPTION

-----  
 Exterior Door: @ A, 2.3.

## UNIT NO. 19 DESCRIPTION

-----  
 Dining Room Door: @ A, 1.7.  
 Windows: Sill, @ AR, 1.5.  
 Exterior (8) Door: Jamb, @ A, 1.5-3.5.

## UNIT NO. 20 DESCRIPTION

-----  
 Exterior Door: Jamb, @ A, 1.7.

LEAD BASE PAINT TEST  
 DETAILED REPORT  
 PROJECT WA2-08

Avondale Manor Apartments  
 King County Housing Authority  
 15455 65th Ave. S.  
 Seattle, WA 98104  
 File No.:  
 Initial Start: 9/15/93  
 Reported: 11/12/93

-----						
Unit No.	1		17107 NE 80th St. Apt #1			
-----						
			Side	Cond	K Pb ALC	Other Data
-----						
Start Data		Loc:		Room No.:	1	
Other	I.D. #22091832			M41	0.0	ASSAY NO.
Living Room		Loc:		Room No.:	2	
Walls	Lower		D		0.0	
Other	Ceiling/Joist				0.4	
Dining Room		Loc:		Room No.:	3	
Walls	Lower		A		0.0	
Door	Door		A		2.0	
	Casing		A		0.2	
Windows	Sill		A		0.0	
Other	Ceiling/Joist				0.1	
Kitchen		Loc:		Room No.:	4	
Walls	Lower		B		0.0	
Other	Fuse Box		B	M	0.4	
	Ceiling/Joist				0.0	
Utility		Loc:		Room No.:	5	
Walls	Lower		C		0.0	
Door	Door		B		0.1	
Other	Ceiling/Joist				0.1	
Staircase		Loc:		Room No.:	6	
Walls	Lower		D		0.0	
Other	Ceiling/Joist				0.1	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 1 (Cont.)

Unit No. 1 (Cont.)					
Hall		Loc: UP		Room No.:	7
Walls	Lower		B		0.0
Other	Ceiling/Joist				0.4
Closet	Walls		D		0.3
	Shelves		ALL	N/A	0.0
	Ceiling		ALL	N/A	0.0
Bathroom		Loc: UP		Room No.:	8
Walls	Lower		A		0.1
Other	Ceiling/Joist				0.1
Bedroom		Loc: UF		Room No.:	9
Walls	Lower		A		0.1
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		A		0.1
	Door		B		0.0
	Shelves		ALL	N/A	0.0
	Holdings		ALL	N/A	0.0
	Ceiling				0.0
Bedroom		Loc: UR		Room No.:	10
Walls	Lower		B		0.0
Windows	Sill		C		0.1
Other	Ceiling/Joist				0.0
Closet	Walls		D		0.4
	Door		B		0.0
	Shelves		D		0.0
	Holdings		ALL	N/A	0.0
	Ceiling				0.1
Exterior		Loc:		Room No.:	11
Door	Door		A		3.4
	Casing		A		0.0
	Jamb		A		1.8
Windows	Casing		A		0.2
Door	Trim		C		0.0
Siding	Siding		A		0.3
	Corner Trim		DL		0.0
	Upper Trim		A		0.3

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

---

 Unit No. 1 (Cont.)
 

---

Other	Fences	AR	0.1
Deck		Loc: C	Room No.: 12
Other	Floor		0.0
	Hand Rail	C	0.1
	Support	C	0.1

---

 Unit No. 2 17107 NE 80th St. Apt #2
 

---

		Side	Cond	K Pb ALC	Other Data
Start Data	Loc:			1	
Other	I.D. #22092031		Room No.: M41	0.0	ASSAY NO.
See Comments For Unit #13.					
Living Room	Loc:		Room No.:	2	
Walls	Lower	D		0.0	
Windows	Sill	C		0.0	
Other	Ceiling/Joist			0.0	
Dining Room	Loc:		Room No.:	3	
Walls	Lower	A		0.0	
Door	Door	A		1.8	
	Casing	A		0.1	
Windows	Sill	AR	LOW	0.0	BARE WOOD
		AL	UP	0.4	
Other	Ceiling/Joist			0.0	
Closet	Walls	A		0.2	
	Door	D		0.0	
	Shelves	B		0.0	
	Holdings	ALL	N/A	0.0	
	Ceiling			0.0	
Utility	Loc:		Room No.:	4	
Walls	Lower	A		0.0	
Door	Door	A		0.0	
Other	Ceiling/Joist			0.2	
Kitchen	Loc:		Room No.:	5	
Walls	Lower	C		0.0	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	2 (Cont.)				
Other	Fuse Box	D	M		0.5
	Ceiling/Joist				0.2
Staircase		Loc:		Room No.:	6
Walls	Lower		B		0.1
Other	Ceiling/Joist				0.0
Hall		Loc: UP		Room No.:	7
Walls	Lower		D		0.0
Other	Ceiling/Joist				0.0
Closet	Walls	D			0.0
	Shelves	ALL	N/A		0.0
	Ceiling				0.0
Bathroom		Loc: UP		Room No.:	8
Walls	Lower		A		0.0
Other	Ceiling/Joist				0.3
Bedroom		Loc: UF		Room No.:	9
Walls	Lower		C		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls	A			0.0
	Door	D			0.0
	Shelves	B			0.1
	Holdings	A			0.0
	Ceiling				0.0
Bedroom		Loc: URL		Room No.:	10
Walls	Lower		C		0.2
Windows	Sill		C		0.2
Other	Ceiling/Joist				0.0
Closet	Walls	D			0.0
	Door	C			0.2
	Shelves	A			0.2
	Holdings	D			0.4
	Ceiling				0.0
Bedroom		Loc: URR		Room No.:	11
Walls	Lower		D		0.0
Windows	Sill		C		0.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 2 (Cont.)

Other	Ceiling/Joist			0.0
Closet	Walls	B		0.0
	Door	C		0.0
	Shelves	A		0.3
	Holdings	B		0.0
	Ceiling			0.0
Exterior		Loc:	Room No.:	12
Door	Door	A		3.0
	Casing	A		0.2
	Jamb	A		1.8
Windows	Casing	A		0.4
	Siding	A		0.4
Siding	Eaves	C		0.0
	Upper Trim	A		0.0
	Other	Fences	AL	0.0
Door	Trim	C		0.4
Deck		Loc: C	Room No.:	13
Other	Hand Rail	C		0.3
	Support	C		0.0

Unit No. 3 17107 NE 80th St. Apt #3

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091832				ASSAY NO.
Living Room					
Walls	Lower	A			Room No.: 2 0.0
Windows	Sill	C			0.0
Other	Ceiling/Joist				0.0
Dining Room					
Walls	Lower	A			Room No.: 3 0.0
Door	Door	A			1.7
	Casing	A			0.2

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	3 (Cont.)				
Windows	Sill		AR		0.0
			AL	LOW	1.7
Other	Ceiling/Joist				0.0
Closet	Walls		A		0.3
	Door		B		0.0
	Shelves		D		0.0
	Holdings		A		0.0
	Ceiling				0.0
Kitchen		Loc:		Room No.:	4
Walls	Lower		B		0.0
Other	Fuse Box		B	M	0.3
	Ceiling/Joist				0.0
Utility		Loc:		Room No.:	5
Walls	Lower		C		0.0
Door	Door		B		0.0
Other	Shelf		C		0.0
	Ceiling/Joist				0.4
Staircase		Loc:		Room No.:	6
Walls	Lower		D		0.1
Other	Ceiling/Joist				0.4
Hall		Loc: UP		Room No.:	7
Walls	Lower		B		0.1
Other	Ceiling/Joist				0.0
Closet	Walls		A		0.0
	Shelves		ALL	N/A	0.0
	Ceiling		ALL	N/A	0.0
Bathroom		Loc: UP		Room No.:	8
Walls	Lower		A		0.0
Other	Ceiling/Joist				0.0
Bedroom		Loc: UF		Room No.:	9
Walls	Lower		A		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		B		0.0
	Shelves		ALL	N/A	0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	3 (Cont.)				
	Holdings		ALL	N/A	0.0
	Ceiling				0.0
Bedroom		Loc: URR		Room No.:	10
Walls	Lower		B		0.3
Windows	Sill		C	N/A	0.0
Other	Ceiling/Joist				0.0
Closet	Walls		B		0.0
	Door		C		0.0
	Shelves		A		0.0
	Holdings		B		0.0
	Ceiling				0.0
Bedroom		Loc: URL		Room No.:	11
Walls	Lower		B		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		D		0.4
	Door		C		0.0
	Shelves		A		0.0
	Holdings		D		0.0
	Ceiling				0.0
Exterior		Loc:		Room No.:	12
Door	Door		A		1.8
	Casing		A		0.0
	Jamb		A		2.6
Windows	Casing		A		0.0
Siding	Siding		C		0.3
	Eaves		C		0.0
	Upper Trim		C		0.0
Other	Fences		AR		0.0
Deck		Loc: C		Room No.:	13
Other	Floor				0.1
	Hand Rail		C		0.4
	Support		C		0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

-----  
 Unit No.        4        17107 NE 80th St. Apt #4  
 -----

			Side	Cond	K Pb ALC	Other Data
		Loc:				-----
Start Data		Loc:		Room No.:	1	
Other	I.D. #22091832			M41	0.0	ASSAY NO.
Living Room		Loc:		Room No.:	2	
Walls	Lower		C		0.4	
Windows	Sill		B		0.0	
Other	Ceiling/Joist				0.0	
Dining Room		Loc:		Room No.:	3	
Walls	Lower		A		0.0	
Door	Door		A		2.2	
	Casing		A		0.0	
Windows	Sill		A		0.0	
Other	Ceiling/Joist				0.0	
Kitchen		Loc:		Room No.:	4	
Walls	Lower		C		0.0	
Other	Fuse Box		D	M	0.5	
	Ceiling/Joist				0.0	
Utility		Loc:		Room No.:	5	
Walls	Lower		C		0.0	
Door	Door		D		0.0	
Other	Ceiling/Joist				0.0	
Staircase		Loc:		Room No.:	6	
Walls	Lower		B		0.0	
Other	Ceiling/Joist				0.3	
Note Other Staircases did not have a distinct ceiling from the upper hallway This unit did have one.						
Hall		Loc: UP		Room No.:	7	
Walls	Lower		D		0.0	
Other	Ceiling/Joist				0.1	
Closet	Walls		C		0.0	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 4 (Cont.)

	Shelves		ALL	N/A	0.0
	Ceiling		ALL	N/A	0.0
Bathroom		Loc: UP		Room No.:	8
Walls	Lower		A		0.3
Other	Ceiling/Joist				0.0
Bedroom		Loc: UF		Room No.:	9
Walls	Lower		C		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	All Surfaces			N/A	0.0
				Door Blocked.	
Bedroom		Loc: UR		Room No.:	10
Walls	Lower		A		0.0
			A		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.1
Closet	Walls		B		0.0
	Door		D		0.3
	Shelves		B		0.3
	Holdings		A		0.0
	Ceiling				0.0
Exterior		Loc:		Room No.:	11
Door	Door		A		1.8
	Casing		A		0.4
	Jamb		A		2.8
Windows	Casing		A		0.0
Siding	Siding		A		0.0
	Corner Trim		AL		0.1
	Upper Trim		C		0.0
Other	Fences		AL		0.2
Deck		Loc:		Room No.:	12
Other	Hand Rail		C		0.0
	Support		C		0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

-----  
 Unit No.        5        17107 NE 80th St. Apt #5  
 -----

		Side	Cond	K Pb ALC	Other Data
		-----	-----	-----	-----
Start Data	Loc:		Room No.:	1	
Other	I.D. #22091732		M41	0.0	ASSAY NO.
Living Room	Loc:		Room No.:	2	
Walls	Lower	C		0.0	
Windows	Sill	C		0.0	
Other	Ceiling/Joist			0.0	
Dining Room	Loc:		Room No.:	3	
Walls	Lower	A		0.0	
Door	Door	A		1.8	
	Casing	A		0.0	
Windows	Sill	AR		0.0	
		AL	LOW	0.4	
Other	Ceiling/Joist			0.0	
Closet	Walls	C		0.0	
	Door	B		0.4	
	Holdings	C		0.0	
	Ceiling			0.0	
Kitchen	Loc:		Room No.:	4	
Walls	Lower	B		0.2	
Other	Fuse Box	B	M	0.4	
	Ceiling/Joist			0.0	
Utility	Loc:		Room No.:	5	
Walls	Lower	C		0.0	
Door	Door	B		0.4	
Other	Ceiling/Joist			0.3	
Staircase	Loc:		Room No.:	6	
Walls	Lower	D		0.0	
Hall	Loc: UP		Room No.:	7	
Walls	Lower	B		0.0	
Other	Ceiling/Joist			0.0	
Closet	All Surfaces		N/A	0.0	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 5 (Cont.)

Closet Packed Full.

Bathroom		Loc: UP		Room No.:	8
Walls	Lower		A		0.4
Other	Ceiling/Joist				0.0
Bedroom		Loc: URR		Room No.:	9
Walls	Lower		B		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		B		0.0
	Door		C		0.0
	Shelves		A		0.0
	Holdings		B		0.0
	Ceiling				0.5
Bedroom		Loc: UFL		Room No.:	10
Walls	Lower		A		0.0
Windows	Sill		A		0.1
Other	Ceiling/Joist				0.0
Closet	Walls		C		0.0
	Door		B		0.0
	Ceiling				0.0
Bedroom		Loc: URL		Room No.:	11
Walls	Lower		B		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		D		0.0
	Door		C		0.0
	Shelves		ALL	BW	0.0
	Holdings		D		0.0
	Ceiling				0.0
Exterior		Loc:		Room No.:	12
Door	Door		A		4.1
	Casing		A		0.2
	Jamb		A		2.0
	Trim		C		0.0
Windows	Casing		C		0.0
Siding	Siding		C		0.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 5 (Cont.)

Eaves		C	0.0
Corner Trim		CL	0.0
Upper Trim		C	0.0
Deck			
Other	Floor	Loc: C	Room No.: 13
	Hand Rail	C	0.4
	Support	C	0.0
			0.1

Unit No. 6 17107 NE 80th St. Apt #6

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091732			Room No.: 1 M41	ASSAY NO. 0.0
Living Room					
Walls	Lower	C		Room No.: 2	0.3
Windows	Sill	C			0.0
Other	Ceiling/Joist				0.2
Dining Room					
Walls	Lower	A		Room No.: 3	0.0
Door	Door	A			0.4
	Casing	A			0.4
Windows	Sill	AR	low	1.7	
Other	Ceiling/Joist				0.0
Kitchen					
Walls	Lower	D		Room No.: 4	0.0
Other	Fuse Box	D	M		0.3
	Ceiling/Joist				0.0
Utility					
Walls	Lower	A		Room No.: 5	0.0
Door	Door	D			0.0
Other	Holder	A			0.0
	Ceiling/Joist				0.0
Bathroom					
		Loc: LOW		Room No.: 6	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	6 (Cont.)			
Walls	Lower		B	0.1
Windows	Sill		A	0.0
Other	Ceiling/Joist			0.0
Staircase		Loc:		Room No.:
Walls	Lower		A	7
				0.0
Hall		Loc: UP		Room No.:
Walls	Lower		B	8
				0.0
Other	Ceiling/Joist			0.0
Closet	Walls		B	0.0
	Shelves		ALL	N/A
				0.0
Other	Ceiling/Joist			0.2
Bathroom		Loc: UP		Room No.:
Walls	Lower		A	9
				0.0
Other	Ceiling/Joist			0.0
Bedroom		Loc: UFL		Room No.:
Walls	Lower		A	10
				0.0
Windows	Sill		A	0.0
Other	Ceiling/Joist			0.2
Closet	Walls		C	0.2
	Door		A	0.0
	Shelves		C	0.0
	Holdes		D	0.0
	Ceiling		V	0.0
Bedroom		Loc: UFR		Room No.:
Walls	Lower		D	11
				0.0
Windows	Sill		A	0.0
Other	Ceiling/Joist			0.0
Closet	Walls		B	0.3
	Door		A	0.0
	Shelves		C	N/A
	Holdes		B	0.2
	Ceiling			0.0
Bedroom		Loc: URL		Room No.:
Walls	Lower		C	12
				0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 6 (Cont.)

Door	Door	C	0.0
Other	Ceiling/Joist		0.0
Closet	Walls	D	0.0
	Door	C	0.4
	Shelves	A	0.0
	Holdes	D	0.3
	Ceiling		0.0
Bedroom		Loc: URR	Room No.: 13
Walls	Lower	B	0.0
Windows	Sill	C	0.0
Other	Ceiling/Joist		0.0
Closet	Walls	A	0.0
	Door	C	0.4
	Shelves	A	0.3
	Holdes	B	0.0
	Ceiling		0.0
Exterior		Loc:	Room No.: 14
Door	Door	A	0.0
	Casing	A	0.4
	Jamb	A	0.0
	Trim	C	0.4
Windows	Casing	A	0.1
Siding	Siding	A	0.1
	Eaves	A	0.0
	Upper Trim	A	0.3
Other	Fences	AL	0.0
Deck		Loc: C	Room No.: 15
Other	Floor	C	0.0
	Hand rail	C	0.0
	Support	C	0.0

Unit No. 7 17107 NE 80th St. Apt #7

	Side	Cond	K Pb ALC	Other Data
Start Data			1	
Other	I.D. #22091732	Loc:	Room No.: M41	0.0 ASSAY NO.

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 7 (Cont.)

Unit No. 7 (Cont.)		Loc:	Room No.:	
Living Room			2	
Walls	Lower	A		0.1
Windows	Sill	C		0.0
Other	Ceiling/Joist			0.0
Hall			3	
Walls	Lower	A		0.0
Door	Door	A		0.2
	Casing	A		0.0
Other	Ceiling/Joist			0.0
Kitchen			4	
Walls	Lower	B		0.0
Other	Fuse Box	B	M	0.4
	Ceiling/Joist			0.2
Utility			5	
Walls	Lower	C		0.0
Door	Door	B		0.0
Other	Holder	C		0.2
	Ceiling/Joist			0.0
Bathroom		Loc: LOW	6	
Walls	Lower	A		0.0
Windows	Sill	A		0.0
Other	Ceiling/Joist			0.0
Staircase			7	
Walls	Lower	A		0.0
Hall		Loc: UP	8	
Walls	Lower	B		0.1
Other	Ceiling/Joist			0.2
Closet	Walls	B		0.2
	Shelves	ALL	N/A	0.0
	Holdings	ALL	N/A	0.0
	Ceiling	ALL	N/A	0.0
Bathroom		Loc: UP	9	
Walls	Lower	C		0.0
Other	Ceiling/Joist			0.1

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

-----  
 Unit No.        7        (Cont.)  
 -----

Bedroom		Loc: URL	Room No.:	10
Walls	Lower	A		0.0
Windows	Sill	C		0.3
Other	Ceiling/Joist			0.0
Closet	Walls	D		0.1
	Door	C		0.0
	Shelves	A		0.4
	Holdes	D		0.0
	Ceiling			0.1
Bedroom		Loc: URR	Room No.:	11
Walls	Lower	B		0.0
Windows	Sill	C		0.0
Other	Ceiling/Joist			0.0
Closet	Walls	B		0.0
	Door	C		0.2
	Shelves	A	N/A	0.0
	Holdes	B		0.0
	Ceiling			0.3
Bedroom		Loc: UFL	Room No.:	12
Walls	Lower	A		0.0
Windows	Sill	A		0.1
Other	Ceiling/Joist			0.0
Closet	Walls	D		0.0
	Door	A		0.0
	Shelves	C		0.0
	Holdes	D		0.0
	Ceiling			0.0
Bedroom		Loc: UFR	Room No.:	13
Walls	Lower	B		0.3
Windows	Sill	A		0.0
Other	Ceiling/Joist			0.4
Closet	Walls	B		0.0
	Shelves	C	N/A	0.0
	Holdes	D		0.4
	Ceiling			0.4
Exterior		Loc:	Room No.:	14

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 7 (Cont.)

Door	Door	A	0.0
	Casing	A	0.0
	Jamb	A	2.8
	Trim	C	0.0
Windows	Casing	C	0.0
Siding	Siding	A	0.0
	Eaves	C	0.1
	Upper Trim	C	0.1
Other	Fences	AR	0.3
Deck		Loc:	Room No.: 15
Other	Floor		0.0
	Hand Rail	C	0.0
	Support	C	0.1

Unit No. 8 17107 NE 80th St. Apt #8

		Side	Cond	K Pb ALC	Other Data
Start Data	Loc:			Room No.: 1	
Other	I.D. #22091731			M41	ASSAY NO.
Living Room	Loc:			Room No.: 2	
Walls	Lower	C		0.0	
Windows	Casing	C		0.0	
Other	Ceiling/Joist			0.0	
Dining Room	Loc:			Room No.: 3	
Walls	Lower	A		0.0	
Door	Door	A		1.7	
	Casing	A		0.0	
Windows	Sill	AL		0.0	
		AR	LOW	0.0	
Other	Ceiling/Joist			0.0	
Closet	Walls	A		0.2	
	Door	D		0.3	
	Shelves	B		0.3	
	Holdings	A		0.2	
	Ceiling			0.0	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 8 (Cont.)

Unit No.	8	(Cont.)			
Utility Walls	Lower	Loc: A	Room No.:	4	0.0
Other	Holder	D			0.0
	Ceiling/Joist				0.0
Staircase Walls	Lower	Loc: D	Room No.:	5	0.0
Hall Walls	Lower	Loc: UP D	Room No.:	6	0.0
Other	Ceiling/Joist				0.5
Closet	Walls	B			0.0
	Shelves	B			0.0
	Holder	B			0.0
	Ceiling				0.0
Bathroom Walls	Lower	Loc: UP A	Room No.:	7	0.0
Other	Ceiling/Joist				0.0
Bedroom Walls	Lower	Loc: UFL AC	Room No.:	8	0.1
Windows	Sill	A			0.0
Other	Ceiling/Joist				0.0
Closet	Walls	A			0.0
	Door	D			0.4
	Shelves	B			0.0
	Holder	A			0.0
	Ceiling				0.0
Bedroom Walls	Lower	Loc: URL B	Room No.:	9	0.0
Windows	Sill	C	N/A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls	D			0.0
	Door	C			0.0
	Shelves	A			0.0
	Holder	D			0.0
	Ceiling				0.0
Bedroom Walls	Lower	Loc: URR B	Room No.:	10	0.4

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 8 (Cont.)

Windows	Sill	C	0.0
Other	Ceiling/Joist		0.0
Closet	All Surfaces	N/A	0.0
			Door Blocked.
Exterior		Loc:	Room No.:
Door	Door	A	11
	Casing	A	2.6
	Jamb	A	0.0
			17.0
Siding	Upper Trim	C	0.0
Windows	Casing	C	0.1
Siding	Siding	C	0.3
	Eaves	C	0.3
	Corner Trim	BR	0.0
Other	Fences	AL	0.1
Deck		Loc:	Room No.:
Other	Hand Rail	C	12
	Support	C	0.0
			0.1

Unit No. 9 17107 NE 80th St. Apt #9

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091731				ASSAY NO.
Living Room					
Walls	Lower	D		2	
				0.0	
Other	Ceiling/Joist			0.0	
Dining Room					
Walls	Lower	A		3	
				0.0	
Door	Door	A		0.0	
	Casing	A		0.0	
Windows	Sill	A		0.0	
Other	Ceiling/Joist			0.0	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	9 (Cont.)			
Kitchen Walls	Lower	Loc: A	Room No.:	4
				0.0
Other	Ceiling/Joist			0.0
Utility Walls	Lower	Loc: C	Room No.:	5
				0.0
Door	Door	B		0.0
Other	Holder Ceiling/Joist	C		0.0 0.2
Staircase Walls	Lower	Loc: D	Room No.:	6
				0.0
Hall Walls	Lower	Loc: UP B	Room No.:	7
				0.0
Other	Ceiling/Joist			0.1
Closet	Walls	C		0.0
	Shelves	ALL	N/A	0.0
	Ceiling	ALL	N/A	0.0
Bathroom Walls	Lower	Loc: UP A	Room No.:	8
				0.0
Other	Ceiling/Joist			0.0
Bedroom Walls	Lower	Loc: UR A	Room No.:	9
				0.0
Windows	Sill	C		0.2
Other	Ceiling/Joist			0.0
Closet	Walls	D		0.3
	Door	B		0.0
	Shelves	ALL	N/A	0.0
	Ceiling			0.0
Bedroom Walls	Lower	Loc: UF C	Room No.:	10
				0.4
Windows	Sill	A		0.0
Other	Ceiling/Joist			0.0
Closet	Walls	C		0.1
	Door	B		0.0
	Shelves	ALL	N/A	0.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 9 (Cont.)

	Holdings	ALL	N/A	0.0
	Ceiling			0.3
Exterior		Loc:	Room No.:	11
Door	Door	A		0.0
	Casing	A		0.0
	Jamb	A		0.0
	Trim	C		0.0
Windows	Casing	A		0.1
Siding	Siding	A		0.3
	Corner Trim	AR		0.0
	Upper Trim	A		0.3
Other	Fences	AR		0.0
Deck		Loc: C	Room No.:	12
Other	Hand Rail	D		0.0
	Support	D		0.0

Unit No. 10 17107 NE 80th St. Apt #10

		Side	Cond	K Pb ALC	Other Data
Start Data				Room No.:	1
Other	I.D. #22091731			M41	0.0
	Test Block A				0.2
					0.0
					0.1
	Test Block B			1.6	L 1.7 #5
				1.5	L 1.7 #6
				1.5	L 1.6 #7
Living Room				Room No.:	2
Walls	Lower	A			0.2
Windows	Sill	C			0.0
Other	Ceiling/Joist				0.2
Dining Room				Room No.:	3
Walls	Lower	A			0.1
Door	Door	A			0.0
	Casing	A			0.3
Windows	Sill	A			2.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No.	10 (Cont.)				
			A		0.0
Other	Ceiling/Joist				0.0
Kitchen		Loc:		Room No.:	4
Walls	Lower		D		0.0
Other	Fuse Box		D	M	0.3
	Ceiling/Joist				0.3
Closet	Walls		C		0.4
	Door		D		0.0
	Shelves		B		0.0
	Holdings		C		0.3
	Ceiling				0.0
Utility		Loc:		Room No.:	5
Walls	Lower		C		0.2
Door	Door		D		0.2
Other	Ceiling/Joist				0.0
Staircase		Loc:		Room No.:	6
Walls	Lower		B		0.0
Hall		Loc: UP		Room No.:	7
Walls	Lower		D		0.0
Other	Ceiling/Joist				0.4
Closet	Walls		A		0.2
	Shelves		B		0.0
	Ceiling				0.3
Bathroom		Loc: UP		Room No.:	8
Walls	Lower		C		0.4
Other	Ceiling/Joist				0.0
Bedroom		Loc: UFL		Room No.:	9
Walls	Lower		C		0.2
Windows	Sill		A		0.1
Other	Ceiling/Joist				0.1
Closet	Walls		B		0.0
	Door		D		0.3
	Shelves		B		0.0
	Holdings		C		0.0
	Ceiling				0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	10 (Cont.)			
Bedroom		Loc: UFL		Room No.: 10
Walls	Lower		D	0.0
Windows	Sill		C	0.1
Other	Ceiling/Joist			0.0
Closet	Walls		D	0.0
	Door		C	0.0
	Shelves		A	N/A 0.0
	Holdings		D	0.3
	Ceiling			0.4
Bedroom		Loc: URR		Room No.: 11
Walls	Lower		B	0.0
Windows	Sill		C	0.0
Other	Ceiling/Joist			0.1
Closet	Walls		B	0.0
	Door		C	0.0
	Shelves		A	0.1
	Holdings		B	0.1
	Ceiling			0.0
Exterior		Loc:		Room No.: 12
Door	Door		A	0.2
	Casing		A	0.4
	Jamb		A	0.0
	Trim		C	0.4
Windows	Casing		A	0.1
Siding	Siding		A	0.0
	Eaves		C	0.0
	Facia Board		ALL	N/A 0.0
	Upper Trim		A	0.1
Other	Fences		AL	0.1
Deck		Loc: C		Room No.: 13
Other	Hand Rail		C	0.0
	Support		C	0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

-----  
 Unit No. 11 17107 NE 80th St. Apt #12  
 -----

		Side	Cond	K Pb ALC	Other Data
		-----	-----	-----	-----
Start Data	Loc:		Room No.:	1	
Other	I.D. #22091732		M41	0.0	ASSAY NO.
See Comments for Unit #13.					
Living Room	Loc:		Room No.:	2	
Walls	Lower	C		0.1	
Other	Ceiling/Joist			0.2	
Dining Room	Loc:		Room No.:	3	
Walls	Lower	A		0.0	
Door	Door	A		0.0	
	Casing	A		0.0	
Windows	Sill	A		0.0	
Other	Ceiling/Joist			0.0	
Kitchen	Loc:		Room No.:	4	
Walls	Lower	C		0.0	
Other	Fuse Box	D	M	0.4	
	Ceiling/Joist			0.0	
Utility	Loc:		Room No.:	5	
Walls	Lower	C		0.0	
Door	Door	D		0.0	
Other	Ceiling/Joist			0.0	
Staircase	Loc:		Room No.:	6	
Walls	Lower	B		0.0	
Hall	Loc: UP		Room No.:	7	
Walls	Lower	D		0.0	
Other	Ceiling/Joist			0.0	
Closet	Walls	B		0.4	
	Shelves	ALL	N/A	0.0	
	Ceiling	ALL	N/A	0.0	
Bathroom	Loc: UP		Room No.:	8	
Walls	Lower	A		0.0	
Other	Ceiling/Joist			0.0	

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 11 (Cont.)

Unit No.	Loc:	Room No.:
Bedroom	UFR	9
Walls	Lower C	0.1
Windows	Sill A	0.0
Other	Ceiling/Joist	0.0
Closet	Walls C	0.0
	Door D	0.0
	Shelves ALL N/A	0.0
	Holdings ALL N/A	0.0
	Ceiling	0.4
Bedroom	URL	10
Walls	Lower A	0.0
Windows	Sill C N/A	0.0
Other	Ceiling/Joist	0.2
Closet	Walls B	0.2
	Door D	0.0
	Shelves B	0.2
	Holdings ALL N/A	0.0
	Ceiling	0.0
Exterior	Loc:	Room No.: 11
Door	Door A	0.2
	Casing A	0.5
	Jamb A	0.0
	Trim C N/A	0.0
Windows	Casing A	0.3
Siding	Siding A	0.2
	Corner Trim BL	0.0
	Upper Trim A	0.3
Other	Fences AL	0.0
Deck	Loc: C	Room No.: 12
Other	Hand Rail C	0.0
	Support C	0.1

Unit No. 12 17107 NE 80th St. Apt #14

Start Data	Loc:	Room No.:	Side	Cond	K Pb ALC	Other Data
Other	I.D. #22091631	M41			1 0.0	ASSAY NO.

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	12 (Cont.)					
Living Room		Loc:		Room No.:	2	
Walls	Lower		A		0.0	
Windows	Sill		C		0.0	
Other	Ceiling/Joist				0.2	
Kitchen		Loc:		Room No.:	3	
Walls	Lower		C		0.0	
Other	Ceiling/Joist				0.0	
Utility		Loc:		Room No.:	4	
Walls	Lower		C		0.1	#67
Other	Shelf		B		0.0	#68
	Holder		C		0.3	#69
	Ceiling/Joist				0.4	#70
Dining Room		Loc:		Room No.:	5	
Walls	Lower		A		0.0	#72
Door	Door		A		1.6	#77
	Casing		A		0.5	#80
Windows	Sill		AR		1.6	#82
Other	Ceiling/Joist				0.0	#83
Bathroom		Loc: LO		Room No.:	6	
Walls	Lower		C		0.0	
Windows	Sill		B		0.0	
Other	Ceiling/Joist			N/A	0.0	
Staircase		Loc:		Room No.:	7	
Walls	Lower				0.0	
Other	Ceiling/Joist			N/A	0.0	
Hall		Loc: UP		Room No.:	8	
Walls	Lower		B		0.0	
Other	Ceiling/Joist				0.0	
Closet	Walls		B		0.0	
	Ceiling				0.0	
Bathroom		Loc: UP		Room No.:	9	
Walls	Lower		A		0.3	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	12 (Cont.)				
Other	Ceiling/Joist				0.0
Bedroom		Loc: UFR		Room No.:	10
Walls	Lower		A		0.2
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		B		0.0
	Door		A		0.0
	Shelves		ALL	N/A	0.0
	Holdings		B		0.0
	Ceiling				0.0
Bedroom		Loc: UFL		Room No.:	11
Walls	Lower		A		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		D		0.0
	Shelves		C		0.0
	Holdings		D		0.0
	Ceiling				0.1
Bedroom		Loc: URL		Room No.:	12
Walls	Lower		C		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		D		0.0
	Door		C		0.0
	Shelves		ALL	N/A	0.0
	Holdings		D		0.0
	Ceiling				0.2
Bedroom		Loc: URR		Room No.:	13
Walls	Lower		C		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.2
Closet	Walls		B		0.2
	Door		C	F	0.0
	Shelves		A		0.0
	Holdings		B		0.0
	Ceiling				0.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 12 (Cont.)

Exterior		Loc:		Room No.:	14
Door	Door		A		2.2
	Casing		A		0.0
	Jamb		A		1.7
	Trim		C		0.0
Windows	Casing		A		0.0
Siding	Siding		A		0.0
			C		0.0
	Eaves		A		0.2
	Upper Trim		A		0.2
Deck		Loc: C		Room No.:	15
Other	Hand Rail		C		0.0
	Support		C		0.0

Unit No. 13 17107 NE 80th St. Apt #13

		Side	Cond	K Pb ALC	Other Data
Start Data	Loc:			Room No.:	1
Other	I.D. #22091631			M41	0.0
	Test Block A				0.1
					0.0
					0.3
	Test Block B			1.4	L 1.6 #5
				1.6	L 1.6 #6
				1.4	L 1.5 #7

and kithchen=V. All Window sashes FPM.

Living Room		Loc:		Room No.:	2
Walls	Lower		B		0.2
Windows	Sill		C		0.4 #9
Other	Ceiling/Joist				0.0 #10
Kitchen		Loc:		Room No.:	3
Walls	Lower		B		0.2 #11
Other	Fuse Box		B		0.3 #13
	Ceiling/Joist				0.4 #14
Laundry		Loc:		Room No.:	4
Other	All Surfaces			N/A	0.0
				Door	Blocked.
Dining Room		Loc:		Room No.:	5

## LEAD BASE PAINT TEST

## DETAIL REPORT

## PROJECT WA2-08

Unit No.	13 (Cont.)			
Walls	Lower	A	0.1	#15
Door	Door	A	0.1	#16
	Casing	A	0.0	#18
Windows	Sill	A	0.0	#19
Other	Ceiling/Joist		0.0	#20
Closet	All Surfaces	N/A	0.0	
			Door blocked.	
Staircase		Loc:	Room No.:	6
Walls	Lower	A	0.0	#21
Other	Ceiling/Joist		0.1	#22
Hall		Loc: UP	Room No.:	7
Walls	Lower	B	0.0	#23
Other	Ceiling/Joist		0.0	#24
Closet	Walls	A	0.0	#25
	Shelves	ALL	N/A	0.0
	Ceiling		0.0	#26
Bathroom		Loc: UP	Room No.:	8
Walls	Lower	A	0.2	#27
Other	Ceiling/Joist		0.0	#28
Bedroom		Loc: URR	Room No.:	9
Walls	Lower	C	0.0	#29
Windows	Sill	C	0.0	#30
Other	Ceiling/Joist		0.0	#31
Closet	Walls	D	0.0	#32
	Door	C	0.0	#33
	Shelves	A	0.0	#34
	Holdings	D	0.0	#35
	Ceiling		0.0	#36
Bedroom		Loc: URR	Room No.:	10
Walls	Lower	D	0.0	#37
Windows	Sill	C	0.0	#38
Other	Ceiling/Joist		0.0	#39
Closet	Walls	B	0.3	#40
	Door	C	0.0	#41

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 13 (Cont.)

	Shelves	A	0.1	#42
	Holdings	B	0.0	#43
	Ceiling		0.4	#44
Bedroom		Loc: UFL	Room No.: 11	
Other	All Surfaces		N/A 0.0	SLEEPER
Exterior		Loc:	Room No.: 12	
Door	Door	A	FPM 0.2	#45
	Casing	A	0.2	#46
	Jamb	A	2.5	#50
Windows	Casing	A	0.0	#51
Siding	Siding	A	0.0	#52
		D	0.2	#53
	Eaves	ALL	BW 0.0	
	Facia Board	ALL	N/A 0.0	
	Corner Trim	DL	0.0	#57
	Upper Trim	UP	0.2	#60
Deck		Loc: C	Room No.: 14	
Other	Support	D	0.0	#56
	Hand Rail	D	0.0	#57

Unit No. 14 17107 NE 80th St. Apt #11

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091631		Room No.: M41	1 0.0	ASSAY NO.
See Comments For Unit #13.					
Living Room			Room No.: 2		
Walls	Lower	C	0.0		
Windows	Sill	C	0.3		
Other	Ceiling/Joist		0.0		
Dining Room			Room No.: 3		
Walls	Lower	A	0.0		
Door	Door	A	0.0		
	Casing	A	0.0		
Windows	Sill	AR	0.0		
		AL	1.7		



LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 14 (Cont.)

Windows	Sill		C		0.0
Other	Ceiling/Joist				0.2
Closet	Walls		D		0.0
	Door		C		0.0
	Shelves		ALL	N/A	0.0
	Holdings		D		0.0
	Ceiling				0.0
Bedroom		Loc: URR		Room No.:	11
Walls	Lower		D		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.3
Closet	Walls		B		0.0
	Door		C		0.1
	Shelves		ALL	N/A	0.0
	Holdings		C		0.0
	Ceiling				0.0
Exterior		Loc:		Room No.:	12
Door	Door		A		0.4
	Casing		A		0.5
	Trim		C		0.2
Windows	Casing		A		0.0
Siding	Siding		A		0.0
	Upper Trim		A		0.3
	Eaves		ALL	N/A	0.0
	Facia Board		ALL	N/A	0.0
Deck		Loc:		Room No.:	13
Other	Hand Rail		C		0.0
	Support		C		0.0

Unit No. 15 17107 NE 80th St. Apt #15

		Side	Cond	K Pb ALC	Other Data
Start Data	Loc:			Room No.:	1
Other	I.D. #22091631			M41	0.0
					ASSAY NO.

See Comments For Unit #13

Living Room Loc: Room No.: 2



## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

-----  
 Unit No. 15 (Cont.)  
 -----

Other	Ceiling/Joist			0.0
Bedroom		Loc: UFR	Room No.:	10
Walls	Lower	A		0.0
Windows	Sill	A		0.0
Other	Ceiling/Joist			0.3
Closet	Walls	D		0.0
	Door	A		0.0
	Shelves	C	BW	0.0
	Holdings	B		0.2
	Ceiling			0.3
Bedroom		Loc: UFL	Room No.:	11
Walls	Lower	A		0.0
Windows	Sill	A		0.0
Other	Ceiling/Joist			0.0
Closet	Walls	D		0.3
	Door	A		0.0
	Shelves	C	BW	0.0
	Holdings	D		0.3
	Ceiling			0.3
Bedroom		Loc: URL	Room No.:	12
Walls	Lower	D		0.0
Windows	Sill	C		0.4
Other	Ceiling/Joist			0.0
Closet	Walls	D		0.0
	Door	D		0.0
	Shelves	A	BW	0.0
	Holdings	B		0.4
	Ceiling			0.0
Bedroom		Loc: URR	Room No.:	13
Walls	Lower	B		0.4
Windows	Sill	C		0.2
Other	Ceiling/Joist			0.0
Closet	Walls	B		0.0
	Door	C		0.0
	Shelves	A	BW	0.0
	Holdings	B		0.2

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 15 (Cont.)

	Ceiling			0.2
Exterior		Loc:	Room No.:	14
Door	Door	A		2.7
	Casing	A		1.7
	Jamb	A		1.7
	Trim	C		0.4
Windows	Casing	A		0.0
Siding	Siding	C		0.1
	Eaves	C		0.1
	Facia Board	ALL	N/A	0.0
	Upper Trim	C		0.4
Deck		Loc: C	Room No.:	15
Other	Hand Rail	C		0.0
	Support	C		0.0

Unit No. 16 17107 NE 80th St. Apt #16

		Side	Cond	K Pb ALC	Other Data
Start Data	Loc:			Room No.:	1
Other	I.D. #22091631			M41	0.0
See Comments For unit #13					
Living Room	Loc:			Room No.:	2
Walls	Lower	C			0.0
Windows	Sill	C			0.2
Other	Ceiling/Joist				0.2
Dining Room	Loc:			Room No.:	3
Walls	Lower	A			0.0
Door	Door	A		2.2	
	Casing	A		0.0	
Windows	Sill	AR		1.8	
		AL		0.0	
Other	Ceiling/Joist				0.0
Closet	Walls	C			0.0
	Door	D			0.0
	Shelves	B			0.0
	Holdes	C			0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	16 (Cont.)				
	Ceiling				0.4
Utility		Loc:		Room No.:	4
Walls	Lower		A		0.0
Door	Door		D		0.0
Other	Ceiling/Joist				0.1
Kitchen		Loc:		Room No.:	5
Walls	Lower		A		0.3
Other	Fuse Box		D	M	0.1
	Ceiling/Joist				0.1
Staircase		Loc:		Room No.:	6
Walls	Lower		B		0.0
Hall		Loc:		Room No.:	7
Walls	Lower		B		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		A		0.0
	Shelves		ALL	N/A	0.0
	Ceiling			N/A	0.0
Bathroom		Loc: UP		Room No.:	8
Walls	Lower		A		0.0
Other	Ceiling/Joist				0.0
Bedroom		Loc: UFL		Room No.:	9
Walls	Lower		A		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		B		0.0
	Door		D		0.0
	Shelves		ALL	N/A	0.0
	Holdings		ALL	N/A	0.0
	Ceiling				0.0
Bedroom		Loc: URR		Room No.:	10
Walls	Lower		C		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		B		0.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 16 (Cont.)

	Door		C		0.0
	Shelves		A		0.0
	Holdings		A		0.2
	Ceiling				0.0
Exterior		Loc:		Room No.:	11
Door	Door		A		2.9
	Casing		A		0.0
	Jamb		A		1.8
Windows	Casing		A		0.0
Door	Trim		C		0.2
Siding	Siding		A		0.0
	Facia Board		BR		0.0
	Corner Trim		BR		0.0
	Upper Trim		A		0.0
Other	Fences		AL		0.2
Deck		Loc: C		Room No.:	12
Other	Hand Rail		C		0.0
	Support		C		0.0

Unit No. 17 17107 NE 80th St. Apt #17

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091831			Room No.:	1
	Test Block A			M41	0.0
					0.0
					0.0
	Test Block B				0.2
					1.6
					1.6
					1.7
					L 0.0 #2
					L 0.0 #3
					L 0.0 #4
					L 1.6 #5
					L 1.7 #6
					L 1.6 #7

See Comments For Unit #13.

Living Room		Loc:		Room No.:	2
Walls	Lower		A		0.0
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.1
Dining Room		Loc:		Room No.:	3
Walls	Lower		A		0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	17 (Cont.)				
Door	Door	A		1.8	
	Casing	A		0.3	
Windows	Sill	AR	LOW	0.3	
		AL		0.3	
Other	Ceiling/Joist			0.3	
Closet	Walls	A		0.0	
	Door	D		0.0	
	Shelves	B		0.0	
	Holdings	A		0.3	
	Ceiling			0.0	
Kitchen		Loc:	Room No.:	4	
	Walls	Lower	D	0.0	
Other	Fuse Box	D	M	0.1	
	Ceiling/Joist			0.0	
Utility		Loc:	Room No.:	5	
	Walls	Lower	A	0.0	
Door	Door	D		0.0	
Other	Ceiling/Joist			0.0	
Staircase		Loc:	Room No.:	6	
	Walls	Lower	B	0.1	
Hall		Loc: UP	Room No.:	7	
	Walls	Lower	D	0.0	
Other	Ceiling/Joist			0.0	
Closet	Walls	A		0.1	
	Shelves	ALL	N/A	0.0	
	Ceiling		N/A	0.0	
Bathroom		Loc: UP	Room No.:	8	
	Walls	Lower	A	0.1	
Other	Ceiling/Joist			0.0	
Bedroom		Loc: URL	Room No.:	9	
	Walls	Lower	B	0.0	
Windows	Sill	C		0.4	
Other	Ceiling/Joist			0.0	
Closet	Walls	D		0.0	
	Door	C		0.0	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	17 (Cont.)			
	Shelves		A	0.0
	Holdings		D	0.4
	Ceiling			0.1
Bedroom		Loc: URR		Room No.: 10
Walls	Lower		B	0.0
Windows	Sill		C	0.0
Other	Ceiling/Joist			0.0
Closet	Walls		B	0.0
	Door		C	0.0
	Shelves		A	0.1
	Holdings		B	0.1
	Ceiling			0.0
Bedroom		Loc: UFR		Room No.: 11
Walls	Lower		C	0.0
Windows	Sill		A	0.0
Other	Ceiling/Joist			0.0
Closet	Walls		C	0.4
	Door		D	0.0
	Shelves		B	0.0
	Holdings		C	0.0
	Ceiling			0.2
Exterior		Loc:		Room No.: 12
Door	Door		A	1.8
	Casing		A	0.4
	Jamb		A	1.7
Windows	Casing		C	0.0
Siding	Siding		C	0.3
	Eaves		C	0.0
	Corner Trim		CR	0.1
	Upper Trim		C	0.0
Other	Fences		AL	0.0
Deck		Loc: C		Room No.: 13
Other	Floor			0.0
	Hand Rail		C	0.0
	Support		C	0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

## PROJECT WA2-08

-----  
 Unit No. 18 17107 NE 80th St. Apt #18  
 -----

		Side	Cond	K Pb ALC	Other Data
		----	----	----	-----
Start Data	Loc:		Room No.:	1	
Other	I.D. #22091831		M41	0.0	ASSAY NO.
Living Room	Loc:		Room No.:	2	
Walls	Lower	C		0.3	
Windows	Sill	C		0.3	
Other	Ceiling/Joist			0.0	
Dining Room	Loc:		Room No.:	3	
Walls	Lower	A		0.3	
Door	Door	A		0.3	
	Casing	A		0.3	
Windows	Sill	AR		0.0	
		AL	LOW	0.2	
Other	Ceiling/Joist			0.0	
Kitchen	Loc:		Room No.:	4	
Walls	Lower	B		0.1	
Other	Fuse Box	B	M	0.3	
	Ceiling/Joist			0.0	
Utility	Loc:		Room No.:	5	
Walls	Lower	C		0.1	
Door	Door	B		0.0	
Other	Shelf	D		0.0	
	Holder	C		0.3	
	Ceiling/Joist			0.0	
Bathroom	Loc: LOW		Room No.:	6	
Walls	Lower	A		0.0	
Windows	Sill	A		0.1	
Other	Ceiling/Joist			0.1	
Staircase	Loc:		Room No.:	7	
Walls	Lower	C		0.2	
Hall	Loc: UP		Room No.:	8	
Walls	Lower	B		0.0	
Other	Ceiling/Joist			0.1	

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	18 (Cont.)				
Closet	Walls		B		0.2
	Shelves		ALL	N/A	0.0
Other	Ceiling/Joist				0.0
Bathroom		Loc: UP		Room No.:	9
Walls	Lower		A		0.1
Other	Ceiling/Joist				0.2
Bedroom		Loc: URL		Room No.:	10
Walls	Lower		D		0.2
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		D		0.0
	Door		C		0.0
	Shelves		A		0.0
	Holdings		D		0.0
	Ceiling				0.4
Bedroom		Loc: URR		Room No.:	11
Walls	Lower		B		0.1
Windows	Sill		C		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		A		0.0
	Door		C		0.0
	Shelves		A		0.1
	Holdings		B		0.4
	Ceiling				0.0
Bedroom		Loc: UFL		Room No.:	12
Walls	Lower		D		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Closet	Walls		C		0.0
	Door		A		0.0
	Shelves		C		0.0
	Holdings		D		0.0
	Ceiling				0.0
Bedroom		Loc: UFR		Room No.:	13
Walls	Lower		B		0.0

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 18 (Cont.)

Windows	Sill	A	0.0
Other	Ceiling/Joist		0.3
Closet	Walls	B	0.2
	Door	A	0.0
	Shelves	C	0.0
	Holdings	B	0.0
	Ceiling		0.0
Exterior		Loc:	Room No.:
Door	Door	A	14
	Casing	A	2.3
	Jamb	A	0.4
	Trim	C	0.3
			0.0
Siding	Siding	A	0.0
	Eaves	A	0.0
	Upper Trim	A	0.0
Other	Fences	AR	0.3
Deck		Loc: C	Room No.:
Other	Floor		15
	Hand Rail	C	0.1
	Support	C	0.0

Unit No. 19 17107 NE 80th St. Apt #19

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091831			Room No.: 1 M41	0.0 ASSAY NO.
See Comments For Unit #13.					
Living Room				Room No.:	2
Walls	Lower	A			0.0
Windows	Sill	C			0.0
Other	Ceiling/Joist				0.3
Dining Room				Room No.:	3
Walls	Lower	A			0.0
Door	Door	A			1.7
	Casing	A			0.0
Windows	Sill	AR	LOW		1.5

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	19	(Cont.)			
			AL		0.0
Other	Ceiling/Joist				0.0
Kitchen Walls	Lower	Loc:	D	Room No.:	4 0.0
Other	fuse Box Ceiling/Joist		D	M	0.1 0.0
Bathroom Walls	Lower	Loc: LOW	B	Room No.:	5 0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.0
Utility Walls	Lower	Loc:	C	Room No.:	6 0.0
Door	Door		D		0.0
Other	Shelf Holder Ceiling/Joist		B C		0.0 0.0 0.0
Staircase Walls	Lower	Loc:	C	Room No.:	7 0.0
Hall Walls	Lower	Loc: UP	D	Room No.:	8 0.2
Other	Ceiling/Joist				0.0
Closet	Walls Shelves Ceiling		B ALL ALL	N/A N/A	0.0 0.0 0.0
Bathroom Walls	Lower	Loc: UP	A	Room No.:	9 0.0
Other	Ceiling/Joist				0.0
Bedroom Walls	Lower	Loc: UFL	B	Room No.:	10 0.2
Windows	Sill				0.0
Other	Ceiling/Joist				0.0
Closet	Walls Door Shelves		C A D		0.1 0.0 0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	19 (Cont.)		
	Holdings	B	0.0
	Ceiling		0.0
Bedroom		Loc: UFR	Room No.: 11
Walls	Lower	D	0.2
Windows	Sill	A	0.0
Other	Ceiling/Joist		0.0
Closet	Walls	B	0.0
	Door	A	0.1
	Shelves	C	0.0
	Holdings	B	0.0
	Ceiling		0.0
Bedroom		Loc: URL	Room No.: 12
Walls	Lower	D	0.3
Windows	Sill	C	0.0
Other	Ceiling/Joist		0.0
Closet	Walls	D	0.3
	Door	C	0.3
	Shelves	A	0.4
	Holdings	D	0.0
	Ceiling		0.0
Bedroom		Loc: URR	Room No.: 13
Walls	Lower	B	0.2
Windows	Sill	C	0.0
Other	Ceiling/Joist		0.2
Closet	Walls	A	0.3
	Door	C	0.0
	Shelves	A	0.0
	Holdings	B	0.0
	Ceiling		0.0
Exterior		Loc:	Room No.: 14
Door	Door	A	3.5
	Casing	A	0.0
	Jamb	A	1.5
	Trim	C	0.0
Windows	Casing	A	0.0
Siding	Siding	A	0.0
	Eaves	A	0.0
	Upper Trim	A	0.1

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 19 (Cont.)

Other	Fences	AL	0.0
Deck		Loc: C	Room No.: 15
Other	Hand Rail	C	0.0
	Support	C	0.0

Unit No. 20 17107 NE 80th St. Apt #20

		Side	Cond	K Pb ALC	Other Data
Start Data					
Other	I.D. #22091832				
					ASSAY NO.

See Comments For Unit #13.

Living Room		Loc:	Room No.:	2
Walls	Lower	D		0.0
Windows	Sill	C		0.0
Other	Ceiling/Joist			0.2

Dining Room		Loc:	Room No.:	3
Walls	Lower	A		0.0
Door	Door	A		0.0
	Casing	A		0.0
Windows	Sill	AR		0.0
		AL	LOW	0.3

Other	Ceiling/Joist			0.0
Closet	Walls	A		0.0
	Door	B		0.0
	Shelves	D		0.0
	Holdings	D		0.3
	Ceiling			0.4

Utility		Loc:	Room No.:	4
Walls	Lower	A		0.0
Door	Door	B		0.0
Other	Holder	A		0.0
	Ceiling/Joist			0.0

Kitchen		Loc:	Room No.:	5
Walls	Lower	B		0.1

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No.	20 (Cont.)				
Other	Fuse Box	B	M		0.1
	Ceiling/Joist				0.0
Staircase		Loc:		Room No.:	6
Walls	Lower		D		0.1
Hall		Loc: UP		Room No.:	7
Walls	Lower		D		0.0
Other	Ceiling/Joist				0.0
Closet	Walls	A			0.3
	Shelves	D			0.0
	Ceiling				0.3
Bedroom		Loc: UFR		Room No.:	8
Walls	Lower		B		0.0
Windows	Sill		A		0.0
Other	Ceiling/Joist				0.3
Closet	Walls	C			0.1
	Door	B			0.0
	Shelves	D			0.0
	Holdings	C			0.2
	Ceiling				0.0
Bathroom		Loc: UP		Room No.:	9
Walls	Lower		A		0.3
Other	Ceiling/Joist				0.0
Bedroom		Loc: UFR		Room No.:	10
Walls	Lower		B		0.0
Door	Door		A		0.0
Other	Ceiling/Joist				0.2
Closet	Walls	D			0.0
	Door	A			0.4
	Shelves	ALL	N/A		0.0
	Holdings	D			0.0
	Ceiling				0.4
Bedroom		Loc: URL		Room No.:	11
Walls	Lower		D		0.0
Windows	Sill		A		0.3
Other	Ceiling/Joist				0.1

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 20 (Cont.)

Closet	Walls	B	0.0
	Shelves	A	0.0
	Holders	C	0.3
	Ceiling		0.0
Exterior		Loc:	Room No.: 12
Door	Door	A	0.0
	Casing	A	0.0
	Jamb	A	1.7
	Trim	C	0.3
Windows	Casing	A	0.2
Siding	Siding	A	0.0
	Eaves	C	0.3
	Corner Trim	DL	0.0
	Upper Trim	A	0.2
Other	Fences	AR	0.2
Deck		Loc: C	Room No.: 13
Other	Floor		0.0
	Hand Rail	C	0.0
	Support	C	0.1

Unit No. 21 Community Center

		Side	Cond	K Pb ALC	Other Data
Start Data				Room No.: 1	
Other	I.D. #22091832			0.0	
Deck		Loc: EXT		Room No.: 2	
Door	Door	A		0.0	#124
	Casing	A		0.1	#125
Windows	Casing	A		0.0	#126
Siding	Siding	A		0.0	#127
	Corner Trim	A		0.1	#128
Other	Floor	A		0.0	#131
	Hand Rail	D		0.0	#129
	Support	D		0.0	#140
	Support Beam	D		0.3	#133
	Steps			0.0	#134
	Hand Rail		M	0.4	#135
Exterior		Loc: LOW		Room No.: 3	

LEAD BASE PAINT TEST

DETAIL REPORT

PROJECT WA2-08

Unit No. 21 (Cont.)

Door	Door	A		0.0	#139
	Casing	A		0.0	#141
Walls	Lower	D	CC	0.0	#138
Siding	Siding	A		0.0	#145
Other	Support Beam	A		0.1	#139
	Beam	A		0.2	#136

Start Data	Loc:	Room No.:	4
Other	ID 22092932	M22	0.0
	A Block	BW	0.0
		BW	0.0
		BW	0.0
	B Block		1.0
			0.8
			1.1

Rec. Room	Loc:	Room No.:	5
Walls	Lower	A	0.3
	Baseboards	ALL V	0.0
Door	Door	A	M 0.0
	Casing	A	M 0.0
	Jamb	A	M 0.0
Windows	Sill	ALL	BW 0.0
	Casing	ALL	BW 0.0
	Sash	ALL	BM 0.0
Other	Ceiling/Joist		0.0
	Heating Units	ALL	FPM 0.0
Closet	Walls	D	0.1
	Baseboards	ALL	V 0.0
	Door	A	BW 0.0
	Casing	A	BW 0.0
	Jamb	A	BW 0.0
	Shelves	ALL	BW 0.0
	Holdings	ALL	BW 0.0
	Ceiling		0.1

Kitchen	Loc:	Room No.:	6
Walls	Lower	B	0.0
	Baseboards	ALL	BW 0.0
Door	Door	ALL	BW 0.0
	Casing	ALL	BW 0.0
	Jamb	ALL	BW 0.0
Cabinets	Upper	ALL	BW 0.0
	Lower	ALL	BW 0.0

## LEAD BASE PAINT TEST

## DETAIL REPORT

PROJECT WA2-08

Unit No. 21 (Cont.)

Rear Lobby		Loc:	Room No.:		
Walls	Lower	C		7	0.2
	Baseboards	ALL	V		0.0
Door	Door	C	M		0.2
	Casing	C			0.0
	Jamb	C			0.0
Windows	Sill	ALL	BW		0.0
	Casing	ALL	BW		0.0
	Sash	ALL	BM		0.0
Other	Ceiling/Joist				0.0
	Shelves	B			0.1
Staircase		Loc:	Room No.:		
Walls	Lower	D		8	0.0
	Upper	D			0.0
	Chair Rail	D	BW		0.0
	Baseboards	ALL	V		0.0
Door	Door	ALL	BW		0.0
	Casing	ALL	BW		0.0
	Jamb	ALL	BW		0.0
Stairs	Treads	ALL	V		0.0
	Risers	ALL	V		0.0
	Stringers	ALL	V		0.0
	Handrail		BW		0.0
	Railing Cap		BW		0.0
Bathroom		Loc: FNT	Room No.:		
Walls	Lower	ALL	V	9	0.0
	Upper	B			0.1
	Baseboards	ALL	V		0.0
Door	Door	B	BW		0.0
	Casing	B	BW		0.0
Other	Ceiling/Joist				0.0
	Partition		M		0.2
Bathroom		Loc: REA	Room No.:		
Walls	Lower	A		10	0.0
	Baseboards	ALL	V		0.0
Door	Door	B	BW		0.0
	Casing	B	BW		0.0
Other	Ceiling/Joist				0.1
	Partition		M		0.3