

Lead-Based Paint Inspection Report

Pacific Court Apartments
4028 South 146th Street
Tukwila, WA 98168

Prepared for:
King County Housing Authority
700 Andover Park West
Seattle, Washington 98188

November 3, 2023
PBS Project 40573.257



214 E GALER STREET, SUITE 300
SEATTLE, WA 98102
206.233.9639 MAIN
866.727.0140 FAX
PBSUSA.COM

LEAD-BASED PAINT INSPECTION REPORT

Pacific Court Apartments
4028 South 146th Street
Tukwila, Washington 98198

Prepared for:

King County Housing Authority
700 Andover Park West
Seattle, Washington 98188

Prepared by:

PBS Engineering and Environmental
214 E Galer Street, Suite 300
Seattle, WA 98102
(206) 233-9639

PBS Project 40573.257
November 3, 2023

This report is for the exclusive use of the client for planned development of the property and is not to be relied upon by other parties. It is not to be photographed, photocopied, or similarly reproduced in total or in part without the expressed written consent of the client and PBS.

TABLE OF CONTENTS

1 IDENTIFYING INFORMATION 1

2 LEAD-BASED PAINT INSPECTION 2

 2.1 Site Information..... 2

 2.2 Lead-Based Paint Inspection and Sampling 2

 2.2.1 XRF Sampling..... 2

 2.2.2 Bulk Paint-Chip Sampling 3

Supporting Data

APPENDICES

Tab 1: XRF Data Sheets

Tab 2: Certifications

©2020 PBS Engineering and Environmental Inc.

1 IDENTIFYING INFORMATION

BUILDING DATA

Pacific Court Apartments
Buildings A, B, and C
4028 S, 146th Street
Tukwila, WA 98198

CLIENT DATA

King County Housing Authority (KCHA)
700 Andover Park West
Seattle, WA 98188


SCOPE OF ASSESSMENT

KCHA has requested that PBS perform lead-based paint inspections of Buildings A, B and C at Pacific Court Apartments. According to KCHA, the Recreation Building was constructed in 2012 and therefore, not included in the Lead-Based Paint Inspection. PBS Engineering and Environmental, Inc. (PBS) conducted a lead-based paint inspection of nineteen 19 of the 32 Units at Pacific Court Apartments on October 24 - 27, 2023 in accordance with Chapter 7: Lead-Based Paint Inspection of the U.S. Department of Housing and Urban Development (HUD), Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing (HUD Guidelines).

CERTIFICATIONS

Lead Inspector/Risk Assessor

Janet Murphy
State of Washington Risk Assessor Certification No: 0258
Expiration Date: 03/08/2025

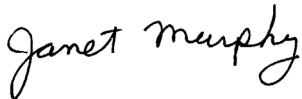

Signature

November 2, 2023

Date

Firm

PBS Engineering and Environmental
214 E Galer Street, Suite 300
Seattle, Washington 98102
Telephone: 206.223.9639

Certification No: 178
Expiration Date: 09/03/2025

2 LEAD-BASED PAINT INSPECTION

2.1 Site Information

Pacific Court consists of four (4) buildings with a total of 32 units. This inspection was limited to Building A, B and C. The buildings are of wood construction with gypsum interior walls and ceilings. The exterior is cement board siding and wood trim. Apartment units are one and two bedrooms with a bathroom and a kitchen/living room area. The buildings are in good condition.

Architectural finishes are uniform throughout. The majority of the interior components are painted. Walls are painted gypsum wallboard. Windows in units have wood or granite sills. Doors and door frames are painted wood, cement board or medium density fiberboard (MDF). The window frames are vinyl or painted MDF. Covebase is vinyl or painted MDF. Some units have painted drywall wainscot. All MDF has a factory coating of white paint. Unit A4 was under renovation. Walls in the bedroom, bathroom and kitchen had been removed. Unit A21 was also being renovated. Window frames, sills and interior doors were not present.

2.2 Lead-Based Paint Inspection and Sampling

Based on a review of King County Assessor records, Pacific Court Apartments were constructed in 1970. AS previously discussed, KCHA requested that this inspection include Building A, B and C only. A total of 32 units are present in Buildings A, B and C. Based on the unit selection criteria in Table 7.3 of Chapter 7 of the HUD Guidelines, (19) Units were inspected. The Recreation Building was not included in the survey.

2.2.1 XRF Sampling

The presence of lead in paint was determined through x-ray fluorescence spectroscopy. A handheld Niton Inc. X-Ray Fluorescence (XRF) Analyzer, Model XLP 300A Version 5.2.1 P/N 500-926 Serial #102877 operating in lead paint mode was used to perform a surface-by-surface lead paint inspection of each painted surface in the selected units and other building areas. Calibration was checked based on the requirements of the Performance Characteristic Sheet for the XRF Analyzer. All calibration readings were within the tolerance for this instrument. No substrate correction is required with this instrument.

HUD and the U.S. Environmental Protection Agency (EPA) have set 1.0 milligrams per square centimeter (mg/cm^2) as the threshold limit for lead-based paint as determined through X-Ray Fluorescence (XRF) testing. HUD and EPA have set 5,000 parts per million (ppm) or 0.5% by atomic absorption spectroscopy (AAS) laboratory analysis as the threshold limit for lead-based paint. Paint that is known to contain lead levels less than those described above does not have to be evaluated, although all deteriorated paint (paint surfaces in poor condition) should be repaired because it may contain lower levels of lead that may contribute to lead dust or lead contaminated soil hazards.

The "Side" information presented on the XRF data sheets is in relation to the side of the rooms or building exteriors where the unit number is located. The inspector/risk assessor used the address side of each residence as the basis to establish side "A." Sides B, C, and D follow in clockwise rotation.

Please refer to the XRF Sample Data Table located in Tab 1 for a complete list of XRF samples.

2.2.2 Bulk Paint-Chip Sampling

Bulk paint chip verification samples are collected when there is an inconclusive result with the XRF. There were no inconclusive results with the XRF analyzer. No bulk paint chip samples were collected.

2.2.3 Components with Lead-Based Paint

Lead was **not** found in any of the paint on building components associated with Building A, B and C. at Pacific Court Apartments above the HUD lead-based paint threshold of 1.0 mg/cm² by XRF.

TAB 1

XRF Data Sheets

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
1	10/24/2023 10:46	SHUTTER CAL								9.66
2	10/24/2023 10:49	NIST	PAINT			RED		CALIBRATION	Positive	1.1
3	10/24/2023 10:50	NIST	PAINT			RED		CALIBRATION	Positive	1.1
4	10/24/2023 10:50	NIST	PAINT			RED		CALIBRATION	Positive	1.5
5	10/24/2023 11:06	SIDING	WOOD	A	INTACT	YELLOW	OUTSIDE	BUILDING A SIDING	Negative	<LOD
6	10/24/2023 11:07	SIDING	WOOD	A	INTACT	RED	OUTSIDE	BUILDING A SIDING	Negative	<LOD
7	10/24/2023 11:08	RISER	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
8	10/24/2023 11:09	STAIR SOFFIT	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
9	10/24/2023 11:09	STAIR TREAD	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
10	10/24/2023 11:11	WALL	CEMENT BOARD	C	INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
11	10/24/2023 11:12	WALL	CEMENT BOARD	C	INTACT	YELLOW	OUTSIDE	BUILDING A SIDING	Negative	<LOD
12	10/24/2023 11:12	WALL	CEMENT BOARD	B	INTACT	YELLOW	OUTSIDE	BUILDING A SIDING	Negative	<LOD
13	10/24/2023 11:12	WALL	CEMENT BOARD	D	INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
14	10/24/2023 11:19	WALL	CEMENT BOARD	D	INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
15	10/24/2023 11:20	WALL	CEMENT BOARD	D	INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
16	10/24/2023 11:20	WALL	CEMENT BOARD	B	INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
17	10/24/2023 11:21	WALL	CEMENT BOARD	C	INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
18	10/24/2023 11:23	SOFFIT	CEMENT BOARD		INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
19	10/24/2023 11:24	SOFFIT	CEMENT BOARD		INTACT	YELLOW	OUTSIDE	BUILDING A STAIRS	Negative	<LOD
20	10/24/2023 11:27	SKIRT	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING A	Duplicate	<LOD
21	10/24/2023 11:27	SKIRT	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
22	10/24/2023 11:28	SKIRT	WOOD	A	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
23	10/24/2023 11:29	SKIRT	WOOD	B	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
24	10/24/2023 11:30	TRIM	WOOD	B	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
25	10/24/2023 11:31	SIDING	WOOD	B	INTACT	YELLOW	OUTSIDE	BUILDING A	Negative	<LOD
26	10/24/2023 11:31	SIDING	WOOD	B	INTACT	RED	OUTSIDE	BUILDING A	Negative	<LOD
27	10/24/2023 11:33	SIDING	CEMENT BOARD	C	INTACT	RED	OUTSIDE	BUILDING A	Negative	<LOD
28	10/24/2023 11:33	SIDING	CEMENT BOARD	C	INTACT	YELLOW	OUTSIDE	BUILDING A	Negative	<LOD
29	10/24/2023 11:34	TRIM	CEMENT BOARD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
30	10/24/2023 11:35	SKIRT	CEMENT BOARD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
31	10/24/2023 11:41	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING A	Negative	<LOD
32	10/24/2023 11:42	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING A	Negative	<LOD
33	10/24/2023 11:43	WINDOW FRAME	WOOD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
34	10/24/2023 11:43	WINDOW FRAME	WOOD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
35	10/24/2023 11:43	WINDOW FRAME	WOOD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
36	10/24/2023 11:43	WINDOW FRAME	WOOD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
37	10/24/2023 11:44	WINDOW FRAME	WOOD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
38	10/24/2023 11:44	WINDOW FRAME	WOOD	C	INTACT	WHITE	OUTSIDE	BUILDING A	Duplicate	<LOD
39	10/24/2023 11:45	SIDING	CEMENT BOARD	C	INTACT	RED	OUTSIDE	BUILDING A	Negative	<LOD
40	10/24/2023 11:46	SIDING	CEMENT BOARD	C	INTACT	YELLOW	OUTSIDE	BUILDING A	Negative	<LOD
41	10/24/2023 11:47	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING A	Negative	<LOD
42	10/24/2023 11:47	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING A	Negative	<LOD
43	10/24/2023 11:49	SKIRT	CONCRETE	D	INTACT	TAN	OUTSIDE	BUILDING A	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
44	10/24/2023 11:50	SIDING	HARDY BOARD	D	INTACT	TAN	OUTSIDE	BUILDING A	Negative	<LOD
45	10/24/2023 11:51	WINDOW FRAME	WOOD	D	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
46	10/24/2023 11:51	WINDOW FRAME	WOOD	D	INTACT	WHITE	OUTSIDE	BUILDING A	Negative	<LOD
47	10/24/2023 11:57	SIDING	CEMENT BOARD	A	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
48	10/24/2023 11:57	SIDING	CEMENT BOARD	A	INTACT	RED	OUTSIDE	BUILDING B	Negative	<LOD
49	10/24/2023 11:58	SIDING	CEMENT BOARD	B	INTACT	RED	OUTSIDE	BUILDING B	Negative	<LOD
50	10/24/2023 11:58	SIDING	CEMENT BOARD	B	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
51	10/24/2023 11:59	SIDING	CEMENT BOARD	C	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
52	10/24/2023 11:59	SIDING	CEMENT BOARD	C	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
53	10/24/2023 12:00	SIDING	CEMENT BOARD	D	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
54	10/24/2023 12:00	SIDING	CEMENT BOARD	D	INTACT	RED	OUTSIDE	BUILDING B	Negative	<LOD
55	10/24/2023 12:01	WINDOW FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
56	10/24/2023 12:01	WINDOW FRAME	CEMENT BOARD	B	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
57	10/24/2023 12:02	WINDOW FRAME	CEMENT BOARD	C	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
58	10/24/2023 12:02	WINDOW FRAME	CEMENT BOARD	D	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
59	10/24/2023 12:03	TRIM	CEMENT BOARD	D	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
60	10/24/2023 12:03	TRIM	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
61	10/24/2023 12:04	TRIM	CEMENT BOARD	B	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
62	10/24/2023 12:04	TRIM	CEMENT BOARD	C	INTACT	WHITE	OUTSIDE	BUILDING B	Negative	<LOD
63	10/24/2023 12:05	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
64	10/24/2023 12:05	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
65	10/24/2023 12:06	SKIRT	CONCRETE	C	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
66	10/24/2023 12:08	DOWNSPOUTS	VINYL	A	INTACT	RED	OUTSIDE	BUILDING B	Negative	<LOD
67	10/24/2023 12:08	DOWNSPOUTS	VINYL	A	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
68	10/24/2023 12:09	DOWNSPOUTS	METAL	D	INTACT	RED	OUTSIDE	BUILDING B	Negative	<LOD
69	10/24/2023 12:10	DOWNSPOUTS	METAL	D	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
70	10/24/2023 12:14	CRAWLSPACE COVER	METAL	D	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
71	10/24/2023 12:14	CRAWLSPACE COVER	METAL	D	INTACT	TAN	OUTSIDE	BUILDING B	Negative	<LOD
72	10/24/2023 12:15	CRAWLSPACE COVER	WOOD	D	INTACT	GREEN	OUTSIDE	BUILDING B	Negative	<LOD
73	10/24/2023 12:17	DOOR	METAL	A	INTACT	YELLOW	OUTSIDE	BUILDING B	Negative	<LOD
74	10/24/2023 12:17	DOOR	METAL	A	INTACT	YELLOW	OUTSIDE	BUILDING B	Negative	<LOD
75	10/24/2023 12:17	DOOR	METAL	A	INTACT	YELLOW	OUTSIDE	BUILDING B	Negative	<LOD
76	10/24/2023 12:19	STAIRWELL SURFACE	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
77	10/24/2023 12:19	STAIRWELL SURFACE	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
78	10/24/2023 12:20	STAIRWELL SURFACE	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
79	10/24/2023 12:20	STAIRWELL SURFACE	WOOD	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
80	10/24/2023 12:22	STAIRWELL COVEBASE	CONCRETE	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
81	10/24/2023 12:23	STAIRWELL COVEBASE	CONCRETE	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
82	10/24/2023 12:23	STAIRWELL COVEBASE	CONCRETE	A	INTACT	GRAY	OUTSIDE	BUILDING B	Negative	<LOD
83	10/24/2023 12:24	STAIRWELL HANDRAIL	METAL	A	INTACT	BROWN	OUTSIDE	BUILDING B	Negative	<LOD
84	10/24/2023 12:24	STAIRWELL HANDRAIL	METAL	A	INTACT	BROWN	OUTSIDE	BUILDING B	Negative	<LOD
85	10/24/2023 12:26	SIDING	CEMENT BOARD	A	INTACT	TAN	OUTSIDE	BUILDING C	Negative	<LOD
86	10/24/2023 12:26	SIDING	CEMENT BOARD	A	INTACT	RED	OUTSIDE	BUILDING C	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
87	10/24/2023 12:27	SIDING	CEMENT BOARD	B	INTACT	TAN	OUTSIDE	BUILDING C	Negative	<LOD
88	10/24/2023 12:27	SIDING	CEMENT BOARD	C	INTACT	TAN	OUTSIDE	BUILDING C	Negative	<LOD
89	10/24/2023 12:27	SIDING	CEMENT BOARD	D	INTACT	TAN	OUTSIDE	BUILDING C	Negative	<LOD
90	10/24/2023 12:28	SIDING	CEMENT BOARD	D	INTACT	RED	OUTSIDE	BUILDING C	Negative	<LOD
91	10/24/2023 12:29	SOFFIT	CEMENT BOARD	C	INTACT	TAN	OUTSIDE	BUILDING C	Negative	<LOD
92	10/24/2023 12:30	WINDOW FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
93	10/24/2023 12:30	WINDOW FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
94	10/24/2023 12:30	WINDOW FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
95	10/24/2023 12:31	WINDOW FRAME	CEMENT BOARD	D	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
96	10/24/2023 12:32	DOOR FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
97	10/24/2023 12:32	DOOR FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
98	10/24/2023 12:32	DOOR FRAME	CEMENT BOARD	A	INTACT	WHITE	OUTSIDE	BUILDING C	Negative	<LOD
99	10/24/2023 12:33	DOOR	METAL	A	INTACT	YELLOW	OUTSIDE	BUILDING C	Negative	<LOD
100	10/24/2023 12:33	DOOR	METAL	A	INTACT	YELLOW	OUTSIDE	BUILDING C	Negative	<LOD
101	10/24/2023 12:33	DOOR	METAL	A	INTACT	YELLOW	OUTSIDE	BUILDING C	Negative	<LOD
102	10/24/2023 12:35	BENCHES	METAL		INTACT	SILVER	OUTSIDE	BUILDING C	Negative	<LOD
103	10/24/2023 12:35	BENCHES	METAL		INTACT	SILVER	OUTSIDE	BUILDING C	Negative	<LOD
104	10/24/2023 12:48	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A4	Negative	<LOD
105	10/24/2023 12:48	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A4	Negative	<LOD
106	10/24/2023 12:51	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A4	Negative	<LOD
107	10/24/2023 12:51	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A4	Negative	<LOD
108	10/24/2023 12:51	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A4	Negative	<LOD
109	10/24/2023 12:52	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT A4	Negative	<LOD
110	10/24/2023 13:02	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNT A21	Negative	<LOD
111	10/24/2023 13:03	CEILING	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
112	10/24/2023 13:04	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
113	10/24/2023 13:04	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
114	10/24/2023 13:04	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
115	10/24/2023 13:05	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
116	10/24/2023 13:06	WINDOW SILL	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
117	10/24/2023 13:06	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
118	10/24/2023 13:08	DOOR	METAL	D	INTACT	YELLOW	LIVING ROOM	UNIT A21	Negative	<LOD
119	10/24/2023 13:08	DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A21	Negative	<LOD
120	10/24/2023 13:09	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A21	Negative	<LOD
121	10/24/2023 13:10	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A21	Negative	<LOD
122	10/24/2023 13:10	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A21	Negative	<LOD
123	10/24/2023 13:11	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A21	Negative	<LOD
124	10/24/2023 13:11	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A21	Negative	<LOD
125	10/24/2023 13:12	CABINETRY	WOOD	D	INTACT	TAN	KITCHEN	UNIT A21	Negative	<LOD
126	10/24/2023 13:13	CABINETRY	WOOD	D	INTACT	TAN	BATHROOM	UNIT A21	Negative	<LOD
127	10/24/2023 13:14	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
128	10/24/2023 13:14	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
129	10/24/2023 13:15	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
130	10/24/2023 13:15	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
131	10/24/2023 13:15	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
132	10/24/2023 13:16	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
133	10/24/2023 13:16	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
134	10/24/2023 13:17	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A21	Negative	<LOD
135	10/24/2023 13:19	CEILING	DRYWALL		INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
136	10/24/2023 13:19	WALL	DRYWALL	A	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
137	10/24/2023 13:19	WALL	DRYWALL	B	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
138	10/24/2023 13:20	WALL	DRYWALL	C	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
139	10/24/2023 13:20	WALL	DRYWALL	D	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
140	10/24/2023 13:21	ROLL DOOR	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
141	10/24/2023 13:21	ROLL DOOR FRAME	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
142	10/24/2023 13:22	DOOR	WOOD	B	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
143	10/24/2023 13:23	DOOR FRAME	WOOD	B	INTACT	WHITE	WEST BEDROOM	UNIT A21	Negative	<LOD
144	10/24/2023 13:25	CEILING	DRYWALL		INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
145	10/24/2023 13:25	WALL	DRYWALL	A	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
146	10/24/2023 13:26	WALL	DRYWALL	B	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
147	10/24/2023 13:26	WALL	DRYWALL	C	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
148	10/24/2023 13:26	WALL	DRYWALL	D	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
149	10/24/2023 13:27	DOOR	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
150	10/24/2023 13:27	DOOR FRAME	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
151	10/24/2023 13:28	ROLL DOOR	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
152	10/24/2023 13:28	ROLL DOOR FRAME	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
153	10/24/2023 13:29	WINDOW SILL	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
154	10/24/2023 13:30	WINDOW FRAME	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
155	10/24/2023 13:30	WINDOW FRAME	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A21	Negative	<LOD
156	10/24/2023 13:35	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B9	Negative	<LOD
157	10/24/2023 13:35	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT B9	Negative	<LOD
158	10/24/2023 13:36	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT B9	Negative	<LOD
159	10/24/2023 13:36	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT B9	Negative	<LOD
160	10/24/2023 13:36	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT B9	Negative	<LOD
161	10/24/2023 13:48	CEILING	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT B9	Negative	<LOD
162	10/24/2023 13:48	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT B9	Negative	<LOD
163	10/24/2023 13:49	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B9	Negative	<LOD
164	10/24/2023 13:49	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT B9	Negative	<LOD
165	10/24/2023 13:49	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT B9	Negative	<LOD
166	10/24/2023 13:50	CEILING	DRYWALL		INTACT	TAN	WEST BEDROOM	UNIT B9	Negative	<LOD
167	10/24/2023 13:51	WALL	DRYWALL	A	INTACT	TAN	WEST BEDROOM	UNIT B9	Negative	<LOD
168	10/24/2023 13:51	WALL	DRYWALL	B	INTACT	TAN	WEST BEDROOM	UNIT B9	Negative	<LOD
169	10/24/2023 13:51	WALL	DRYWALL	C	INTACT	TAN	WEST BEDROOM	UNIT B9	Negative	<LOD
170	10/24/2023 13:52	WALL	DRYWALL	D	INTACT	TAN	WEST BEDROOM	UNIT B9	Negative	<LOD
171	10/24/2023 13:57	CEILING	DRYWALL		INTACT	TAN	EAST BEDROOM	UNIT B9	Negative	<LOD
172	10/24/2023 13:58	WALL	DRYWALL	A	INTACT	TAN	EAST BEDROOM	UNIT B9	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
173	10/24/2023 13:58	WALL	DRYWALL	B	INTACT	TAN	EAST BEDROOM	UNIT B9	Negative	<LOD
174	10/24/2023 13:58	WALL	DRYWALL	C	INTACT	TAN	EAST BEDROOM	UNIT B9	Negative	<LOD
175	10/24/2023 13:59	WALL	DRYWALL	D	INTACT	TAN	EAST BEDROOM	UNIT B9	Negative	<LOD
176	10/24/2023 14:07	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT A17	Negative	<LOD
177	10/24/2023 14:08	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT A17	Negative	<LOD
178	10/24/2023 14:08	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT A17	Negative	<LOD
179	10/24/2023 14:09	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A17	Negative	<LOD
180	10/24/2023 14:09	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A17	Negative	<LOD
181	10/24/2023 14:10	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT A17	Negative	<LOD
182	10/24/2023 14:10	DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A17	Negative	<LOD
183	10/24/2023 14:12	WAINSCOT	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A17	Negative	<LOD
184	10/24/2023 14:12	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A17	Negative	<LOD
185	10/24/2023 14:13	WAINSCOT	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A17	Negative	<LOD
186	10/24/2023 14:13	WAINSCOT	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A17	Negative	<LOD
187	10/24/2023 14:16	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A17	Negative	<LOD
188	10/24/2023 14:16	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A17	Negative	<LOD
189	10/24/2023 14:17	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A17	Negative	<LOD
190	10/24/2023 14:17	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A17	Negative	<LOD
191	10/24/2023 14:18	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A17	Negative	<LOD
192	10/24/2023 14:18	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A17	Negative	<LOD
193	10/24/2023 14:19	CABINETRY	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A17	Negative	<LOD
194	10/24/2023 14:20	CEILING	DRYWALL		INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
195	10/24/2023 14:21	WALL	DRYWALL	A	INTACT	TAN	BEDROOM	UNIT A17	Negative	<LOD
196	10/24/2023 14:21	WALL	DRYWALL	B	INTACT	TAN	BEDROOM	UNIT A17	Negative	<LOD
197	10/24/2023 14:21	WALL	DRYWALL	C	INTACT	TAN	BEDROOM	UNIT A17	Negative	<LOD
198	10/24/2023 14:22	WALL	DRYWALL	D	INTACT	TAN	BEDROOM	UNIT A17	Negative	<LOD
199	10/24/2023 14:22	WALL	DRYWALL	D	INTACT	TAN	BEDROOM	UNIT A17	Negative	<LOD
200	10/24/2023 14:23	DOOR	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
201	10/24/2023 14:23	DOOR FRAME	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
202	10/24/2023 14:23	WINDOW SILL	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
203	10/24/2023 14:24	ROLL DOOR	WOOD	D	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
204	10/24/2023 14:26	COVEBASE	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
205	10/24/2023 14:26	COVEBASE	WOOD	B	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
206	10/24/2023 14:27	COVEBASE	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
207	10/24/2023 14:27	COVEBASE	WOOD	D	INTACT	WHITE	BEDROOM	UNIT A17	Negative	<LOD
208	10/24/2023 14:30	CEILING	DRYWALL	DM	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
209	10/24/2023 14:30	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
210	10/24/2023 14:31	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
211	10/24/2023 14:31	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
212	10/24/2023 14:31	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
213	10/24/2023 14:32	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
214	10/24/2023 14:32	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A17	Negative	<LOD
215	10/24/2023 14:40	SHUTTER CAL								

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
216	10/24/2023 15:04	NIST	PAINT			RED		CALIBRATION	Positive	1.5
217	10/24/2023 15:05	NIST	PAINT			RED		CALIBRATION	Positive	1.2
218	10/24/2023 15:06	NIST	PAINT			RED		CALIBRATION	Duplicate	1
219	10/24/2023 15:07	NIST	PAINT			RED		CALIBRATION	Positive	1.1
220	10/24/2023 15:09	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
221	10/24/2023 15:10	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
222	10/24/2023 15:10	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
223	10/24/2023 15:10	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
224	10/24/2023 15:11	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
225	10/24/2023 15:11	DOOR	METAL	B	INTACT	YELLOW	LIVING ROOM	UNIT A12	Negative	<LOD
226	10/24/2023 15:12	DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
227	10/24/2023 15:13	WINDOW FRAME	WOOD	C	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
228	10/24/2023 15:13	WINDOW SILL	WOOD	C	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
229	10/24/2023 15:14	CLOSET DOOR	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
230	10/24/2023 15:14	CLOSET DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
231	10/24/2023 15:14	CLOSET DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A12	Negative	<LOD
232	10/24/2023 15:15	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
233	10/24/2023 15:16	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
234	10/24/2023 15:16	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
235	10/24/2023 15:17	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
236	10/24/2023 15:17	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
237	10/24/2023 15:17	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
238	10/24/2023 15:18	WINDOW SILL	WOOD	D	INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
239	10/24/2023 15:18	WINDOW FRAME	WOOD	D	INTACT	WHITE	KITCHEN	UNIT A12	Negative	<LOD
240	10/24/2023 15:19	CABINETY	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A12	Negative	<LOD
241	10/24/2023 15:25	CABINETY	WOOD	A	INTACT	BROWN	BATHROOM	UNIT A12	Negative	<LOD
242	10/24/2023 15:26	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
243	10/24/2023 15:27	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
244	10/24/2023 15:27	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
245	10/24/2023 15:27	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
246	10/24/2023 15:28	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
247	10/24/2023 15:29	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
248	10/24/2023 15:29	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A12	Negative	<LOD
249	10/24/2023 15:30	CEILING	DRYWALL		INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
250	10/24/2023 15:30	WALL	DRYWALL	A	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
251	10/24/2023 15:30	WALL	DRYWALL	B	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
252	10/24/2023 15:31	WALL	DRYWALL	C	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
253	10/24/2023 15:31	WALL	DRYWALL	D	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
254	10/24/2023 15:32	WINDOW SILL	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
255	10/24/2023 15:32	WINDOW SILL	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
256	10/24/2023 15:33	WINDOW FRAME	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
257	10/24/2023 15:33	DOOR	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
258	10/24/2023 15:34	DOOR FRAME	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
259	10/24/2023 15:34	CLOSET ROLL DOOR	WOOD	D	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
260	10/24/2023 15:35	CLOSET ROLL DOOR FRAM	WOOD	D	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
261	10/24/2023 15:35	CLOSET ROLL DOOR FRAM	WOOD	D	INTACT	WHITE	BEDROOM	UNIT A12	Negative	<LOD
262	10/24/2023 15:40	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
263	10/24/2023 15:40	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
264	10/24/2023 15:41	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
265	10/24/2023 15:41	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
266	10/24/2023 15:41	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
267	10/24/2023 15:42	WINDOW SILL	WOOD	C	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
268	10/24/2023 15:43	WINDOW FRAME	WOOD	C	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
269	10/24/2023 15:44	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT A5	Negative	<LOD
270	10/24/2023 15:44	DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
271	10/24/2023 15:45	CLOSET DOOR	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
272	10/24/2023 15:45	CLOSET DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A5	Negative	<LOD
273	10/24/2023 15:46	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A5	Negative	<LOD
274	10/24/2023 15:46	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A5	Negative	<LOD
275	10/24/2023 15:47	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A5	Negative	<LOD
276	10/24/2023 15:47	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A5	Negative	<LOD
277	10/24/2023 15:48	CABINET	WOOD	A	INTACT	TAN	KITCHEN	UNIT A5	Negative	<LOD
278	10/24/2023 15:49	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
279	10/24/2023 15:49	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
280	10/24/2023 15:49	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
281	10/24/2023 15:50	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
282	10/24/2023 15:50	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
283	10/24/2023 15:51	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
284	10/24/2023 15:51	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A5	Negative	<LOD
285	10/24/2023 15:52	CABINET	WOOD	A	INTACT	TAN	BATHROOM	UNIT A5	Negative	<LOD
286	10/24/2023 15:53	CEILING	DRYWALL		INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
287	10/24/2023 15:54	WALL	DRYWALL	A	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
288	10/24/2023 15:54	WALL	DRYWALL	B	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
289	10/24/2023 15:54	WALL	DRYWALL	C	INTACT	WHITE	NORTH BEDROOM	UNIT A17	Negative	<LOD
290	10/24/2023 15:55	WALL	DRYWALL	D	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
291	10/24/2023 15:55	WALL	DRYWALL	D	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
292	10/24/2023 15:55	DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
293	10/24/2023 15:56	DOOR FRAME	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
294	10/24/2023 15:56	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
295	10/24/2023 15:57	WINDOW SILL	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT A5	Negative	<LOD
296	10/24/2023 15:58	CEILING	DRYWALL		INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
297	10/24/2023 15:58	WALL	DRYWALL	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
298	10/24/2023 15:59	WALL	DRYWALL	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
299	10/24/2023 15:59	WALL	DRYWALL	C	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
300	10/24/2023 15:59	WALL	DRYWALL	D	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
301	10/24/2023 16:00	DOOR	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
302	10/24/2023 16:01	DOOR FRAME	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
303	10/24/2023 16:01	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
304	10/24/2023 16:02	CLOSET ROLL DOOR FRAM	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A5	Negative	<LOD
305	10/24/2023 16:14	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A3	Negative	<LOD
306	10/24/2023 16:15	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A3	Negative	<LOD
307	10/24/2023 16:15	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A3	Negative	<LOD
308	10/24/2023 16:16	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A3	Negative	<LOD
309	10/24/2023 16:16	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A3	Negative	<LOD
310	10/24/2023 16:17	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT A3	Negative	<LOD
311	10/24/2023 16:18	DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A3	Negative	<LOD
312	10/24/2023 16:19	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A3	Negative	<LOD
313	10/24/2023 16:20	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A3	Negative	<LOD
314	10/24/2023 16:20	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A3	Negative	<LOD
315	10/24/2023 16:21	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A3	Negative	<LOD
316	10/24/2023 16:21	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A3	Negative	<LOD
317	10/24/2023 16:22	CABINTRY	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A3	Negative	<LOD
318	10/24/2023 16:23	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
319	10/24/2023 16:24	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
320	10/24/2023 16:24	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
321	10/24/2023 16:25	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
322	10/24/2023 16:25	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
323	10/24/2023 16:25	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
324	10/24/2023 16:26	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
325	10/24/2023 16:26	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A3	Negative	<LOD
326	10/24/2023 16:27	CEILING	DRYWALL		INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
327	10/24/2023 16:28	WALL	DRYWALL	A	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
328	10/24/2023 16:28	WALL	DRYWALL	B	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
329	10/24/2023 16:28	WALL	DRYWALL	C	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
330	10/24/2023 16:29	WALL	DRYWALL	D	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
331	10/24/2023 16:29	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
332	10/24/2023 16:30	CLOSET ROLL DOOR FRAM	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
333	10/24/2023 16:30	DOOR	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
334	10/24/2023 16:31	DOOR FRAME	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
335	10/24/2023 16:31	COVEBASE	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
336	10/24/2023 16:31	COVEBASE	WOOD	B	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
337	10/24/2023 16:32	COVEBASE	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
338	10/24/2023 16:32	COVEBASE	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT A3	Negative	<LOD
339	10/24/2023 16:33	CEILING	DRYWALL		INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
340	10/24/2023 16:34	WALL	DRYWALL	A	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
341	10/24/2023 16:34	WALL	DRYWALL	B	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
342	10/24/2023 16:34	WALL	DRYWALL	C	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
343	10/24/2023 16:35	WALL	DRYWALL	D	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
344	10/24/2023 16:35	CLOSET ROLL DOOR	DRYWALL	D	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
345	10/24/2023 16:36	CLOSET ROLL DOOR FRAM	DRYWALL	D	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
346	10/24/2023 16:36	DOOR	DRYWALL	B	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
347	10/24/2023 16:36	DOOR FRAME	DRYWALL	B	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
348	10/24/2023 16:37	WINDOW SILL	DRYWALL	C	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
349	10/24/2023 16:37	WINDOW FRAME	DRYWALL	C	INTACT	WHITE	SOUTH ROOM	UNIT A3	Negative	<LOD
350	10/24/2023 16:40	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A1	Negative	<LOD
351	10/24/2023 16:40	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT A1	Negative	<LOD
352	10/24/2023 16:41	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT A1	Negative	<LOD
353	10/24/2023 16:41	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A1	Negative	<LOD
354	10/24/2023 16:41	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A1	Negative	<LOD
355	10/24/2023 16:42	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT A1	Negative	<LOD
356	10/24/2023 16:46	SHUTTER CAL								5.22
357	10/24/2023 17:12	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT A1	Negative	<LOD
358	10/24/2023 17:13	DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A1	Negative	0.7
359	10/24/2023 17:14	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A1	Negative	0.6
360	10/24/2023 17:15	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A1	Negative	<LOD
361	10/24/2023 17:15	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A1	Negative	<LOD
362	10/24/2023 17:15	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A1	Negative	<LOD
363	10/24/2023 17:16	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A1	Negative	<LOD
364	10/24/2023 17:16	CABINET	WOOD	A	INTACT	TAN	KITCHEN	UNIT A1	Negative	<LOD
365	10/24/2023 17:17	CABINET	WOOD	A	INTACT	TAN	BATHROOM	UNIT A1	Negative	<LOD
366	10/24/2023 17:17	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A1	Negative	0.6
367	10/24/2023 17:18	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A1	Negative	<LOD
368	10/24/2023 17:18	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A1	Negative	<LOD
369	10/24/2023 17:18	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A1	Negative	<LOD
370	10/24/2023 17:18	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A1	Negative	<LOD
371	10/24/2023 17:19	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A1	Duplicate	<LOD
372	10/24/2023 17:19	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A1	Negative	<LOD
373	10/24/2023 17:20	DOOR FRAME	WOOD	B	INTACT	WHITE	BEDROOM	UNIT A1	Negative	<LOD
374	10/24/2023 17:20	DOOR	WOOD	B	INTACT	WHITE	BEDROOM	UNIT A1	Negative	<LOD
375	10/24/2023 17:21	WINDOW FRAME	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A1	Negative	<LOD
376	10/24/2023 17:21	WALL	DRYWALL	A	INTACT	WHITE	BEDROOM	UNIT A1	Duplicate	<LOD
377	10/24/2023 17:22	WALL	DRYWALL	B	INTACT	WHITE	BEDROOM	UNIT A1	Negative	<LOD
378	10/24/2023 17:22	NIST	PAINT			RED		CAL CHECK	Positive	3.6
379	10/24/2023 17:23	WALL	DRYWALL	C	INTACT	WHITE	BEDROOM	UNIT A1	Negative	<LOD
380	10/24/2023 17:23	WALL	DRYWALL	D	INTACT	WHITE	BEDROOM	UNIT A1	Negative	<LOD
381	10/25/2023 10:06	Shutter Cal								
382	10/25/2023 10:10	NIST	PAINT			RED		CALIBRATION	Positive	1.1
383	10/25/2023 10:10	NIST	PAINT			RED		CALIBRATION	Positive	1.2
384	10/25/2023 10:11	NIST	PAINT			RED		CALIBRATION	Positive	1.2
385	10/25/2023 11:49	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
386	10/25/2023 11:50	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
387	10/25/2023 11:51	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT A2	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
388	10/25/2023 11:51	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A2	Negative	<LOD
389	10/25/2023 11:51	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A2	Negative	<LOD
390	10/25/2023 11:53	WAINSCOT	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
391	10/25/2023 11:53	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
392	10/25/2023 11:54	WAINSCOT	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
393	10/25/2023 11:54	WAINSCOT	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
394	10/25/2023 11:55	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A2	Negative	<LOD
395	10/25/2023 11:57	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A2	Negative	<LOD
396	10/25/2023 11:57	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A2	Negative	<LOD
397	10/25/2023 11:58	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A2	Negative	<LOD
398	10/25/2023 11:58	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A2	Negative	<LOD
399	10/25/2023 11:59	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A2	Negative	<LOD
400	10/25/2023 11:59	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A2	Negative	<LOD
401	10/25/2023 12:00	CABINETRY	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A2	Negative	<LOD
402	10/25/2023 12:00	CABINETRY	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A2	Negative	<LOD
403	10/25/2023 12:02	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A2	Negative	<LOD
404	10/25/2023 12:03	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT A2	Negative	<LOD
405	10/25/2023 12:03	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT A2	Negative	<LOD
406	10/25/2023 12:04	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT A2	Negative	<LOD
407	10/25/2023 12:04	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT A2	Negative	<LOD
408	10/25/2023 12:05	CABINET	WOOD	A	INTACT	BROWN	BATHROOM	UNIT A2	Negative	<LOD
409	10/25/2023 12:05	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A2	Negative	<LOD
410	10/25/2023 12:06	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A2	Negative	<LOD
411	10/25/2023 12:08	ELECTRICAL PANEL	METAL	B	INTACT	TAN	LIVING ROOM	UNIT A2	Negative	<LOD
412	10/25/2023 12:10	CEILING	DRYWALL		INTACT	TAN	EAST BEDROOM	UNIT A2	Negative	<LOD
413	10/25/2023 12:11	WALL	DRYWALL	A	INTACT	TAN	EAST BEDROOM	UNIT A2	Negative	<LOD
414	10/25/2023 12:11	WALL	DRYWALL	B	INTACT	TAN	EAST BEDROOM	UNIT A2	Negative	<LOD
415	10/25/2023 12:12	WALL	DRYWALL	C	INTACT	TAN	EAST BEDROOM	UNIT A2	Negative	<LOD
416	10/25/2023 12:12	WALL	DRYWALL	D	INTACT	TAN	EAST BEDROOM	UNIT A2	Negative	<LOD
417	10/25/2023 12:13	CLOSET ROLL DOOR	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
418	10/25/2023 12:14	WINDOW SILL	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
419	10/25/2023 12:14	WINDOW FRAME	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
420	10/25/2023 12:15	DOOR	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
421	10/25/2023 12:15	DOOR FRAME	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
422	10/25/2023 12:16	COVEBASE	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
423	10/25/2023 12:17	COVEBASE	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
424	10/25/2023 12:17	COVEBASE	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
425	10/25/2023 12:18	COVEBASE	WOOD	D	INTACT	WHITE	EAST BEDROOM	UNIT A2	Negative	<LOD
426	10/25/2023 12:19	CEILING	DRYWALL		INTACT	TAN	SOUTH BEDROOM	UNIT A2	Negative	<LOD
427	10/25/2023 12:20	WALL	DRYWALL	A	INTACT	TAN	SOUTH BEDROOM	UNIT A2	Negative	<LOD
428	10/25/2023 12:20	WALL	DRYWALL	B	INTACT	TAN	SOUTH BEDROOM	UNIT A2	Negative	<LOD
429	10/25/2023 12:21	WALL	DRYWALL	C	INTACT	TAN	SOUTH BEDROOM	UNIT A2	Negative	<LOD
430	10/25/2023 12:21	WALL	DRYWALL	D	INTACT	TAN	SOUTH BEDROOM	UNIT A2	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
431	10/25/2023 12:22	COVEBASE	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
432	10/25/2023 12:23	COVEBASE	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
433	10/25/2023 12:23	COVEBASE	WOOD	C	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
434	10/25/2023 12:25	WINDOW SILL	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
435	10/25/2023 12:25	WINDOW FRAME	WOOD	C	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
436	10/25/2023 12:26	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
437	10/25/2023 12:27	CLOSET DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
438	10/25/2023 12:28	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
439	10/25/2023 12:28	DOOR	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
440	10/25/2023 12:28	DOOR FRAME	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A2	Negative	<LOD
441	10/25/2023 12:32	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT A14	Negative	<LOD
442	10/25/2023 12:33	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT A14	Negative	<LOD
443	10/25/2023 12:33	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT A14	Negative	<LOD
444	10/25/2023 12:34	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A14	Negative	<LOD
445	10/25/2023 12:34	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A14	Negative	<LOD
446	10/25/2023 12:35	WAINSCOT	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
447	10/25/2023 12:35	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
448	10/25/2023 12:36	WAINSCOT	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
449	10/25/2023 12:36	WAINSCOT	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
450	10/25/2023 12:37	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
451	10/25/2023 12:38	CLOSET DOOR	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
452	10/25/2023 12:39	CLOSET DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
453	10/25/2023 12:40	FRONT DOOR	WOOD	B	INTACT	YELLOW	LIVING ROOM	UNIT A14	Negative	<LOD
454	10/25/2023 12:40	FRONT DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT A14	Negative	<LOD
455	10/25/2023 12:41	CEILING	DRYWALL		INTACT	TAN	KITCHEN	UNIT A14	Negative	<LOD
456	10/25/2023 12:42	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT A14	Negative	<LOD
457	10/25/2023 12:42	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT A14	Negative	<LOD
458	10/25/2023 12:42	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT A14	Negative	<LOD
459	10/25/2023 12:43	WALL	DRYWALL	D	INTACT	TAN	KITCHEN	UNIT A14	Negative	<LOD
460	10/25/2023 12:43	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A14	Negative	<LOD
461	10/25/2023 12:45	CEILING	DRYWALL		INTACT	TAN	BATHROOM	UNIT A14	Negative	<LOD
462	10/25/2023 12:45	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT A14	Negative	<LOD
463	10/25/2023 12:46	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT A14	Negative	<LOD
464	10/25/2023 12:46	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT A14	Negative	<LOD
465	10/25/2023 12:47	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT A14	Negative	<LOD
466	10/25/2023 12:47	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A14	Negative	<LOD
467	10/25/2023 12:48	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT A14	Negative	<LOD
468	10/25/2023 12:48	CABINET	WOOD	A	INTACT	BROWN	BATHROOM	UNIT A14	Negative	<LOD
469	10/25/2023 12:49	CEILING	DRYWALL		INTACT	TAN	NORTH BEDROOM	UNIT A14	Negative	<LOD
470	10/25/2023 12:50	WALL	DRYWALL	A	INTACT	TAN	NORTH BEDROOM	UNIT A14	Negative	<LOD
471	10/25/2023 12:51	WALL	DRYWALL	B	INTACT	TAN	NORTH BEDROOM	UNIT A14	Negative	<LOD
472	10/25/2023 12:51	WALL	DRYWALL	C	INTACT	TAN	NORTH BEDROOM	UNIT A14	Negative	<LOD
473	10/25/2023 12:51	WALL	DRYWALL	D	INTACT	TAN	NORTH BEDROOM	UNIT A14	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
474	10/25/2023 12:52	CLOSET DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
475	10/25/2023 12:53	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
476	10/25/2023 12:54	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
477	10/25/2023 12:55	WINDOW SILL	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
478	10/25/2023 12:55	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
479	10/25/2023 12:56	COVEBASE	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
480	10/25/2023 12:57	DOOR	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
481	10/25/2023 12:57	DOOR FRAME	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
482	10/25/2023 12:58	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
483	10/25/2023 12:58	CLOSET DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
484	10/25/2023 12:59	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT A14	Negative	<LOD
485	10/25/2023 13:01	CEILING	DRYWALL		INTACT	WHITE	SOUTH BEADROOM	UNIT A14	Negative	<LOD
486	10/25/2023 13:02	WALL	DRYWALL	A	INTACT	GRAY	SOUTH BEADROOM	UNIT A14	Negative	<LOD
487	10/25/2023 13:03	WALL	DRYWALL	B	INTACT	GRAY	SOUTH BEADROOM	UNIT A14	Negative	<LOD
488	10/25/2023 13:03	WALL	DRYWALL	C	INTACT	GRAY	SOUTH BEADROOM	UNIT A14	Negative	<LOD
489	10/25/2023 13:04	WALL	DRYWALL	D	INTACT	GRAY	SOUTH BEADROOM	UNIT A14	Negative	<LOD
490	10/25/2023 13:04	DOOR	WOOD	A	INTACT	WHITE	SOUTH BEADROOM	UNIT A14	Negative	<LOD
491	10/25/2023 13:05	DOOR FRAME	WOOD	A	INTACT	WHITE	SOUTH BEADROOM	UNIT A14	Negative	<LOD
492	10/25/2023 13:06	WINDOW SILL	WOOD	C	INTACT	WHITE	SOUTH BEADROOM	UNIT A14	Negative	<LOD
493	10/25/2023 13:06	WINDOW FRAME	WOOD	C	INTACT	WHITE	SOUTH BEADROOM	UNIT A14	Negative	<LOD
494	10/25/2023 13:07	CLOSET ROLL DOOR	WOOD	C	INTACT	WHITE	SOUTH BEADROOM	UNIT A14	Negative	<LOD
495	10/25/2023 13:08	ELECTRICAL PANEL	METAL	D	INTACT	TAN	LIVING ROOM	UNIT A14	Negative	<LOD
496	10/25/2023 13:10	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
497	10/25/2023 13:10	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
498	10/25/2023 13:11	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
499	10/25/2023 13:11	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
500	10/25/2023 13:11	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
501	10/25/2023 13:12	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
502	10/25/2023 13:13	WINDOW SILL	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
503	10/25/2023 13:13	DOOR	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
504	10/25/2023 13:13	DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
505	10/25/2023 13:14	DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
506	10/25/2023 13:14	ENTRY DOOR	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
507	10/25/2023 13:15	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
508	10/25/2023 13:16	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
509	10/25/2023 13:16	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
510	10/25/2023 13:16	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
511	10/25/2023 13:17	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
512	10/25/2023 13:17	CABINET	WOOD	A	INTACT	TAN	KITCHEN	UNIT A15	Negative	<LOD
513	10/25/2023 13:18	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD
514	10/25/2023 13:19	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD
515	10/25/2023 13:20	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD
516	10/25/2023 13:20	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
517	10/25/2023 13:20	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD
518	10/25/2023 13:21	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD
519	10/25/2023 13:21	DOOR JAM	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A15	Negative	<LOD
520	10/25/2023 13:22	CABINET	WOOD	A	INTACT	TAN	BATHROOM	UNIT A15	Negative	<LOD
521	10/25/2023 13:23	CEILING	DRYWALL		INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
522	10/25/2023 13:23	WALL	DRYWALL	A	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
523	10/25/2023 13:23	WALL	DRYWALL	B	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
524	10/25/2023 13:23	WALL	DRYWALL	C	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
525	10/25/2023 13:24	WALL	DRYWALL	D	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
526	10/25/2023 13:24	WINDOW FRAME	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
527	10/25/2023 13:25	WINDOW SILL	WOOD	C	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
528	10/25/2023 13:25	DOOR	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
529	10/25/2023 13:26	DOOR FRAME	WOOD	A	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
530	10/25/2023 13:27	CLOSET ROLL DOOR	WOOD	B	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
531	10/25/2023 13:27	CLOSET ROLL DOOR FRAME	WOOD	B	INTACT	WHITE	BEDROOM	UNIT A15	Negative	<LOD
532	10/25/2023 13:28	CLOSET ROLL DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
533	10/25/2023 13:28	CLOSET ROLL DOOR	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
534	10/25/2023 13:38	SHUTTER CAL								4.79
535	10/25/2023 13:41	NIST	PAINT			RED		CALIBRATION	Positive	1.1
536	10/25/2023 13:42	NIST	PAINT			RED		CALIBRATION	Positive	1.2
537	10/25/2023 13:42	NIST	PAINT			RED		CALIBRATION	Positive	1.1
538	10/25/2023 13:56	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
539	10/25/2023 13:56	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
540	10/25/2023 13:56	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
541	10/25/2023 13:57	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
542	10/25/2023 13:57	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
543	10/25/2023 13:58	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
544	10/25/2023 13:58	ENTRY DOOR	WOOD	A	INTACT	YELLOW	LIVING ROOM	UNIT A6	Negative	<LOD
545	10/25/2023 13:59	ENTRY DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
546	10/25/2023 14:00	CLOSET DOOR	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
547	10/25/2023 14:00	CLOSET DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT A6	Negative	<LOD
548	10/25/2023 14:00	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A6	Negative	<LOD
549	10/25/2023 14:01	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT A6	Negative	<LOD
550	10/25/2023 14:01	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT A6	Negative	<LOD
551	10/25/2023 14:01	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT A6	Negative	<LOD
552	10/25/2023 14:02	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT A6	Negative	<LOD
553	10/25/2023 14:02	CABINET	DRYWALL	A	INTACT	BROWN	KITCHEN	UNIT A6	Negative	<LOD
554	10/25/2023 14:03	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD
555	10/25/2023 14:04	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD
556	10/25/2023 14:04	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD
557	10/25/2023 14:04	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD
558	10/25/2023 14:04	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD
559	10/25/2023 14:05	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
560	10/25/2023 14:05	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A6	Negative	<LOD
561	10/25/2023 14:06	CABINET	WOOD	A	INTACT	BROWN	BATHROOM	UNIT A6	Negative	<LOD
562	10/25/2023 14:07	CEILING	DRYWALL		INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
563	10/25/2023 14:07	WALL	DRYWALL	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
564	10/25/2023 14:08	WALL	DRYWALL	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
565	10/25/2023 14:08	WALL	DRYWALL	C	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
566	10/25/2023 14:08	WALL	DRYWALL	D	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
567	10/25/2023 14:09	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
568	10/25/2023 14:09	CLOSET DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
569	10/25/2023 14:10	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
570	10/25/2023 14:10	DOOR FRAME	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
571	10/25/2023 14:10	DOOR	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
572	10/25/2023 14:11	WINDOW SILL	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
573	10/25/2023 14:11	WINDOW FRAME	WOOD	C	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
574	10/25/2023 14:12	COVEBASE	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
575	10/25/2023 14:13	COVEBASE	WOOD	B	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
576	10/25/2023 14:13	COVEBASE	WOOD	C	INTACT	WHITE	SOUTH BEDROOM	UNIT A6	Negative	<LOD
577	10/25/2023 14:14	CEILING	DRYWALL		INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
578	10/25/2023 14:15	WALL	DRYWALL	A	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
579	10/25/2023 14:15	WALL	DRYWALL	B	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
580	10/25/2023 14:15	WALL	DRYWALL	C	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
581	10/25/2023 14:16	WALL	DRYWALL	D	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
582	10/25/2023 14:16	COVEBASE	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
583	10/25/2023 14:17	COVEBASE	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
584	10/25/2023 14:17	COVEBASE	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
585	10/25/2023 14:17	COVEBASE	WOOD	D	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
586	10/25/2023 14:18	WINDOW SILL	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
587	10/25/2023 14:18	WINDOW FRAME	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
588	10/25/2023 14:19	DOOR	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
589	10/25/2023 14:19	DOOR FRAME	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
590	10/25/2023 14:20	CLOSET ROLL DOOR	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A6	Negative	<LOD
591	10/25/2023 14:28	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
592	10/25/2023 14:29	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
593	10/25/2023 14:29	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
594	10/25/2023 14:29	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
595	10/25/2023 14:30	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
596	10/25/2023 14:31	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
597	10/25/2023 14:32	ENTRY DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT B5	Negative	<LOD
598	10/25/2023 14:33	CLOSET DOOR	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
599	10/25/2023 14:33	CLOSET DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT B5	Negative	<LOD
600	10/25/2023 14:34	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT B5	Negative	<LOD
601	10/25/2023 14:34	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT B5	Negative	<LOD
602	10/25/2023 14:35	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT B5	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
603	10/25/2023 14:35	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT B5	Negative	<LOD
604	10/25/2023 14:35	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT B5	Negative	<LOD
605	10/25/2023 14:36	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT B5	Negative	<LOD
606	10/25/2023 14:37	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT B5	Negative	<LOD
607	10/25/2023 14:38	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT B5	Negative	<LOD
608	10/25/2023 14:38	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B5	Negative	<LOD
609	10/25/2023 14:39	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT B5	Negative	<LOD
610	10/25/2023 14:39	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT B5	Negative	<LOD
611	10/25/2023 14:39	CABINET	WOOD	A	INTACT	BROWN	BATHROOM	UNIT B5	Negative	<LOD
612	10/25/2023 14:40	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B5	Negative	<LOD
613	10/25/2023 14:40	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B5	Negative	<LOD
614	10/25/2023 14:42	CEILING	DRYWALL		INTACT	TAN	NORTH BEDROOM	UNIT B5	Negative	<LOD
615	10/25/2023 14:42	WALL	DRYWALL	A	INTACT	TAN	NORTH BEDROOM	UNIT B5	Negative	<LOD
616	10/25/2023 14:42	WALL	DRYWALL	B	INTACT	TAN	NORTH BEDROOM	UNIT B5	Negative	<LOD
617	10/25/2023 14:43	WALL	DRYWALL	C	INTACT	TAN	NORTH BEDROOM	UNIT B5	Negative	<LOD
618	10/25/2023 14:43	WALL	DRYWALL	D	INTACT	TAN	NORTH BEDROOM	UNIT B5	Negative	<LOD
619	10/25/2023 14:43	COVEBASE	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
620	10/25/2023 14:44	COVEBASE	WOOD	B	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
621	10/25/2023 14:44	COVEBASE	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
622	10/25/2023 14:44	COVEBASE	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
623	10/25/2023 14:45	WINDOW SILL	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
624	10/25/2023 14:45	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
625	10/25/2023 14:46	DOOR FRAME	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
626	10/25/2023 14:47	CLOSET ROLL DOOR	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT B5	Negative	<LOD
627	10/25/2023 14:49	CEILING	DRYWALL		INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
628	10/25/2023 14:50	WALL	DRYWALL	A	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
629	10/25/2023 14:50	WALL	DRYWALL	B	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
630	10/25/2023 14:50	WALL	DRYWALL	C	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
631	10/25/2023 14:51	WALL	DRYWALL	D	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
632	10/25/2023 14:51	COVEBASE	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
633	10/25/2023 14:52	COVEBASE	WOOD	B	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
634	10/25/2023 14:52	COVEBASE	WOOD	C	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
635	10/25/2023 14:52	COVEBASE	WOOD	D	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
636	10/25/2023 14:53	WINDOW SILL	WOOD	C	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
637	10/25/2023 14:54	WINDOW FRAME	WOOD	C	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
638	10/25/2023 14:54	DOOR	WOOD	D	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
639	10/25/2023 14:55	DOOR FRAME	WOOD	D	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
640	10/25/2023 14:55	CLOSET DOOR	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
641	10/25/2023 14:56	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
642	10/25/2023 14:56	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B5	Negative	<LOD
643	10/25/2023 14:58	CEILING	DRYWALL		INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
644	10/25/2023 14:59	WALL	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
645	10/25/2023 14:59	WALL	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
646	10/25/2023 15:00	WALL	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
647	10/25/2023 15:00	WALL	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
648	10/25/2023 15:01	WINDOW FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
649	10/25/2023 15:02	ENTRY DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT B4	Negative	<LOD
650	10/25/2023 15:02	ENTRY DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
651	10/25/2023 15:03	CLOSET DOOR	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
652	10/25/2023 15:03	CLOSET DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
653	10/25/2023 15:04	CEILING	DRYWALL		INTACT	TAN	KITCHEN	UNIT B4	Negative	<LOD
654	10/25/2023 15:04	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT B4	Negative	<LOD
655	10/25/2023 15:05	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT B4	Negative	<LOD
656	10/25/2023 15:05	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT B4	Negative	<LOD
657	10/25/2023 15:05	WALL	DRYWALL	D	INTACT	TAN	KITCHEN	UNIT B4	Negative	<LOD
658	10/25/2023 15:06	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT B4	Negative	<LOD
659	10/25/2023 15:07	CEILING	DRYWALL		INTACT	TAN	BATHROOM	UNIT B4	Negative	<LOD
660	10/25/2023 15:07	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT B4	Negative	<LOD
661	10/25/2023 15:08	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B4	Negative	<LOD
662	10/25/2023 15:08	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT B4	Negative	<LOD
663	10/25/2023 15:09	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT B4	Negative	<LOD
664	10/25/2023 15:09	CABINET	WOOD	A	INTACT	BROWN	BATHROOM	UNIT B4	Negative	<LOD
665	10/25/2023 15:10	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT B4	Negative	<LOD
666	10/25/2023 15:10	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT B4	Negative	<LOD
667	10/25/2023 15:12	CEILING	DRYWALL		INTACT	TAN	EAST BEDROOM	UNIT B4	Negative	<LOD
668	10/25/2023 15:13	WALL	DRYWALL	A	INTACT	TAN	EAST BEDROOM	UNIT B4	Negative	<LOD
669	10/25/2023 15:13	WALL	DRYWALL	B	INTACT	TAN	EAST BEDROOM	UNIT B4	Negative	<LOD
670	10/25/2023 15:13	WALL	DRYWALL	C	INTACT	TAN	EAST BEDROOM	UNIT B4	Negative	<LOD
671	10/25/2023 15:13	WALL	DRYWALL	D	INTACT	TAN	EAST BEDROOM	UNIT B4	Negative	<LOD
672	10/25/2023 15:14	COVEBASE	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
673	10/25/2023 15:14	COVEBASE	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
674	10/25/2023 15:15	COVEBASE	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
675	10/25/2023 15:15	COVEBASE	WOOD	D	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
676	10/25/2023 15:16	WINDOW SILL	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
677	10/25/2023 15:16	WINDOW FRAME	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
678	10/25/2023 15:17	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
679	10/25/2023 15:18	CLOSET DOOR	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
680	10/25/2023 15:19	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
681	10/25/2023 15:19	DOOR	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
682	10/25/2023 15:19	DOOR FRAME	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT B4	Negative	<LOD
683	10/25/2023 15:20	CEILING	DRYWALL		INTACT	TAN	NORTH BEDROOM	UNIT B4	Negative	<LOD
684	10/25/2023 15:21	WALL	DRYWALL	A	INTACT	TAN	NORTH BEDROOM	UNIT B4	Negative	<LOD
685	10/25/2023 15:21	WALL	DRYWALL	B	INTACT	TAN	NORTH BEDROOM	UNIT B4	Negative	<LOD
686	10/25/2023 15:21	WALL	DRYWALL	C	INTACT	TAN	NORTH BEDROOM	UNIT B4	Negative	<LOD
687	10/25/2023 15:22	WALL	DRYWALL	D	INTACT	TAN	NORTH BEDROOM	UNIT B4	Negative	<LOD
688	10/25/2023 15:22	COVEBASE	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
689	10/25/2023 15:23	COVEBASE	WOOD	B	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
690	10/25/2023 15:23	COVEBASE	WOOD	B	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
691	10/25/2023 15:23	COVEBASE	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
692	10/25/2023 15:24	WINDOW SILL	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
693	10/25/2023 15:24	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
694	10/25/2023 15:26	DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
695	10/25/2023 15:26	DOOR FRAME	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
696	10/25/2023 15:27	CLOSET ROLL DOOR	WOOD	B	INTACT	WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
697	10/25/2023 15:29	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
698	10/25/2023 15:29	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
699	10/25/2023 15:30	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
700	10/25/2023 15:30	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
701	10/25/2023 15:30	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
702	10/25/2023 15:31	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
703	10/25/2023 15:31	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT B8	Negative	<LOD
704	10/25/2023 15:32	WAINSCOT	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
705	10/25/2023 15:32	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
706	10/25/2023 15:32	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
707	10/25/2023 15:33	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
708	10/25/2023 15:33	WAINSCOT	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
709	10/25/2023 15:34	WAINSCOT	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
710	10/25/2023 15:35	DOOR	METAL	B	INTACT	YELLOW	LIVING ROOM	UNIT B8	Negative	<LOD
711	10/25/2023 15:35	DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
712	10/25/2023 15:36	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT B8	Negative	<LOD
713	10/25/2023 15:37	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT B8	Negative	<LOD
714	10/25/2023 15:37	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT B8	Negative	<LOD
715	10/25/2023 15:38	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT B8	Negative	<LOD
716	10/25/2023 15:38	WALL	DRYWALL	D	INTACT	TAN	KITCHEN	UNIT B8	Negative	<LOD
717	10/25/2023 15:39	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT B8	Negative	<LOD
718	10/25/2023 15:40	CABINET	WOOD	A	INTACT	BROWN	BATHROOM	UNIT B8	Negative	<LOD
719	10/25/2023 15:41	CEILING	DRYWALL		INTACT	TAN	BATHROOM	UNIT B8	Negative	<LOD
720	10/25/2023 15:42	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT B8	Negative	<LOD
721	10/25/2023 15:42	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B8	Negative	<LOD
722	10/25/2023 15:42	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B8	Negative	<LOD
723	10/25/2023 15:43	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT B8	Negative	<LOD
724	10/25/2023 15:43	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT B8	Negative	<LOD
725	10/25/2023 15:44	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B8	Negative	<LOD
726	10/25/2023 15:44	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B8	Negative	<LOD
727	10/25/2023 15:45	CEILING	DRYWALL		INTACT	WHITE	BEDROOM	UNIT B8	Negative	<LOD
728	10/25/2023 15:46	WALL	DRYWALL	A	INTACT	TAN	BEDROOM	UNIT B8	Negative	<LOD
729	10/25/2023 15:47	WALL	DRYWALL	B	INTACT	TAN	BEDROOM	UNIT B8	Negative	<LOD
730	10/25/2023 15:47	WALL	DRYWALL	C	INTACT	TAN	BEDROOM	UNIT B8	Negative	<LOD
731	10/25/2023 15:47	WALL	DRYWALL	D	INTACT	TAN	BEDROOM	UNIT B8	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
732	10/25/2023 15:48	CLOSET ROLL DOOR	WOOD	D	INTACT	WHITE	BEDROOM	UNIT B8	Negative	<LOD
733	10/25/2023 15:48	DOOR	WOOD	A	INTACT	WHITE	BEDROOM	UNIT B8	Negative	<LOD
734	10/25/2023 15:49	DOOR FRAME	WOOD	A	INTACT	WHITE	BEDROOM	UNIT B8	Negative	<LOD
735	10/25/2023 15:50	WINDOW SILL	WOOD	C	INTACT	WHITE	BEDROOM	UNIT B8	Negative	<LOD
736	10/25/2023 15:51	CLOSET ROLL DOOR	WOOD	C	INTACT	WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
737	10/25/2023 15:54	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
738	10/25/2023 15:54	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
739	10/25/2023 15:54	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
740	10/25/2023 15:55	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
741	10/25/2023 15:55	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
742	10/25/2023 15:56	WAINSCOT	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
743	10/25/2023 15:57	WAINSCOT	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
744	10/25/2023 15:57	WAINSCOT	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT B1	Negative	<LOD
745	10/25/2023 15:58	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT B1	Negative	<LOD
746	10/25/2023 15:58	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT B1	Negative	<LOD
747	10/25/2023 15:59	DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT B1	Negative	<LOD
748	10/25/2023 15:59	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT B1	Negative	<LOD
749	10/25/2023 16:00	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT B1	Negative	<LOD
750	10/25/2023 16:00	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT B1	Negative	<LOD
751	10/25/2023 16:01	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT B1	Negative	<LOD
752	10/25/2023 16:01	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT B1	Negative	<LOD
753	10/25/2023 16:02	WALL	DRYWALL	D	INTACT	TAN	KITCHEN	UNIT B1	Negative	<LOD
754	10/25/2023 16:02	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT B1	Negative	<LOD
755	10/25/2023 16:02	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT B1	Negative	<LOD
756	10/25/2023 16:03	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT B1	Negative	<LOD
757	10/25/2023 16:04	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT B1	Negative	<LOD
758	10/25/2023 16:05	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B1	Negative	<LOD
759	10/25/2023 16:05	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT B1	Negative	<LOD
760	10/25/2023 16:06	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B1	Negative	<LOD
761	10/25/2023 16:07	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B1	Negative	<LOD
762	10/25/2023 16:09	CEILING	DRYWALL		INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
763	10/25/2023 16:10	CEILING	DRYWALL		INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
764	10/25/2023 16:11	WALL	DRYWALL	A	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
765	10/25/2023 16:12	WALL	DRYWALL	B	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
766	10/25/2023 16:12	WALL	DRYWALL	C	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
767	10/25/2023 16:12	WALL	DRYWALL	D	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
768	10/25/2023 16:13	DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
769	10/25/2023 16:14	DOOR FRAME	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
770	10/25/2023 16:15	CLOSET ROLL DOOR	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
771	10/25/2023 16:16	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
772	10/25/2023 16:17	WINDOW SILL	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
773	10/25/2023 16:18	COVEBASE	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
774	10/25/2023 16:18	COVEBASE	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
775	10/25/2023 16:18	COVEBASE	WOOD	B	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
776	10/25/2023 16:19	COVEBASE	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
777	10/25/2023 16:20	COVEBASE	WOOD	D	INTACT	WHITE	NORTH BEDROOM	UNIT B1	Negative	<LOD
778	10/25/2023 16:21	CEILING	DRYWALL		INTACT	TAN	WEST BEDROOM	UNIT B1	Negative	<LOD
779	10/25/2023 16:21	WALL	DRYWALL	A	INTACT	TAN	WEST BEDROOM	UNIT B1	Negative	<LOD
780	10/25/2023 16:22	WALL	DRYWALL	B	INTACT	TAN	WEST BEDROOM	UNIT B1	Negative	<LOD
781	10/25/2023 16:22	WALL	DRYWALL	C	INTACT	TAN	WEST BEDROOM	UNIT B1	Negative	<LOD
782	10/25/2023 16:22	WALL	DRYWALL	D	INTACT	TAN	WEST BEDROOM	UNIT B1	Negative	<LOD
783	10/25/2023 16:23	COVEBASE	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
784	10/25/2023 16:23	COVEBASE	WOOD	B	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
785	10/25/2023 16:24	COVEBASE	WOOD	C	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
786	10/25/2023 16:24	COVEBASE	WOOD	D	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
787	10/25/2023 16:24	WINDOW SILL	WOOD	C	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
788	10/25/2023 16:25	WINDOW FRAME	WOOD	C	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
789	10/25/2023 16:26	DOOR	WOOD	D	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
790	10/25/2023 16:26	DOOR FRAME	WOOD	D	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
791	10/25/2023 16:26	DOOR FRAME	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
792	10/25/2023 16:26	DOOR	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
793	10/25/2023 16:27	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	WEST BEDROOM	UNIT B1	Negative	<LOD
794	10/25/2023 17:13	SHUTTER CAL								4.36
795	10/26/2023 9:26	SHUTTER CAL								4.66
796	10/26/2023 9:29	NIST	PAINT			RED		CALIBRATION	Positive	1.2
797	10/26/2023 9:30	NIST	PAINT			RED		CALIBRATION	Positive	1.1
798	10/26/2023 9:31	NIST	PAINT			RED		CALIBRATION	Positive	1.1
799	10/26/2023 10:23	CEILING	DRYWALL		INTACT	WHITE		LAUNDRY	Negative	<LOD
800	10/26/2023 10:23	WALL	DRYWALL	A	INTACT	WHITE		LAUNDRY	Negative	<LOD
801	10/26/2023 10:24	WALL	DRYWALL	B	INTACT	WHITE		LAUNDRY	Negative	<LOD
802	10/26/2023 10:24	WALL	DRYWALL	C	INTACT	WHITE		LAUNDRY	Negative	<LOD
803	10/26/2023 10:24	WALL	DRYWALL	D	INTACT	WHITE		LAUNDRY	Negative	<LOD
804	10/26/2023 10:25	DOOR	WOOD	A	INTACT	YELLOW		LAUNDRY	Negative	<LOD
805	10/26/2023 10:26	DOOR FRAME	WOOD	A	INTACT	YELLOW		LAUNDRY	Negative	<LOD
806	10/26/2023 10:26	DOOR FRAME	WOOD	A	INTACT	YELLOW		LAUNDRY	Negative	<LOD
807	10/26/2023 10:29	DOOR FRAME	WOOD	A	INTACT	WHITE	LIVING ROOM	UNIT C1	Negative	<LOD
808	10/26/2023 10:30	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT C1	Negative	<LOD
809	10/26/2023 10:30	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT C1	Negative	<LOD
810	10/26/2023 10:31	WALL	METAL	A	INTACT	TAN	LIVING ROOM	UNIT C1	Negative	<LOD
811	10/26/2023 10:31	WALL	METAL	B	INTACT	TAN	LIVING ROOM	UNIT C1	Negative	<LOD
812	10/26/2023 10:32	WALL	METAL	C	INTACT	TAN	LIVING ROOM	UNIT C1	Negative	<LOD
813	10/26/2023 10:32	WALL	METAL	C	INTACT	TAN	LIVING ROOM	UNIT C1	Negative	<LOD
814	10/26/2023 10:33	WALL	METAL	D	INTACT	TAN	LIVING ROOM	UNIT C1	Negative	<LOD
815	10/26/2023 10:34	CEILING	DRYWALL		INTACT	TAN	BATHROOM	UNIT C1	Negative	<LOD
816	10/26/2023 10:34	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT C1	Negative	<LOD
817	10/26/2023 10:34	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT C1	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
818	10/26/2023 10:35	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT C1	Negative	<LOD
819	10/26/2023 10:35	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT C1	Negative	<LOD
820	10/26/2023 10:35	DOOR	METAL	D	INTACT	WHITE	BATHROOM	UNIT C1	Negative	<LOD
821	10/26/2023 10:36	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT C1	Negative	<LOD
822	10/26/2023 10:38	COVEBASE	WOOD	A	INTACT	WHITE	BATHROOM	UNIT C1	Negative	<LOD
823	10/26/2023 10:39	COVEBASE	WOOD	B	INTACT	WHITE	BATHROOM	UNIT C1	Negative	<LOD
824	10/26/2023 10:39	COVEBASE	WOOD	C	INTACT	WHITE	BATHROOM	UNIT C1	Negative	<LOD
825	10/26/2023 10:39	COVEBASE	WOOD	D	INTACT	WHITE	BATHROOM	UNIT C1	Negative	<LOD
826	10/26/2023 10:40	COVEBASE	WOOD	D	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
827	10/26/2023 10:40	COVEBASE	WOOD	C	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
828	10/26/2023 10:40	COVEBASE	WOOD	B	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
829	10/26/2023 10:40	COVEBASE	WOOD	A	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
830	10/26/2023 10:41	CEILING	DRYWALL		INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
831	10/26/2023 10:41	CEILING	DRYWALL		INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
832	10/26/2023 10:41	CEILING	DRYWALL		INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
833	10/26/2023 10:42	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
834	10/26/2023 10:42	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
835	10/26/2023 10:42	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
836	10/26/2023 10:42	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
837	10/26/2023 10:43	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
838	10/26/2023 10:43	DOOR	METAL	D	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
839	10/26/2023 10:44	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM TWO	UNIT C1	Negative	<LOD
840	10/26/2023 10:44	CABINET	WOOD	B	INTACT	BROWN	KITCHEN	UNIT C1	Negative	<LOD
841	10/26/2023 10:45	CEILING	WOOD	B	INTACT	BROWN	KITCHEN	UNIT C1	Negative	<LOD
842	10/26/2023 10:45	CEILING	WOOD	B	INTACT	BROWN	KITCHEN	UNIT C1	Negative	<LOD
843	10/26/2023 10:46	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT C1	Negative	<LOD
844	10/26/2023 10:46	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT C1	Negative	<LOD
845	10/26/2023 10:47	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT C1	Negative	<LOD
846	10/26/2023 11:01	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT A10	Negative	<LOD
847	10/26/2023 11:02	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT A10	Negative	<LOD
848	10/26/2023 11:03	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT A10	Negative	<LOD
849	10/26/2023 11:03	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT A10	Negative	<LOD
850	10/26/2023 11:04	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT A10	Negative	<LOD
851	10/26/2023 11:05	DOOR	METAL	A	INTACT	YELLOW	LIVING ROOM	UNIT A10	Negative	<LOD
852	10/26/2023 11:05	DOOR FRAME	WOOD	A	INTACT	YELLOW	LIVING ROOM	UNIT A10	Negative	<LOD
853	10/26/2023 11:07	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT A10	Negative	<LOD
854	10/26/2023 11:08	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT A10	Negative	<LOD
855	10/26/2023 11:08	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT A10	Negative	<LOD
856	10/26/2023 11:08	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT A10	Negative	<LOD
857	10/26/2023 11:08	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT A10	Negative	<LOD
858	10/26/2023 11:09	WALL	DRYWALL	D	INTACT	TAN	KITCHEN	UNIT A10	Negative	<LOD
859	10/26/2023 11:09	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A10	Negative	<LOD
860	10/26/2023 11:10	CABINET	WOOD	A	INTACT	BROWN	KITCHEN	UNIT A10	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
861	10/26/2023 11:11	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT A10	Negative	<LOD
862	10/26/2023 11:11	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT A10	Negative	<LOD
863	10/26/2023 11:12	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT A10	Negative	<LOD
864	10/26/2023 11:12	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT A10	Negative	<LOD
865	10/26/2023 11:12	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT A10	Negative	<LOD
866	10/26/2023 11:13	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A10	Negative	<LOD
867	10/26/2023 11:13	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT A10	Negative	<LOD
868	10/26/2023 11:16	CEILING	DRYWALL		INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
869	10/26/2023 11:16	WALL	DRYWALL	A	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
870	10/26/2023 11:17	WALL	DRYWALL	B	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
871	10/26/2023 11:17	WALL	DRYWALL	C	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
872	10/26/2023 11:18	WALL	DRYWALL	D	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
873	10/26/2023 11:20	WINDOW SILL	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
874	10/26/2023 11:20	WINDOW SILL	WOOD	C	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
875	10/26/2023 11:20	DOOR	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
876	10/26/2023 11:21	DOOR FRAME	WOOD	B	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
877	10/26/2023 11:22	CLOSET DOOR FRAME	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
878	10/26/2023 11:22	CLOSET DOOR	WOOD	A	INTACT	WHITE	EAST BEDROOM	UNIT A10	Negative	<LOD
879	10/26/2023 11:25	SHUTTER CAL								4.82
880	10/26/2023 11:28	NIST	PAINT			RED		CALIBRATION	Positive	1.2
881	10/26/2023 11:29	NIST	PAINT			RED		CALIBRATION	Positive	1.2
882	10/26/2023 11:29	NIST	PAINT			RED		CALIBRATION	Negative	1
883	10/26/2023 11:29	NIST	PAINT			RED		CALIBRATION	Positive	1.2
884	10/26/2023 11:32	CEILING	DRYWALL		INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
885	10/26/2023 11:32	CEILING	DRYWALL		INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
886	10/26/2023 11:33	WALL	DRYWALL	A	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
887	10/26/2023 11:33	WALL	DRYWALL	B	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
888	10/26/2023 11:34	WALL	DRYWALL	C	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
889	10/26/2023 11:34	WALL	DRYWALL	D	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
890	10/26/2023 11:34	DOOR	WOOD	A	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
891	10/26/2023 11:34	DOOR	WOOD	A	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
892	10/26/2023 11:35	DOOR FRAME	WOOD	A	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
893	10/26/2023 11:36	CLOSET ROLL DOOR	WOOD	B	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
894	10/26/2023 11:36	WINDOW SILL	WOOD	C	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
895	10/26/2023 11:37	WINDOW SILL	WOOD	C	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
896	10/26/2023 11:37	WINDOW FRAME	WOOD	C	INTACT	TAN	NORTH BEDROOM	UNIT A10	Negative	<LOD
897	10/26/2023 11:47	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B7	Negative	<LOD
898	10/26/2023 11:47	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT B7	Negative	<LOD
899	10/26/2023 11:48	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT B7	Negative	<LOD
900	10/26/2023 11:48	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT B7	Negative	<LOD
901	10/26/2023 11:48	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT B7	Negative	<LOD
902	10/26/2023 11:49	WAINSCOT	DRYWALL	D	INTACT	WHITE	LIVING ROOM	UNIT B7	Negative	<LOD
903	10/26/2023 11:49	WAINSCOT	DRYWALL	C	INTACT	WHITE	LIVING ROOM	UNIT B7	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
904	10/26/2023 11:50	WAINSCOT	DRYWALL	B	INTACT	WHITE	LIVING ROOM	UNIT B7	Negative	<LOD
905	10/26/2023 11:50	WAINSCOT	DRYWALL	A	INTACT	WHITE	LIVING ROOM	UNIT B7	Negative	<LOD
906	10/26/2023 11:51	DOOR	METAL	D	INTACT	YELLOW	LIVING ROOM	UNIT B7	Negative	<LOD
907	10/26/2023 11:52	DOOR FRAME	WOOD	D	INTACT	WHITE	LIVING ROOM	UNIT B7	Negative	<LOD
908	10/26/2023 11:53	CEILING	DRYWALL		INTACT	TAN	KITCHEN	UNIT B7	Negative	<LOD
909	10/26/2023 11:53	CEILING	DRYWALL		INTACT	TAN	KITCHEN	UNIT B7	Negative	<LOD
910	10/26/2023 11:54	WALL	DRYWALL	A	INTACT	TAN	KITCHEN	UNIT B7	Negative	<LOD
911	10/26/2023 11:54	WALL	DRYWALL	B	INTACT	TAN	KITCHEN	UNIT B7	Negative	<LOD
912	10/26/2023 11:54	WALL	DRYWALL	C	INTACT	TAN	KITCHEN	UNIT B7	Negative	<LOD
913	10/26/2023 11:54	WALL	DRYWALL	D	INTACT	TAN	KITCHEN	UNIT B7	Negative	<LOD
914	10/26/2023 11:54	CEILING	DRYWALL		INTACT	TAN	BATHROOM	UNIT B7	Negative	<LOD
915	10/26/2023 11:56	WALL	DRYWALL	A	INTACT	TAN	BATHROOM	UNIT B7	Negative	<LOD
916	10/26/2023 11:56	WALL	DRYWALL	B	INTACT	TAN	BATHROOM	UNIT B7	Negative	<LOD
917	10/26/2023 11:56	WALL	DRYWALL	C	INTACT	TAN	BATHROOM	UNIT B7	Negative	<LOD
918	10/26/2023 11:56	WALL	DRYWALL	D	INTACT	TAN	BATHROOM	UNIT B7	Negative	<LOD
919	10/26/2023 11:57	DOOR	WOOD	D	INTACT	WHITE	BATHROOM	UNIT B7	Negative	<LOD
920	10/26/2023 11:57	DOOR FRAME	WOOD	D	INTACT	WHITE	BATHROOM	UNIT B7	Negative	<LOD
921	10/26/2023 11:58	CEILING	DRYWALL		INTACT	TAN	BEDROOM	UNIT B7	Negative	<LOD
922	10/26/2023 11:58	WALL	DRYWALL	A	INTACT	TAN	BEDROOM	UNIT B7	Negative	<LOD
923	10/26/2023 11:59	WALL	DRYWALL	B	INTACT	TAN	BEDROOM	UNIT B7	Negative	<LOD
924	10/26/2023 11:59	WALL	DRYWALL	C	INTACT	TAN	BEDROOM	UNIT B7	Negative	<LOD
925	10/26/2023 12:00	WALL	DRYWALL	D	INTACT	TAN	BEDROOM	UNIT B7	Negative	<LOD
926	10/26/2023 12:00	DOOR	WOOD	A	INTACT	WHITE	BEDROOM	UNIT B7	Negative	<LOD
927	10/26/2023 12:01	DOOR FRAME	WOOD	A	INTACT	WHITE	BEDROOM	UNIT B7	Negative	<LOD
928	10/26/2023 12:01	WINDOW SILL	WOOD	A	INTACT	WHITE	BEDROOM	UNIT B7	Negative	<LOD
929	10/26/2023 12:01	WINDOW FRAME	WOOD	A	INTACT	WHITE	BEDROOM	UNIT B7	Negative	<LOD
930	10/26/2023 12:02	CEILING	DRYWALL		INTACT	TAN	LIVING ROOM	UNIT B6	Negative	<LOD
931	10/26/2023 12:08	WALL	DRYWALL	A	INTACT	TAN	LIVING ROOM	UNIT B6	Negative	<LOD
932	10/26/2023 12:09	WALL	DRYWALL	B	INTACT	TAN	LIVING ROOM	UNIT B6	Negative	<LOD
933	10/26/2023 12:09	WALL	DRYWALL	C	INTACT	TAN	LIVING ROOM	UNIT B6	Negative	<LOD
934	10/26/2023 12:10	WALL	DRYWALL	D	INTACT	TAN	LIVING ROOM	UNIT B6	Negative	<LOD
935	10/26/2023 12:10	DOOR	METAL	B	INTACT	YELLOW	LIVING ROOM	UNIT B6	Negative	<LOD
936	10/26/2023 12:11	DOOR	METAL	B	INTACT	YELLOW	LIVING ROOM	UNIT B6	Negative	<LOD
937	10/26/2023 12:11	DOOR FRAME	WOOD	B	INTACT	WHITE	LIVING ROOM	UNIT B6	Negative	<LOD
938	10/26/2023 12:12	CEILING	DRYWALL		INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
939	10/26/2023 12:13	WALL	DRYWALL	A	INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
940	10/26/2023 12:14	WALL	DRYWALL	B	INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
941	10/26/2023 12:14	WALL	DRYWALL	C	INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
942	10/26/2023 12:14	WALL	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
943	10/26/2023 12:15	WINDOW FRAME	DRYWALL	D	INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
944	10/26/2023 12:15	WINDOW SILL	WOOD	D	INTACT	WHITE	KITCHEN	UNIT B6	Negative	<LOD
945	10/26/2023 12:16	CABINET	WOOD	C	INTACT	BROWN	KITCHEN	UNIT B6	Negative	<LOD
946	10/26/2023 12:17	CEILING	DRYWALL		INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD

Reading No.	Time	Component	Substrate	Side	Condition	Color	Room	Unit	Result	Lead mg/cm2
947	10/26/2023 12:18	WALL	DRYWALL	A	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
948	10/26/2023 12:19	WALL	DRYWALL	B	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
949	10/26/2023 12:19	WALL	DRYWALL	C	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
950	10/26/2023 12:19	WALL	DRYWALL	D	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
951	10/26/2023 12:20	DOOR	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
952	10/26/2023 12:20	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
953	10/26/2023 12:21	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
954	10/26/2023 12:21	DOOR FRAME	WOOD	B	INTACT	WHITE	BATHROOM	UNIT B6	Negative	<LOD
955	10/26/2023 12:21	CEILING	DRYWALL		INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
956	10/26/2023 12:26	WALL	DRYWALL	A	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
957	10/26/2023 12:27	WALL	DRYWALL	B	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
958	10/26/2023 12:27	WALL	DRYWALL	C	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
959	10/26/2023 12:27	WALL	DRYWALL	D	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
960	10/26/2023 12:28	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
961	10/26/2023 12:29	WINDOW SILL	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
962	10/26/2023 12:29	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
963	10/26/2023 12:30	WINDOW FRAME	WOOD	C	INTACT	WHITE	NORTH BEDROOM	UNIT B6	Negative	<LOD
964	10/26/2023 12:30	CEILING	DRYWALL		INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
965	10/26/2023 12:31	WINDOW	DRYWALL	A	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
966	10/26/2023 12:31	WINDOW	DRYWALL	B	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
967	10/26/2023 12:32	WINDOW	DRYWALL	C	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
968	10/26/2023 12:32	WINDOW	DRYWALL	D	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
969	10/26/2023 12:32	WINDOW SILL	WOOD	C	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
970	10/26/2023 12:33	WINDOW FRAME	WOOD	C	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
971	10/26/2023 12:33	DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
972	10/26/2023 12:33	DOOR FRAME	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
973	10/26/2023 12:34	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
974	10/26/2023 12:34	CLOSET ROLL DOOR	WOOD	A	INTACT	WHITE	SOUTH BEDROOM	UNIT B6	Negative	<LOD
975	10/26/2023 12:34	PICNIC TABLE	WOOD		INTACT	BLUE	OUTSIDE		Negative	<LOD
976	10/26/2023 12:37	SHUTTER CAL								4.38
977	10/26/2023 16:48	SHUTTER CAL								
978	10/27/2023 10:29	NIST	PAINT			RED		CALIBRATION	Positive	1.04
979	10/27/2023 10:30	NIST	PAINT			RED		CALIBRATION	Positive	1.11
980	10/27/2023 10:31	NIST	PAINT			RED		CALIBRATION	Positive	1.06
981	10/27/2023 10:36	CEILING	DRYWALL			WHITE	LIVING ROOM	UNIT A15	Negative	<LOD
982	10/27/2023 10:37	CEILING	DRYWALL			WHITE	BATHROOM	UNIT B15	Negative	<LOD
983	10/27/2023 10:38	CEILING	DRYWALL			WHITE	WEST BEDROOM	UNIT B15	Negative	<LOD
984	10/27/2023 10:39	CEILING	DRYWALL			WHITE	LIVING ROOM	UNIT B4	Negative	<LOD
985	10/27/2023 10:40	CEILING	DRYWALL			WHITE	NORTH BEDROOM	UNIT B4	Negative	<LOD
986	10/27/2023 10:41	CEILING	DRYWALL			WHITE	LIVING ROOM	UNIT B8	Negative	<LOD
987	10/27/2023 10:43	WALL	DRYWALL	A		WHITE	LIVING ROOM	UNIT A10	Negative	<LOD
988	10/27/2023 10:44	WALL	DRYWALL	B		WHITE	NORTH BEDROOM	UNIT A10	Negative	<LOD



XRF CALIBRATION CHECK TEST RESULTS

XRF Serial No.: 18121 Date: Oct 24, 2023
 Address/Unit Number: 4028 S 146th St Tukwila
 Device: XLp 300A
 Contractor: PBS
 Inspector Name: Janet Murphy Signature: Janet Murphy
 NIST SRM used: SMR 2573 mg/cm² Calibration Check tolerance used: 1.04 mg/cm² + 0.06
- 0.06

FIRST CALIBRATION CHECK: Oct 24 2023

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
#12 1.1	#13 1.1	#14 1.5	1.2	0.16

SECOND CALIBRATION CHECK: Oct 24, 2023

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
# 216 1.5	#217 1.2	#219 1.1	1.26	0.22

THIRD CALIBRATION CHECK (IF REQUIRED): Oct 25, 2023

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
#382 1.1	#383 1.2	384 1.2	1.16	0.12

FOURTH CALIBRATION CHECK (IF REQUIRED): Oct 25, 2023

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
#535 1.1	536 1.2	537 1.1	1.13	0.09

* If the difference of the Calibration Check Average from the NIST SRM film value is greater than the specified Calibration Check tolerance for this device, consult the manufacturer's recommendations to bring the instrument back into control. Retest all testing combinations tested since the last successful Calibration Check test.



XRF CALIBRATION CHECK TEST RESULTS

XRF Serial No.: 18121 Date: Oct 26, 2023
 Address/Unit Number: 4028 S. 146th St Tukwila
 Device: XLP 300A
 Contractor: PBS
 Inspector Name: Janet Murphy Signature: Janet Murphy

NIST SRM used: SMR 2573 mg/cm² Calibration Check tolerance used: 1.04 ^{+ 0.06} _{- 0.06} mg/cm²

FIRST CALIBRATION CHECK: Oct 25

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
# 796 1.2	# 797 1.1	# 798 1.1	1.13	0.09

SECOND CALIBRATION CHECK: Oct 26

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
# 880 1.2	# 881 1.2	# 883 1.2	1.2	0.16

THIRD CALIBRATION CHECK (IF REQUIRED):

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		
# 978 1.1	# 979 1.2	# 980 1.1	1.13	0.09

FOURTH CALIBRATION CHECK (IF REQUIRED):

NIST SRM			First Average	Difference Between First Average and NIST SRM*
First Reading	Second Reading	Third Reading		

* If the difference of the Calibration Check Average from the NIST SRM film value is greater than the specified Calibration Check tolerance for this device, consult the manufacturer's recommendations to bring the instrument back into control. Retest all testing combinations tested since the last successful Calibration Check test.

TAB 2
Certifications

STATE OF WASHINGTON

Department of Commerce
Lead-Based Paint Abatement Program

Janet J Murphy

*Has fulfilled the certification requirements of
WAC 365-230
and has been certified to conduct lead-based
paint activities as a
Risk Assessor*

<u>Certification #</u>	<u>Issuance Date</u>	<u>Expiration Date</u>
0258	12/22/2021	03/08/2025

STATE OF WASHINGTON

Department of Commerce

Lead-Based Paint Abatement Firm

PBS Engineering & Environmental Inc.

*Has fulfilled the certification requirements of
WAC 365-230
and has been certified to conduct lead-based
paint activities.*

Certification #

178

Issuance Date

09/12/2022

Expiration Date

09/03/2025